



U.S. Department
of Transportation

**National Highway
Traffic Safety
Administration**

400 Seventh Street, S.W.
Washington, D.C. 20590

Dear Crash Data Researchers/Users:

Thank you for choosing crash data from the National Highway Traffic Safety Administration (NHTSA) for your research or other use. The information contained in this motor vehicle crash report is collected, maintained and distributed in accordance with Public Law 89-564. In accordance with this Public Law, NHTSA is required not to release any case information until completion of quality control procedures. These procedures include a review of the case material to extract all names, licenses and registration numbers, non-coded interview material, non-research related researcher comments in the margins, non-factual data, and the production number portion of the vehicle identification number (VIN).

If you requested NHTSA to query its database files in order to identify a specific crash, then that query was made using non-personal descriptors you provided for use in our search. This motor vehicle crash may have been identified from a data search and matches the general, non-personal descriptors you provided, but we cannot confirm that this is the specific crash report you requested.

If you have any questions with regard to the above procedures, please contact the Field Operations Branch, Crash Investigation Division, National Center for Statistics and Analysis at 202-366-4820. Again, please be advised that we cannot confirm that this is the case that you have specifically requested nor can we certify the information to be correct.

*** *** ***



AUTO SAFETY HOTLINE
(800) 424-9393
Wash. D.C. Area 366-0123

Case Vehicle (A): 1998 Ford
Type: F-150 XLT Super cab 4 x 2, 3-door pickup
Driver: 43-year-old female
CDC: 01-FDEW-3

Veh. (B): 1989 Ford
Type: Festiva LX, 2-door hatchback
Driver: 17-year-old female
CDC: 12-FDEW-3

SITUATION

This is a fatal crash; the driver of vehicle (B) was pronounced dead at the scene.

(Slide 1) It was daylight, the skies were clear, and (slide 2) the four-lane, asphalt surface was dry and free of defects. Case vehicle (A) was traveling north at a unknown speed in the left northbound lane. Vehicle (B) was traveling south in the right southbound lane. Vehicle (X) was stopped facing west on a three-lane asphalt road that intersects with the north-south 4-lane road. As case vehicle (A) and vehicle (B) approached the intersection of the two roads, vehicle (X) pulled out into the northbound lanes and stopped in the path of case vehicle (A). The driver of case vehicle (A) steered to the left into the southbound lane to avoid striking vehicle (X). The driver of vehicle (B) was unable to take any evasive maneuvers, and the front of case vehicle (A) struck the front of vehicle (B), resulting in significant underride to the front of case vehicle (A) and override to the front of vehicle (B). The driver of vehicle (B) died at the scene. The right-front passenger of vehicle (B) was flown to a local area hospital and was treated for life-threatening injuries. The driver, right-front, center-rear, and right-rear passengers of case vehicle (A) did not report any injuries.

GENERAL VEHICLE DAMAGE AND ESTIMATED CRASH SEVERITIES

(Slide 3) Direct damage to case vehicle (A) began at the right-front bumper corner and extended 130 cm to the left across the front, resulting in 70-percent vehicle overlap. (Slide 4) The maximum crush was 57 cm to the right-front bumper.

(Slide 5) Damage to vehicle (B) was severe. (Slide 6) The direct damage to vehicle (B) began at the left-front bumper corner and extended 84 cm to the right. (Slide 7) The maximum crush was 51 cm to the left-front bumper. The left wheelbase was reduced 18 cm and the right wheelbase was reduced 5 cm. (Slide 8) Rescue personnel cut the upper A- and B-pillars to remove the roof, the hatchback, and (slide 9) the left door in order to extricate the occupants.

Using the WinSMASH accident-reconstruction program, and (slides 10, 11, 12 and 13) crush profiles measured for case vehicle (A) and (slides 14, 15, 16 and 17) vehicle (B), the impact severities shown in the following table were calculated:

Vehicle	Variable	Calculated Velocity Change - kph (mph)		
		Total	Longitudinal	Latitudinal
Case Vehicle (A)	delta V	33 (20)	-31 (-19)	-11 (-7)
Vehicle (B)	delta V	72 (45)	-71 (-44)	12 (8)

DESCRIPTION OF DAMAGE TO CASE VEHICLE (A)

Exterior

(Slide 18) Damage to case vehicle (A) was moderate. In the front, (slide 19) the right headlight assembly, the bumper, the grille, the hood, the hood latch, and the right hood hinge were damaged. The right bumper corner was shifted 41 cm to the left, and the left bumper corner was shifted 25 cm to the left. The hood latch was damaged and jammed closed, but had been pried open by rescue or tow yard personnel. The hood was buckled and the rear edge of the hood was slightly elevated, but it did not contact the windshield. (Slide 20) There was a stress crack along the right-lower portion of the windshield. (Slide 21) The right upper and lower radiator supports were pushed rearward and to the left.

On the right side, (slide 22) the fender and front wheel were damaged, and (slides 23 and 24) the wheelbase was reduced 11 cm. On the left side, (slide 25) the fender was deformed, and (slide 26) the wheelbase was reduced 5 cm. There was no damage to the rear of the vehicle.

Interior

This vehicle was equipped with steering-wheel and passenger frontal-impact airbags, and (slides 27 and 28) both deployed. (Slide 29) The right-rear portion of the steering-wheel airbag fabric was burned and melted. (Slides 30, 31, 32 and 33) The upper flap of the steering-wheel airbag module cover was deformed, (slides 34 and 35) and there was a scuff mark on the lower flap. (Slides 36 and 37) There was no damage to the passenger airbag module cover, (slide 38) but there was a scuff mark on the upper left edge. (Slide 39) There was no damage to the steering-wheel rim or (slide 40) spokes. (Slide 41) The plastic knee bolster cover, (slide 42) upper vent outlets, (slide 43) right-front door panel, and (slide 44) front-seat center armrest were damaged.

(Slide 45) The rear-view mirror was cracked. (Slides 46, 47, 48 , 49, 50, 51, 52, 53, 54, 55 and 56) There were no intrusions and no other interior damage.

OCCUPANT KINEMATICS AND INJURIES

(Slide 57) The 5-ft, 2-in, 150-lb, 43-year-old female driver was wearing the three-point belt and the (slide 58) frontal-impact airbag deployed. (Slide 59) There was only a slight webbing imprint on the plastic D-ring, (slide 60) but plastic transferred to belt webbing from the continuous loop and (slide 61) a webbing imprint on the continuous loop indicate belt use at the time of the crash. (Slide 62) There was also yellow mark of unknown origin on the shoulder belt webbing. The driver had reportedly positioned the seat in the forward seat-track position, had positioned the seatback in an upright position, and had adjusted the shoulder belt anchor point in the full-up position.

On impact, the driver moved forward relative to the vehicle interior into the belt restraint and airbag. The upper airbag module cover may have contacted her right arm or chest, (slide 63) as evidenced by the deformed upper airbag module cover and (slide 64) a scuff mark on the lower airbag module cover, but no injuries were reported from this contact. Her left knee contacted the knee bolster below the steering column, (slide 65) as evidenced by a 12-by-12 cm scuff mark, and her right knee probably contacted the knee bolster, (slide 66) as evidenced by the 15-by-16 cm scuff mark, but no knee injuries were reported. (Slide 67) There were scuff marks on the upper vent outlet and center instrument cluster, but these are possibly transfer marks from the passenger-side frontal-impact airbag. The driver did not report any injuries in this crash.

(Slide 68) The 5-ft, 6-in, 135-lb, 14-year-old male, right-front passenger was wearing the three-point belt and the frontal-impact airbag deployed. He reportedly had the seat positioned in the most rearward seat-track position and had the seatback in an upright position. The adjustable shoulder belt anchor point was in the full-down position. (Slide 69) There were webbing imprints on the plastic D-ring and (slide 70) continuous loop, indicating belt use at the time of the crash. (Slide 71) There was an unknown substance on the belt webbing.

On impact, the right-front passenger moved forward into the belt restraint and airbag, and his knees probably contacted the glove box area, (slides 72 and 73) as evidenced by a patterned 12-by 2 cm scuff mark on the upper portion of the glove box door. His lower leg and/or foot

contacted the lower portion of the glove box, (slide 74) as indicated by a 24-by-9 cm scuff mark on the lower portion of the glove compartment door and a 9-by-3 cm scuff mark on the heater/AC duct. His right knee probably contacted the right-front door panel, (slides 75 and 76) as evidenced by a scuff mark just forward of the stereo speaker. His right arm or right side may have contacted the right-front door armrest and hardware, (slide 77) as indicated by scuff marks on the handle and armrest. (Slide 78) There was also a witness mark on the seat headrest and (slide 79) blood on the seat cushion. In spite of these possible contacts, the right-front passenger reportedly did not sustain any injuries.

(Slide 80) The 4-ft, 5-in, 71-lb, 11-year-old male, center-rear passenger was wearing the available lap belt, as indicated by (slide 81) a plastic transfer mark on the belt webbing. Also, (slide 82) the general condition of the belt webbing indicates regular belt use. On impact, he moved forward relative to the vehicle interior and his head or arms contacted the front-seat center console/armrest, (slides 83 and 84) as evidenced by scuff marks along the upper edge. However, he did not sustain any injuries.

(Slide 85) The 4-ft, 5-in, 71-lb, 10-year-old male, right-rear passenger was wearing the three-point belt, as indicated by (slides 86 and 87) webbing imprints on the plastic D-ring and continuous loop. On impact, he moved forward into the three-point belt and was reportedly uninjured.

The following tables and attached drawings (slides 88, 89, 90 and 91) summarize the information and absence of injuries for the four occupants of the case vehicle (A).

Occupant: Driver
Restraints: 3-point belt worn, airbag deployed

Age: 43 years
Stature: 157 cm (5 ft, 2 in)

Sex: Female
Mass: 68 kg (150 lb)

Injury Description	A.I.S.	Injury Source		
		Definite	Probable	Possible
No reported injury	0			
<u>Maximum A.I.S. Level</u>	<u>0</u>			
<u>Injury Severity Score</u>	<u>0</u>			

Occupant: Right front
Restraints: 3-point belt worn; airbag deployed

Age: 14 years
Stature: 160 cm (5 ft, 3 in)

Sex: Male
Mass: 51 kg (112 lb)

Injury Description	A.I.S.	Injury Source		
		Definite	Probable	Possible
No reported injury	0			
<u>Maximum A.I.S. Level</u>	<u>0</u>			
<u>Injury Severity Score</u>	<u>0</u>			

Occupant: Center rear
Restraints: Lap belt worn

Age: 11 years
Stature: 135 cm (4 ft, 5 in)

Sex: Male
Mass: 32 kg (71 lb)

Injury Description	A.I.S.	Injury Source		
		Definite	Probable	Possible
No reported injury				
<u>Maximum A.I.S. Level</u>	<u>0</u>			
<u>Injury Severity Score</u>	<u>0</u>			

Occupant: Right rear
Restraints: 3-point belt worn

Age: 10 years
Stature: 135 cm (4 ft, 5 in)

Sex: Male
Mass: 32 kg (71 lb)

Injury Description	A.I.S.	Injury Source		
		Definite	Probable	Possible
No reported injury				
<u>Maximum A.I.S. Level</u>	<u>0</u>			
<u>Injury Severity Score</u>	<u>0</u>			

Duplicate columns 1-8
from the previous card.

Module G 1 Format 0 2
9 10 11 12

GENERAL INFORMATION GI-1

TIME

DATE OF COLLISION

 / /
m m d d y y y y

HOUR OF COLLISION

(24 HOUR CLOCK)

21 24

ENVIRONMENTAL CONDITIONS

CONSTRUCTION ZONE

- (0) NO
(1) YES
(9) UNKNOWN

0
33

ROAD ALIGNMENT
VERTICAL PLANE

- (1) LEVEL
(2) CREST OF HILL
(3) SLOPE (2%)
(4) BOTTOM OF HILL
(9) UNKNOWN

1
34

ROAD ALIGNMENT
HORIZONTAL PLANE

- (1) STRAIGHT
(2) CURVE
(3) T - SHAPED
(4) Y - SHAPED
(7) OTHER: _____
(9) UNKNOWN

1
35

SURFACE COVERING

- (10) DRY

(21) WATER - DAMP
(22) WATER - WET
(23) WATER - PUDDLED
(29) WATER - AMOUNT UNKNOWN

(31) SNOW - LOOSE
(32) SNOW - PACKED
(39) SNOW - CONDITION UNKNOWN

(41) ICE
(51) SLUSH
(61) SPILLED GRAVEL
(71) OTHER: _____
(99) UNKNOWN

10
36 37

VISIBILITY LIMITATION
(FOR CASE VEHICLE)

- (0) NONE
(1) CLOUDY/DARK
(2) FOG
(3) SMOKE
(4) WINDSHIELD CONDITION
(5) GLARE
(6) RAIN
(7) OTHER: _____
(8) ICE/SNOW
(9) UNKNOWN

0
38

VISIBILITY OBSTRUCTION
(FOR CASE VEHICLE)

- (0) NONE
(1) BUILDING
(2) SIGN
(3) VEGETATION (E.G. BUSHES, SHRUBS)
(4) TREE
(5) HILL OR CURVE IN ROAD
(6) VEHICLE IN TRANSPORT
(7) OTHER: _____
(8) PARKED VEHICLE
(9) UNKNOWN

0
39

LOCATION

STATE: _____

STATE FIPS CODE

25 26

AREA

- (1) URBAN
(2) RURAL
(9) UNKNOWN

1
27

ENVIRONMENTAL CONDITIONS

LIMITED-ACCESS HIGHWAY

- (0) NO
(1) YES
(9) UNKNOWN

0
28

ROAD, TOTAL TRAFFIC LANES
(FOR CASE VEHICLE)

- (1) 1-LANE
(2) 2-LANES
(3) 3-LANES
(4) 4 OR MORE LANES
(5) DIVIDED, 4 OR MORE LANES
(6) PARKING LOT/DRIVEWAY
(7) OTHER: _____
(9) UNKNOWN

4
29

INTERSECTING RD, TOTAL LANES
CHOOSE FROM ABOVE LIST, OR

- (8) NOT APPLICABLE

3
30

TYPE OF ROAD SURFACE

- (1) ASPHALT
(2) CONCRETE
(3) GRAVEL
(4) MORE THAN ONE (CIRCLE EACH)
(7) OTHER: _____
(9) UNKNOWN

1
31

ROAD DEFECTS

- (0) NO
(1) YES
(9) UNKNOWN

0
32

ENVIRONMENTAL CONDITIONS

SPEED LIMIT

- | | | |
|-----|-----------------|----------|
| (0) | 5-45 km/h | 5-25 mph |
| (1) | 46-55 | 30 |
| (2) | 56-60 | 35 |
| (3) | 61-70 | 40 |
| (4) | 71-79 | 45 |
| (5) | 80-85 | 50 |
| (6) | 86-90 | 55 |
| (7) | 91-105 | 60 |
| (8) | OVER 105 | 65 |
| (9) | UNKNOWN | |

5
—
40

PRECIPITATION

- (0) NONE
(1) RAIN
(2) SNOW
(3) HAIL
(4) FREEZING RAIN/SLEET
(7) OTHER: _____
(9) UNKNOWN

0
41

RATE OF PRECIPITATION

- (1) LIGHT/MIST
(2) MODERATE
(3) HEAVY
(8) NOT APPLICABLE
(9) UNKNOWN

8
42

TEMPERATURE

- (0) BELOW -15° C BELOW 5° F
(1) -15 TO -6 5 TO 22
(2) -5 TO -1 23 TO 31
(3) 0 TO 2 32 TO 36
(4) 3 TO 5 37 TO 41
(5) 6 TO 15 42 TO 59
(6) 16 TO 25 60 TO 77
(7) 26 TO 35 78 TO 95
(8) OVER 35 OVER 96
(9) UNKNOWN

2
43

CROSSWIND

- (0) NONE
(1) LIGHT
(2) STRONG
(3) GUSTY & STRONG
(9) UNKNOWN

$$\frac{1}{44}$$

LIGHT CONDITIONS

- (1) DAYLIGHT
- (2) DAWN
- (3) DUSK
- (4) DARK, LIGHTED
- (5) DARK, UNLIGHTED
- (6) DARK, UNKNOWN IF LIGHTED
- (9) UNKNOWN

1
45

MECHANICAL MALFUNCTION

WAS THERE MENTION
OF A MECHANICAL MALFUNCTION
IN CASE VEHICLE

- (0) NO
(1) YES
(2) YES, DID NOT CONTRIBUTE
 TO ACCIDENT
(9) UNKNOWN

0
46

**THE FOLLOWING SECTION SHOULD BE FILLED
OUT IF A MECHANICAL MALFUNCTION IS
RECOGNIZED OR SUSPECTED.**

CIRCLE ITEMS INVOLVED. SUPPORT ANY
ITEMS CIRCLED WITH COMMENTS.

BRAKE SYSTEM

DRIVER CONTROLS

EXHAUST SYSTEM

POWER TRAIN

STEERING SYSTEM

FUEL SYSTEM

SUSPENSION SYSTEM

VISIBILITY ITEMS

ELECTRICAL SYSTEM

TIRES

THROTTLE CONTROLS

UNKNOWN

OTHER: _____

COMMENTS:

GENERAL INFORMATION GI-3

CRASH DETAILS

CASE VEHICLE AND OBJECT

- (0) NO
(1) YES
(9) UNKNOWN

0
47

CASE VEHICLE ROLLOVER

- (0) NO ROLLOVER
(1) YES, FIRST EVENT
(2) YES, SUBSEQUENT EVENT
(3) YES, SEQUENCE UNKNOWN
(9) UNKNOWN

0
48

HIGHEST POLICE INJURY
SEVERITY CODE IN CRASH
(NOT JUST CASE VEHICLE)

- (0) O - NO INJURY
(1) C - POSSIBLE INJURY
(2) B - NON-INCAPACITATING INJURY
(3) A - INCAPACITATING INJURY
(4) K - FATAL
(5) INJURED, SEVERITY UNKNOWN
(6) DIED PRIOR TO ACCIDENT
(7) NON-FATAL INJURY
SEVERITY UNKNOWN
(9) UNKNOWN

4
55

CASE VEHICLE RAN OFF ROADWAY
(BEFORE FIRST IMPACT)

- (0) NO
(1) YES
(9) UNKNOWN

0
49

DRIVER IMPAIRMENT

DRIVER ALCOHOL INVOLVEMENT
(CASE VEHICLE)

- (0) NONE
(1) YES
(9) UNKNOWN/NOT REPORTED/
NO DRIVER

0
56

MOVING CASE VEHICLE AND
CONTACTED MOVING VEHICLE

- (0) NO
(1) YES
(9) UNKNOWN

1
50

DRIVER ALCOHOL BAC
(CASE VEHICLE)

- (80) NO TEST
(90) CHEMICAL TESTS, NO RESULTS
(95) AUTOPSY, NO RESULTS
(99) UNKNOWN

80
57 58

CASE VEHICLE AND
CONTACTED STOPPED VEHICLE

- (0) NO
(1) YES
(9) UNKNOWN

0
51

WAS THERE MENTION OF DRIVER
IMPAIRMENT FOR CASE VEHICLE?

- (0) NO
(1) YES
(9) UNKNOWN

0
59

STOPPED CASE VEHICLE AND
CONTACTED VEHICLE

- (0) NO
(1) YES
(9) UNKNOWN

0
52

LIST IMPAIRMENTS MENTIONED:

TOTAL NUMBER
OF VEHICLES CONTACTED
BY CASE VEHICLE IN CRASH

- (8) 8 OR MORE
(9) UNKNOWN

1
53

Post - CRASH DETAIL

MANNER CASE VEHICLE
LEFT SCENE

- (1) DRIVEN
(2) TOWED DUE TO DAMAGE
(3) TOWED, NOT DUE TO DAMAGE
(4) TOWED, REASON UNKNOWN
(9) UNKNOWN

2
60

ANY FIRE IN THIS CRASH
(NOT JUST CASE VEHICLE)

- (0) NO
(1) YES
(9) UNKNOWN

0
54


ACCIDENT SCHEMATIC

ACCIDENT DESCRIPTION: Case vehicle (A) was traveling north and vehicle (B) was traveling south on the same road. Vehicle (X) was stopped facing west on a side road and pulled out into the path of case vehicle (A) and stopped.

CASE VEHICLE (A): 1998 Ford F-150 Pickup
 OTHER VEHICLE (B): 1989 Ford Festiva
 THIRD VEHICLE (C): _____



NORTH

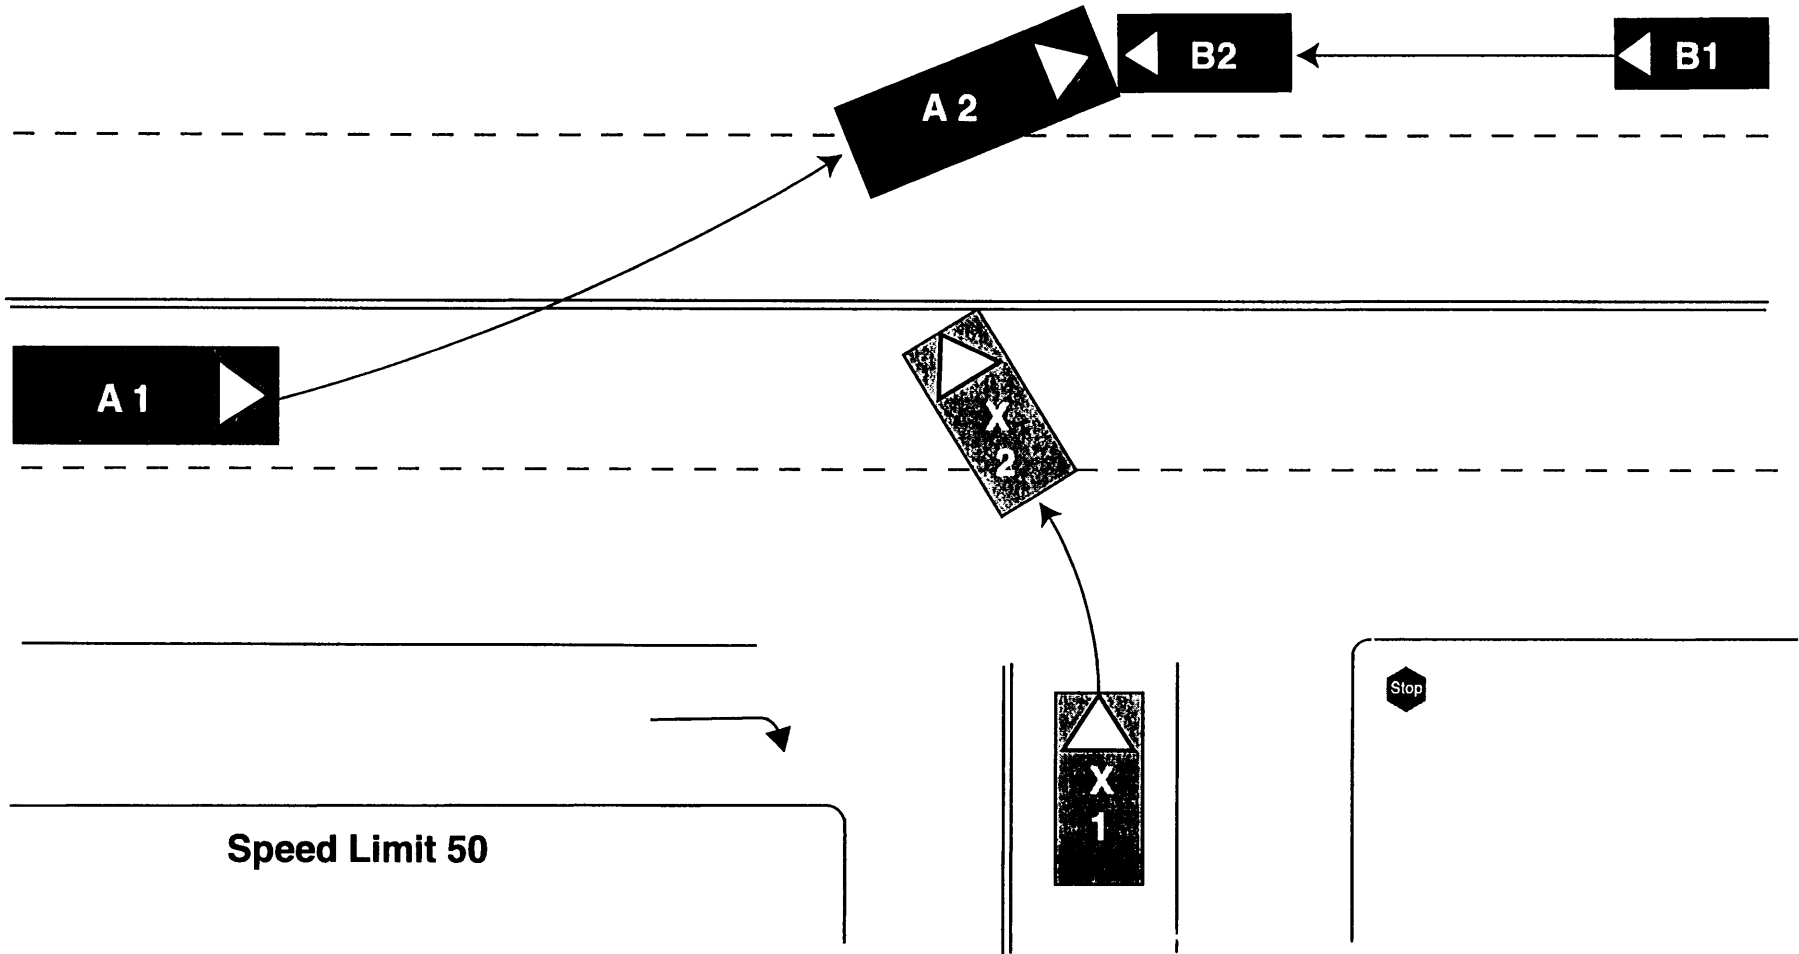

Duplicate columns 1-8
from the previous card.

Module O V Format 0 4
9 10 11 12

OTHER VEHICLE OV-1

MAKE: Ford

CARGO: _____

MODEL: Festiva LX, 2-door hb

VIN K N J B T O 7 K O J 6 [REDACTED]
13 29

MANUFAC/BODY CODE 9 3 2 2 5
30 34

MAKE/MODEL CODE 0 2 2 3
38

MODEL YEAR 1 9 8 9
39 42

VEHICLE MASS (kg) 0 0 0 7 9 4
43 48

IF SEPARATE REPORT WAS MADE,
GIVE VEHICLE NUMBER 0

NUMBER OF OCCUPANTS 0 2
(ENTER 9'S IF UNKNOWN) 51

TRAVELING SPEED (km/h) 9 9 9
54

- (000) PARKED OR STOPPED
(995) JUST STARTING UP
(996) BACKING UP
(997) SPEED NOT EXCESSIVE (BUT UNKNOWN)
(998) SPEED EXCESSIVE (BUT UNKNOWN)
(999) UNKNOWN

HIGHEST POLICE INJURY SEVERITY
CODE FOR THIS VEHICLE

- (0) O - NO INJURY
(1) C - POSSIBLE INJURY
(2) B - NON-INCAPACITATING INJURY
(3) A - INCAPACITATING INJURY
(4) K - FATAL
(5) INJURED, SEVERITY UNKNOWN
(6) DIED PRIOR TO ACCIDENT
(7) NON-FATAL INJURY
SEVERITY UNKNOWN
(8) UNOCCUPIED VEHICLE
(NOT APPLICABLE)
(9) UNKNOWN

4
55

VEHICLE TYPE

PASSENGER VEHICLE

- (02) LARGE
(03) LIMOUSINE
(17) PICKUP CAR
(20) UNKNOWN PASSENGER VEHICLE BODY
(24) SUB-MINI
(25) MINI
(26) SUB-COMPACT
(27) COMPACT
(28) INTERMEDIATE
(29) FULL

2 5
56 57

MULTIPURPOSE PASSENGER VEHICLE

- (14) SMALL UTILITY (WHEELBASE LESS THAN 107",
E.G. JEEP, BRONCO)
(15) LARGE UTILITY (WHEELBASE MORE THAN 107",
E.G. PANEL TRUCK, SUBURBAN)
(16) PICKUP TRUCK WITH CANOPY/SHELL COVER
(17) PICKUP CAR WITH CANOPY/SHELL COVER
(21) MOTOR HOME
(22) PICKUP TRUCK WITH SLIDE-IN CAMPER
(23) PICKUP CAR WITH SLIDE-IN CAMPER
(31) CHASSIS-MOUNTED CAMPER

TRUCK

- (11) VAN
(12) PICKUP TRUCK
(13) UNKNOWN LIGHT TRUCK
(15) LARGE UTILITY (E.G. PANEL TRUCK, SUBURBAN)
(16) PICKUP TRUCK WITH CANOPY/SHELL COVER
(22) PICKUP TRUCK WITH SLIDE-IN CAMPER
(30) UNKNOWN TRUCK TYPE
(31) CHASSIS-MOUNTED CAMPER
(33) DELIVERY VAN (WALK-IN)
(34) STRAIGHT TRUCK
(35) TRUCK-TRACTOR (BOBTAIL)
(36) CHASSIS-CAB
(37) UNKNOWN HEAVY TRUCK
(38) TRACTOR & SEMI-TRAILER (SEMI)
(39) TRUCK (OR SEMI) & FULL TRAILER(S)

BUS

- (40) UNKNOWN BUS TYPE
(41) SCHOOL BUS
(42) INTERCITY BUS (BETWEEN CITIES)
(43) TRANSIT BUS (INTRACITY)
(44) STREETCAR (ON TRACKS)

- (68) TRAIN (CARS)
(69) LOCOMOTIVE (ENGINE, SWITCHER)

(99) UNKNOWN

WHEELBASE (cm)
(999) UNKNOWN

2 2 9
58 59 60

Duplicate columns 1-8
from the previous card.

Module 0 V Format 0 2
9 10 11 12


OTHER VEHICLE OV-2

BEST AVAILABLE COPY

ORIGINAL SPECIFICATIONS

Wheelbase	<u>229</u> cm	Front Overhang	<u>068</u> cm
			22 24
Curb Weight	<u>794</u> kg	Rear Overhang	<u>059</u> cm
			25 27
Average Track Width	<u>139</u> cm	Undeformed End Width (UEW)	<u>145</u> cm
	13 15		28 30
Overall Length	<u>357</u> cm	Engine Displacement	<u>1.3</u> L
	16 18		31 32
Overall Width (OAW)	<u>161</u> cm	Engine: # of Cylinders	<u>04</u>
	19 21		33 34

VEHICLE DAMAGE

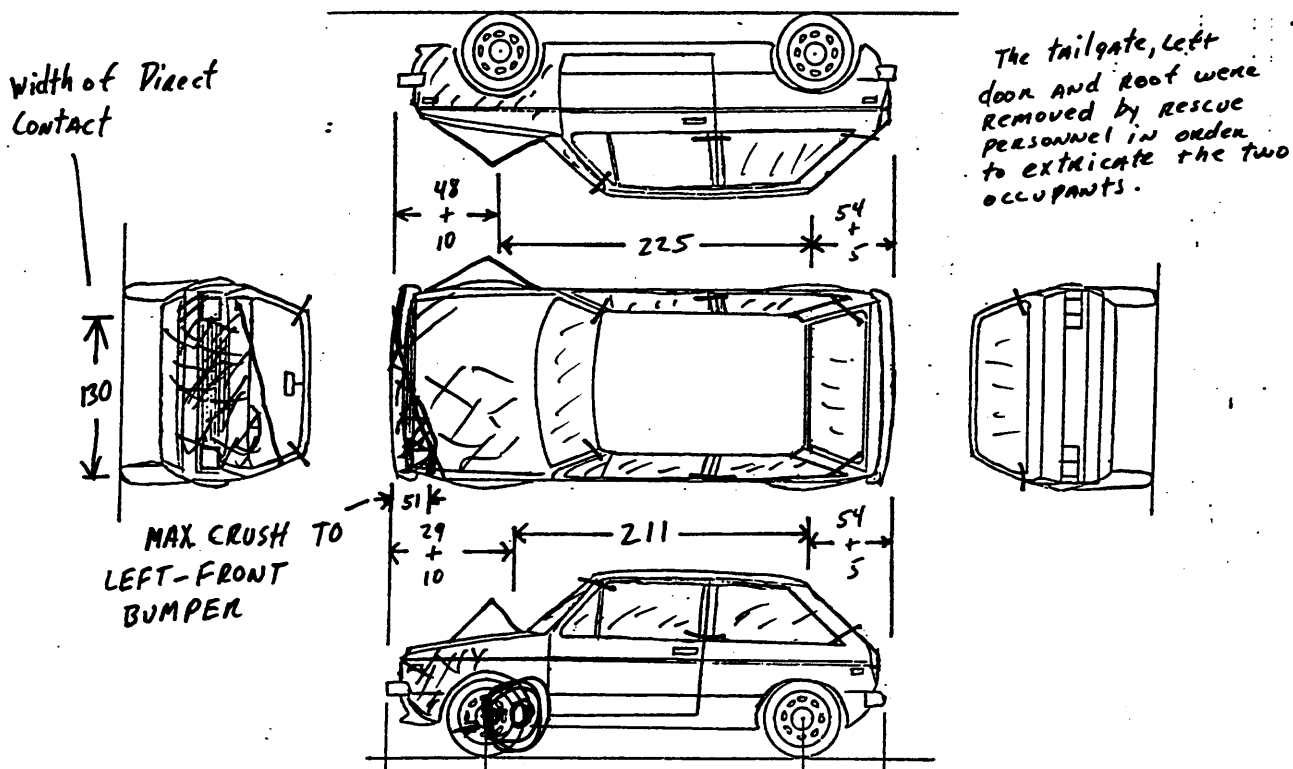

FRONTAL CRASH OVERLAP

Round up for .5. 98 = 98% or more
Enter % overlap or "99" for missing or N/A.

Direct Damage Length (DDL)

130 cm
35 37

Front-End Overlap (Percent) = $\frac{DDL}{UEW}$

90 %
38 39

Vehicle Overlap (Percent) = $\frac{DDL + 1/2 (OAW - UEW)}{OAW}$

86 %
40 41

Duplicate columns 1-8
from the previous card.

Module V D Format 0 4
9 10 11 12

VEHICLE DESCRIPTION VD-1

MAKE: Ford
MODEL: F-150 XLT Supercab 4x2, 3-door pickup

CARGO: _____

VIN 1 F T Z X 1 7 6 0 N N [REDACTED]
13 29

MANUFAC/BODY CODE 1 2 1 1 2
30 34

MAKE/MODEL CODE 3 1 0 8
38

MODEL YEAR 1 9 9 8
39 42

VEHICLE MASS (kg) 0 0 1 8 4 5
43 48

ODOMETER (km)
(ENTER 9'S IF UNKNOWN) 0 2 8 1 9 7
(ENTER 8'S IF ELECTRONIC) 49 54

NUMBER OF OCCUPANTS 0 4
(ENTER 9'S IF UNKNOWN) 56

TRAVELING SPEED (km/h) 9 9 9
59

- (000) PARKED OR STOPPED
(995) JUST STARTING UP
(996) BACKING UP
(997) SPEED NOT EXCESSIVE (BUT UNKNOWN)
(998) SPEED EXCESSIVE (BUT UNKNOWN)
(999) UNKNOWN

STOLEN VEHICLE

- (0) NO
(1) YES
(8) NOT COLLECTED
(9) UNKNOWN

8
62

BODY STRUCTURE

- (1) BODY & FRAME
(2) UNITIZED
(3) INTEGRAL-STUB FRAME
(4) BODY & PLATFORM FRAME
(E.G. VW BUG)
(5) PARTIALLY UNITIZED
(7) OTHER: _____
(9) UNKNOWN

1
63

TRANSMISSION

- (0) NONE
(1) AUTOMATIC
(2) MANUAL
(9) UNKNOWN

1
64

LOCATION OF TRANSMISSION
SELECTOR LEVER

- (1) FLOOR
(2) CONSOLE
(3) COLUMN
(7) OTHER: _____
(9) UNKNOWN

3
65

STEERING

- (1) POWER
(2) MANUAL
(9) UNKNOWN

1
66

BRAKES

- (1) POWER
(2) MANUAL
(9) UNKNOWN

1
67

VEHICLE TYPE

PASSENGER VEHICLE

- (11) 2-DOOR HARDTOP (NO UPPER B-PILLAR)
(12) 2-DOOR SEDAN OR COUPE
(ANY UPPER B-PILLAR)
(13) 4-DOOR HARDTOP
(14) 4-DOOR SEDAN
(15) STATION WAGON
(16) CONVERTIBLE
(18) OTHER PASS. VEH.: _____
(19) PASSENGER VEHICLE, TYPE UNKNOWN

3 3
60 61

MULTIPURPOSE PASSENGER VEHICLE

- (21) SMALL UTILITY (E.G. JEEP, SCOUT, BRONCO)
(22) LARGE UTILITY (E.G. PANEL TRUCK, SUBURBAN)
(23) VAN, SIZE UNKNOWN
(24) VAN, SMALL (MINI)
(25) VAN, LARGE
(29) MPV, TYPE UNKNOWN
(30) MOTOR HOME

TRUCK

- (31) PICKUP TRUCK, UNKNOWN
(32) PICKUP TRUCK, SMALL (DOWNSIZED)
(33) PICKUP TRUCK, LARGE

(99) UNKNOWN

TYPE OF BRAKES

- (1) DRUM, ALL WHEELS
- (2) DISC, FRONT WHEELS
- (3) DISC, ALL WHEELS
- (9) UNKNOWN

2
68

WHEELBASE (cm)
(999) Unknown

353
76 77 78

BRAKE ANTI-LOCK DEVICE

- (0) NONE INSTALLED
- (1) TWO-WHEEL
- (2) FOUR-WHEEL
- (7) EQUIPPED, UNKNOWN WHEELS
- (9) UNKNOWN

1
69

PLASTIC ANTI-LACERATIVE
INNER LAYER GLASS EQUIPPED

- (0) NONE
- (1) WINDSHIELD
- (2) WINDSHIELD AND SIDE
- (7) OTHER
- (9) UNKNOWN

0
79

AIR CONDITIONING IN VEHICLE

- (0) NO
- (1) YES
- (8) NOT COLLECTED
- (9) UNKNOWN

8
70

TYPE OF DRIVE

- (1) REAR WHEEL
- (2) FRONT WHEEL
- (3) FOUR WHEEL
- (4) ALL WHEEL DRIVE
- (9) UNKNOWN

1
71

FIELD INVESTIGATOR INSTRUCTIONS:

1. INDICATE CRUSHED AREAS BY OUT-LINING NEW PERIMETER OF VEHICLE AND SHADING THE DAMAGED AREAS ON THE LARGE SKETCH ON PAGE VD-3. USE AS MANY SKETCHES AS NECESSARY TO COMPLETELY DESCRIBE THE DAMAGE.
2. ENTER THE DIMENSIONS ON THE SKETCH(ES) MEASURED TO THE POINT OF MAXIMUM PENETRATION BY THE OBJECT(S) CONTACTED. USE THE EXAMPLES BELOW AS A GUIDE.
3. ENTER THE THREE DIMENSIONS TO THE CENTER OF THE WHEELS (WHEELBASE, FRONT AND REAR OVERHANGS) ON BOTH SIDES OF THE CAR.
4. ADD OTHER DIMENSIONS AS NECESSARY TO COMPLETELY DESCRIBE THE DAMAGE.

EXAMPLES:

DUAL REAR WHEELS

- (0) NO
- (1) YES
- (9) UNKNOWN

0
72

ORIGINAL TYPE
OF RESTRAINT SYSTEM

- (1) ACTIVE BELT
- (2) PASSIVE BELT
- (3) AIRBAG
- (4) KNEE BOLSTERS
- (7) OTHER: _____
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

3
73

EQUIPPED WITH ROLL BAR


- (0) NO
- (1) YES
- (9) UNKNOWN

0
74

TYPE OF ROOF

- (0) NONE
- (1) SOLID
- (2) T-TOP CLOSED
- (3) T-TOP OPEN
- (4) SUN ROOF CLOSED
- (5) SUN ROOF OPEN
- (6) CONVERTIBLE CLOSED
- (7) CONVERTIBLE OPEN
- (8) OTHER: _____
- (9) UNKNOWN

1
75

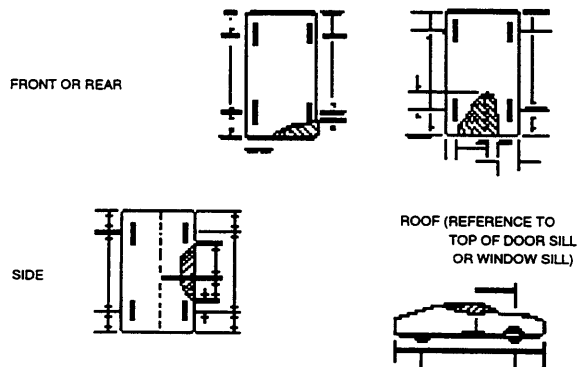


Duplicate columns 1-8
from the previous card.Module V D Format 0 2
9 10 11 12VEHICLE DESCRIPTION **VD-3**

ORIGINAL SPECIFICATIONS

Wheelbase	<u>353</u> cm	Front Overhang	<u>098</u> cm
Curb Weight	<u>1845</u> kg	Rear Overhang	<u>110</u> cm
Average Track Width	<u>165</u> cm	Undeformed End Width (UEW)	<u>180</u> cm
Overall Length	<u>561</u> cm	Engine Displacement	<u>4.6</u> L
Overall Width (OAW)	<u>199</u> cm	Engine: # of Cylinders	<u>08</u>

VEHICLE DAMAGE

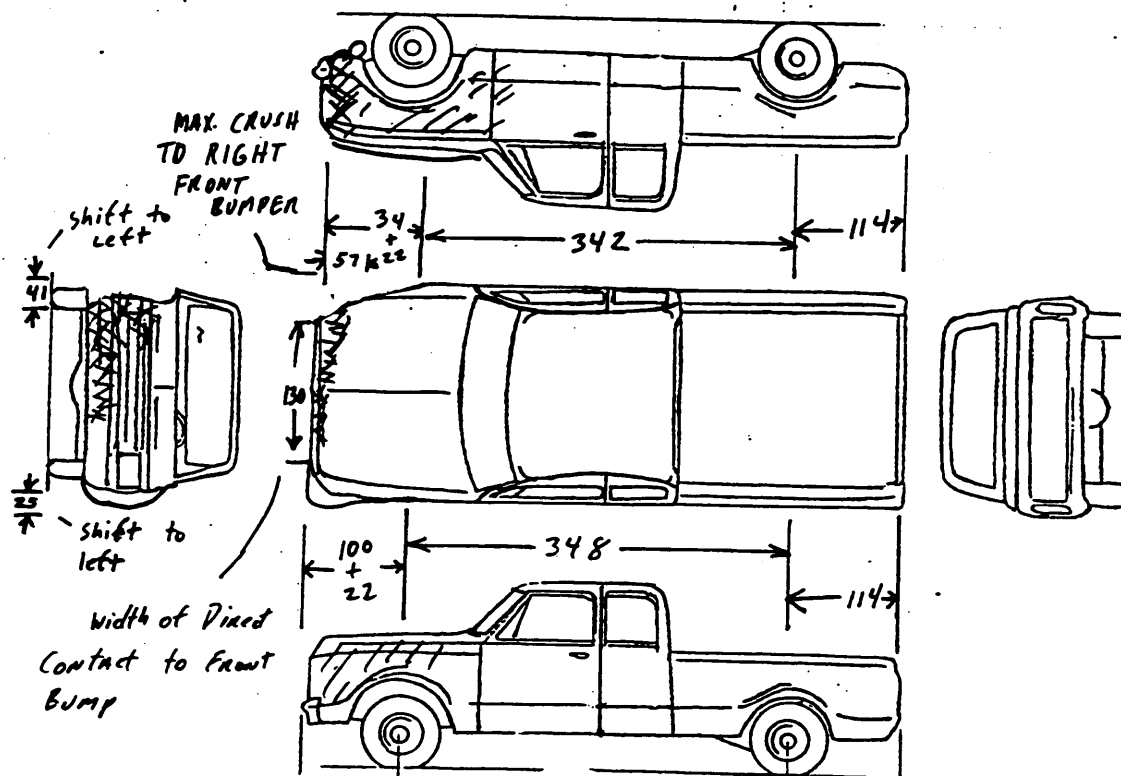

FRONTAL CRASH OVERLAP

Round up for .5. 98 = 98% or more
Enter % overlap or "99" for missing or N/A.

Direct Damage Length (DDL) 130 cmFront-End Overlap (Percent) = $\frac{DDL}{UEW}$ 72%Vehicle Overlap (Percent) = $\frac{DDL + 1/2 (OAW - UEW)}{OAW}$ 70%

Duplicate columns 1-8
from the previous card.

Module D A Format 0 2
9 10 11 12

DAMAGE DA-1

PRIMARY

CASE VEHICLE PRIMARY CDC

CONTACTED VEHICLE ASSOCIATED CDC

EVENT NUMBER

IMPACT SPEED (km/h)

ESTIMATED BY

CRUSH (cm)

CDC #1

CDC #2

1
13
999
14 15 16
1
17
057
18 19 20

01-FDEW-3
21 27
98-0000-0
28 34

999
35 36 37
1
38
051
39 40 41

12-FYEW-3
42 48
98-0000-0
49 55

Duplicate columns 1-8
from the previous card.

Module D A Format 0 3
9 10 11 12

SECONDARY

CASE VEHICLE SECONDARY CDC

CONTACTED VEHICLE ASSOCIATED CDC

EVENT NUMBER

IMPACT SPEED (km/h)

ESTIMATED BY

CRUSH (cm)

CDC #1

CDC #2

8
13

14 15 16

17

18 19 20

21 - - - - - 27
28 - - - - - 34

35 36 37

38

39 40 41

42 - - - - - 48
49 - - - - - 55

CODES

EVENT NUMBER

(8) NOT APPLICABLE
(9) UNKNOWN

IMPACT SPEED

(998) NOT APPLICABLE
(999) UNKNOWN

IMPACT SPEED ESTIMATOR

(1) INVESTIGATOR
(2) DRIVER
(3) POLICE
(4) "CRASH" PROGRAM
(5) OTHER COMPUTER PROGRAM
SPECIFY: _____
(7) OTHER: _____
(8) NOT APPLICABLE
(NO VEHICLE/NO IMPACT)

CRUSH

(998) NOT APPLICABLE
(NO VEHICLE/DAMAGE)
(999) UNKNOWN

CDC

(9800000) NOT APPLICABLE
(9900000) UNKNOWN

Duplicate columns 1-8
from the previous card.Module D A Format 0 1
9 10 11 12

DAMAGE DA-2

MAXIMUM SHEET METAL CRUSH

(cm) (999) UNKNOWN

FRONT 0 5 7
13 15RIGHT SIDE 0 0 0
16 18REAR 0 0 0
19 21LEFT SIDE 0 0 0
22 24ROOF 0 0 0
25 27OTHER 0 0 0
28 30CHRONOLOGICAL SEQUENCE
OF DAMAGE/INJURY PRODUCING CRASH EVENTS
FOR CASE VEHICLENOTE: IF CHRONOLOGICAL ORDER
IS UNKNOWN, EVENT
ORDER IS OPTIONAL.DO YOU KNOW THIS TABLE
TO BE IN CHRONOLOGICAL ORDER? 1
31(0) NO
(1) YES

EVENT NUMBER	IMPACT LOCATION (1) ON ROADWAY (2) SHOULDER/MEDIAN/GORE (3) ON ROADSIDE (4) OUTSIDE ROADSIDE RIGHT-OF-WAY (5) OTHER (6) OFF ROADWAY, LOC. UNK. (9) UNKNOWN	IMPACT CONFIGURATION FOR CODES, SEE TABLE ON PAGE DA-3.	OBJECT/VEHICLE CONTACTED FOR CODES, SEE TABLE ON PAGE DA-4.
# 1	<u>1</u> 32	<u>1 1</u> 34	<u>2 5</u> 36
#2	<u> </u> 37	<u> </u> 39	<u> </u> 41
#3	<u> </u> 42	<u> </u> 44	<u> </u> 46
#4	<u> </u> 47	<u> </u> 49	<u> </u> 51
#5	<u> </u> 52	<u> </u> 54	<u> </u> 56
#6	<u> </u> 57	<u> </u> 59	<u> </u> 61
#7	<u> </u> 62	<u> </u> 64	<u> </u> 66

CODES FOR
IMPACT CONFIGURATIONFRONT OF CASE VEHICLE

- (11) AND FRONT OF CONTACTED VEHICLE
- (13) AND SIDE OF CONTACTED VEHICLE
- (14) AND REAR OF CONTACTED VEHICLE
- (16) ENDSWIPED BY CONTACTED VEHICLE
- (17) AND OBJECT
- (19) AND UNKNOWN OTHER VEHICLE CONFIGURATION

LEFT SIDE OF CASE VEHICLE

- (21) AND FRONT OF CONTACTED VEHICLE (TYPE T)
- (22) AND FRONT OF CONTACTED VEHICLE (TYPE L)
- (23) AND SIDE OF CONTACTED VEHICLE (NOT SIDESWIPE)
- (24) AND REAR OF CONTACTED VEHICLE (TYPE T)
- (25) AND REAR OF CONTACTED VEHICLE (TYPE L)
- (26) SIDESWIPED BY CONTACTED VEHICLE
- (27) AND OBJECT
- (29) AND UNKNOWN OTHER VEHICLE CONFIGURATION

REAR OF CASE VEHICLE

- (31) AND FRONT OF CONTACTED VEHICLE
- (33) AND SIDE OF CONTACTED VEHICLE
- (34) AND REAR OF CONTACTED VEHICLE
- (36) ENDSWIPED BY CONTACTED VEHICLE
- (37) AND OBJECT
- (39) AND UNKNOWN OTHER VEHICLE CONFIGURATION

RIGHT SIDE OF CASE VEHICLE

- (41) AND FRONT OF CONTACTED VEHICLE (TYPE T)
- (42) AND FRONT OF CONTACTED VEHICLE (TYPE L)
- (43) AND SIDE OF CONTACTED VEHICLE (NOT SIDESWIPE)
- (44) AND REAR OF CONTACTED VEHICLE (TYPE T)
- (45) AND REAR OF CONTACTED VEHICLE (TYPE L)
- (46) SIDESWIPED BY CONTACTED VEHICLE
- (47) AND OBJECT
- (49) AND UNKNOWN OTHER VEHICLE CONFIGURATION

OTHER

- (57) VEHICLE TO OBJECT
- (58) VEHICLE TO VEHICLE
- (59) VEHICLE TO VEHICLE, CONFIGURATION UNKNOWN

ROLLOVER

- (61) LESS THAN 360°
- (62) 360° OR MORE
- (69) DETAILS UNKNOWN

UNKNOWN

- (99) IMPACT TYPE UNKNOWN

CODES FOR VEHICLE/OBJECT CONTACTED

VEHICLE/OBJECT GROUPS

- (00) NO OBJECT
- (01) - (39) PASSENGER VEHICLE & TRUCK
- (40) - (69) OTHER VEHICLE
- (70) - (76) PEDESTRIAN & ON-ROADWAY OBJECT
- (77) - (97) OFF-ROADWAY OBJECT

- (98) OTHER (DESCRIBE)
- (99) UNKNOWN

PASSENGER VEHICLE

- (02) LARGE
- (03) LIMOUSINE
- (17) PICKUP
- (20) UNKNOWN PASSENGER VEHICLE BODY
- (24) SUB-MINI
- (25) MINI
- (26) SUB-COMPACT
- (27) COMPACT
- (28) INTERMEDIATE
- (29) FULL

SIZEWHEELBASE

SUB-MINI	< 2286 mm (< 90")
MINI	2286 - 2412 mm (90" - 94.9")
SUB-COMPACT	2413 - 2539 mm (95" - 99.9")
COMPACT	2540 - 2666 mm (100" - 104.9")
INTERMEDIATE	2667 - 2793 mm (105" - 109.9")
FULL	2794 - 2920 mm (110" - 114.9")
LARGE	2921 - 3174 mm (115" - 124.9")
LIMOUSINE	> 3175 mm (> 125")

MULTIPURPOSE PASSENGER VEHICLE

- (11) SMALL VAN (MINI)
- (12) PICKUP
- (14) SMALL UTILITY (WHEELBASE LESS THAN 107",
E.G. JEEP, BRONCO)
- (15) LARGE UTILITY (WHEELBASE MORE THAN 107",
E.G. PANEL TRUCK, SUBURBAN)
- (16) PICKUP TRUCK WITH CANOPY/SHELL COVER
- (17) PICKUP CAR WITH CANOPY/SHELL COVER
- (21) MOTOR HOME
- (22) PICKUP TRUCK WITH SLIDE-IN CAMPER
- (23) PICKUP CAR WITH SLIDE-IN CAMPER
- (31) CHASSIS-MOUNTED CAMPER

TRUCK

- (11) SMALL VAN (E.G. ECONOLINE)
- (12) PICKUP TRUCK
- (13) UNKNOWN LIGHT TRUCK
- (15) LARGE UTILITY (E.G. PANEL TRUCK, SUBURBAN)
- (16) PICKUP TRUCK WITH CANOPY/SHELL COVER
- (22) PICKUP TRUCK WITH SLIDE-IN CAMPER
- (30) UNKNOWN TRUCK TYPE
- (31) CHASSIS-MOUNTED CAMPER
- (33) DELIVERY VAN (WALK-IN)
- (34) STRAIGHT TRUCK
- (35) TRUCK-TRACTOR (BOBTAIL)
- (36) CHASSIS-CAB
- (37) UNKNOWN HEAVY TRUCK
- (38) TRACTOR & SEMI-TRAILER (SEMI)
- (39) TRUCK (OR SEMI) & FULL TRAILER(S)

BUS

- (40) UNKNOWN BUS TYPE
- (41) SCHOOL BUS
- (42) INTERCITY BUS (BETWEEN CITIES)
- (43) TRANSIT BUS (INTRACITY)
- (44) STREETCAR (ON TRACKS)

MOTORCYCLE

- (50) UNKNOWN MOTORCYCLE TYPE
- (51) 1 - 75 cc
- (52) 76 - 125 cc
- (53) 126 - 250 cc
- (54) 251 - 500 cc
- (55) 501 - 750 cc
- (56) 751 cc +
- (57) 3-WHEELS (OR WITH SIDECAR)

SPECIAL PURPOSE VEHICLE

- (60) UNKNOWN/OTHER SPECIAL VEHICLE (DESCRIBE)
- (61) SNOWMOBILE
- (62) ATV (ALL TERRAIN VEHICLE)
- (63) AMPHIBIOUS VEHICLE
- (64) FARM VEHICLE
- (65) CONSTRUCTION VEHICLE
- (66) TRAILER, PRIVATE (CAMPER)
- (67) TRAILER, COMMERCIAL (CARGO)
- (68) TRAIN (CARS)
- (69) LOCOMOTIVE (ENGINE, SWITCHER)

OBJECT

- (70) PEDESTRIAN
- (71) BICYCLIST, OTHER PEDALCYCLIST
- (72) PEDESTRIAN CONVEYANCE (E.G. PERSON RIDING
ANIMAL, CART)
- (73) LARGE ANIMAL
- (74) FALLEN OBJECT (E.G. OBJECT DISLODGED FROM
OTHER VEHICLE, FALLEN TREE, ROCKS)
- (75) ROCKS
- (76) CONSTRUCTION EQUIPMENT (EXCLUDING (65))
- (77) SIGN POST, UTILITY POLE, TREE
- (78) DITCH
- (79) EMBANKMENT, SNOWBANK, RR TRACKS RR X
- (80) GROUND (ROLLOVER ONLY)
- (81) CURB (DAMAGE PRODUCING IMPACTS ONLY)
- (82) CULVERT
- (83) FENCE
- (84) HYDRANT, SHORT POST, STUMP
- (85) SMALL POST/TREE, RURAL MAIL BOX, MILE
MARKER, DELINEATOR
- (86) BUILDING
- (87) PIER, PILLAR, BRIDGE SUPPORT
- (88) ABUTMENT, RETAINING WALL
- (89) BRIDGE RAIL
- (90) GUARD RAIL, LEADING SECTION
- (91) GUARD RAIL, MIDDLE OR UNKNOWN
- (92) GUARD RAIL, TRAILING SECTION
- (93) GUARD POST (TIMBER, METAL, CONCRETE)
- (94) CABLE, FENCE BARRIER
- (95) CONCRETE BARRIER (MEDIAN)
- (96) IMPACT ATTENUATOR
- (97) BREAKAWAY FEATURES

Duplicate columns 1-8
from the previous card.

Module C R Format 0 1
9 10 11 12

CRASH RECONSTRUCTION CR-1

for ΔV

	CASE VEHICLE PRIMARY IMPACT		CASE VEHICLE SECONDARY IMPACT	
	CASE VEHICLE	CONTACTED VEHICLE	CASE VEHICLE	CONTACTED VEHICLE
EVENT NUMBER	<u>1</u> 13		<u> </u> 47	
ΔV (km/h) TOTAL	<u>044</u> 14 15 16	<u>055</u> 32 33 34	<u> </u> 48 49 50	<u> </u> 66 67 68
LONGITUDINAL*	<u>-041</u> 17 20	<u>-054</u> 35 38	<u> </u> 51 54	<u> </u> 69 72
LATERAL*	<u>-015</u> 21 24	<u>+010</u> 39 42	<u> </u> 55 58	<u> </u> 73 76
*NOTE: THESE ΔV COMPONENTS MUST INCLUDE SIGN.				
EXAMPLES: 10 km/h = ± 010 -7 km/h = -007				
ENERGY DISSIPATED BY CRUSH (kj)	<u>0164</u> 25 28	<u>0109</u> 43 46	<u> </u> 59 62	<u> </u> 77 80
RECONSTRUCTION.				
(01) RECONSTRUCTED, UNKNOWN CONFIDENCE LEVEL	<u>22</u> 29 30		<u> </u> 63 64	
(21) RECONSTRUCTED, LOW CONFIDENCE LEVEL				
(22) RECONSTRUCTED, MODERATE CONFIDENCE LEVEL				
(23) RECONSTRUCTED, HIGH CONFIDENCE LEVEL				
NOT RECONSTRUCTED BECAUSE				
(02) INSUFFICIENT DATA				
(03) EXCESSIVE UNDERRIDE/ OVERRIDE				
(04) ROLLOVER				
(05) VAULTING				
(06) OTHER TRAVEL IN MORE THAN ONE PLANE				
(07) NON-HORIZONTAL FORCE				
(08) SIDESWIPE-TYPE DAMAGE				
(09) YIELDING OBJECT				
(10) OTHER: _____				
(11) AT LEAST ONE VEHICLE BEYOND SCOPE				
(12) OTHER VEHICLE NOT INSPECTED				
MODE				
(1) CDC ONLY	<u>2</u> 31		<u> </u> 65	
(2) CDC & DETAILED DAMAGE				
(3) TRAJECTORY & CDC				
(4) TRAJECTORY & CDC & DETAILED DAMAGE				
(5) NOT RECONSTRUCTED				
COMPUTER PROGRAM SPECIFY: <u>WPCASH</u>				

Duplicate columns 1-8
from the previous card.

Module C R Format 0 2
9 10 11 12

CRASH RECONSTRUCTION CR-2

for EBS

	CASE VEHICLE PRIMARY IMPACT		CASE VEHICLE SECONDARY IMPACT	
	CASE VEHICLE	CONTACTED VEHICLE	CASE VEHICLE	CONTACTED VEHICLE
EVENT NUMBER	<u>1</u> 13		<u>47</u>	
EBS (km/h) TOTAL	<u>033</u> 14 15 16	<u>072</u> 32 33 34	<u> </u> 48 49 50	<u> </u> 66 67 68
LONGITUDINAL *	<u>-031</u> 17 20	<u>-071</u> 35 38	<u> </u> 51 54	<u> </u> 69 72
LATERAL *	<u>-011</u> 21 24	<u>+012</u> 39 42	<u> </u> 55 58	<u> </u> 73 76
*NOTE: THESE EBS COMPONENTS MUST INCLUDE SIGN.				
EXAMPLES: 10 km/h = <u>+010</u> -7 km/h = <u>-007</u>				
ENERGY DISSIPATED BY CRUSH (kj)	<u>0164</u> 25 28	<u>0109</u> 43 46	<u> </u> 59 62	<u> </u> 77 80
RECONSTRUCTION				
(01) RECONSTRUCTED, UNKNOWN CONFIDENCE LEVEL	<u>22</u> 29 30		<u> </u> 63 64	
(21) RECONSTRUCTED, LOW CONFIDENCE LEVEL				
(22) RECONSTRUCTED, MODERATE CONFIDENCE LEVEL				
(23) RECONSTRUCTED, HIGH CONFIDENCE LEVEL				
NOT RECONSTRUCTED BECAUSE				
(02) INSUFFICIENT DATA				
(03) EXCESSIVE UNDERRIDE/ OVERRIDE				
(04) ROLLOVER				
(05) VAULTING				
(06) OTHER TRAVEL IN MORE THAN ONE PLANE				
(07) NON-HORIZONTAL FORCE				
(08) SIDESWIPE-TYPE DAMAGE				
(09) YIELDING OBJECT				
(10) OTHER: _____				
(11) AT LEAST ONE VEHICLE BEYOND SCOPE				
(12) OTHER VEHICLE NOT INSPECTED				
MODE				
(1) CDC ONLY	<u>2</u> 31		<u> </u> 65	
(2) CDC & DETAILED DAMAGE				
(3) TRAJECTORY & CDC				
(4) TRAJECTORY & CDC & DETAILED DAMAGE				
(5) NOT RECONSTRUCTED				
COMPUTER PROGRAM SPECIFY: <u>WWSNASH</u>				

Duplicate columns 1-8
from the previous card.

Module C R Format 0 3
9 10 11 12

CRASH RECONSTRUCTION CR-3

NOTES:

1. ENTER CRASH RECONSTRUCTION DAMAGE MEASUREMENTS IN CENTIMETERS.
2. MEASURE C_1 TO C_6 FROM DRIVER TO PASSENGER SIDE IN FRONT OR REAR IMPACTS, REAR TO FRONT IN SIDE IMPACTS.
3. D IS POSITIVE IF MEASURED TO A POINT FORWARD OF OR TO THE RIGHT OF THE CG.
4. USE THE CENTER OF THE WHEELBASE AS THE CG.

CASE VEHICLE


LOCATOR

Locate the end of the damage with respect to the vehicle longitudinal center line, or an undamaged axle for side impacts.

Specific Impact No.	Location of Direct Damage	Location of Field L
1	50 cm Undamaged	Ft. bumper BC to BC

PLANE:

- (1) Bumper
- (2) Above Bumper
- (3) Sill
- (4) Above Sill
- (5) Other _____
- (9) Unknown

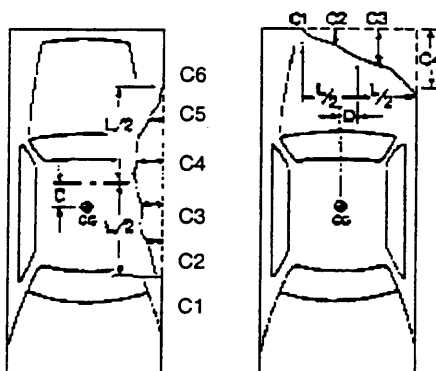

DL 130

UDL 50

CRUSH PROFILE IN CENTIMETERS

NOTE: Each line in the table below is a separate record (card).

Duplicate columns 1 - 12 for each completed line.

Specific Impact Number	Plane of Impact C-Measur.	Direct Damage		Field L	C ₁	C ₂	C ₃	C ₄	C ₅	C ₆	±D
		Length (DDL)	Max Crush								
1	1	130	64	155	27	20	35	52	64	77	+34
			-7		-22	-7	-1	-1	-7	-22	
1	1	130	057	155	005	013	034	051	057	055	+034
13	14	15 16 17	18 19 20	21 22 23	24 25 26	27 28 29	30 31 32	33 34 35	36 37 38	39 40 41	42 43 44 45
2											

Duplicate columns 1-8
from the previous card.

Module C R Format 0 4
9 10 11 12

CRASH RECONSTRUCTION CR-4

- NOTES:
1. ENTER CRASH RECONSTRUCTION DAMAGE MEASUREMENTS IN CENTIMETERS.
 2. MEASURE C_1 TO C_6 FROM DRIVER TO PASSENGER SIDE IN FRONT OR REAR IMPACTS, REAR TO FRONT IN SIDE IMPACTS.
 3. D IS POSITIVE IF MEASURED TO A POINT FORWARD OF OR TO THE RIGHT OF THE CG.
 4. USE THE CENTER OF THE WHEELBASE AS THE CG.

OTHER VEHICLE



LOCATOR

Locate the end of the damage with respect to the vehicle longitudinal center line, or an undamaged axle for side impacts.

Specific Impact No.	Location of Direct Damage	Location of Field L
1	Begin 4-BC 130cm to right	Rt. bumper BC to BC

PLANE:

- (1) Bumper
- (2) Above Bumper
- (3) Sill
- (4) Above Sill
- (5) Other _____
- (9) Unknown

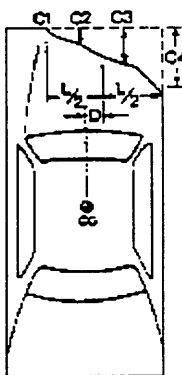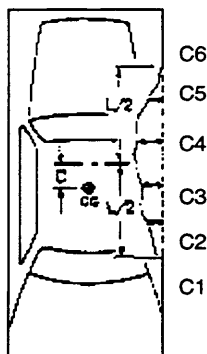

UEW = 145

DL 130

UDL 15

CRUSH PROFILE IN CENTIMETERS

NOTE: Each line in the table below is a separate record (card).

Duplicate columns 1 - 12 for each completed line.

Specific Impact Number	Plane of Impact C-Measur.	Direct Damage		Field L	C ₁	C ₂	C ₃	C ₄	C ₅	C ₆	±D
		Length (DDL)	Max Crush								
1	1	130	55	132	57	55	53	38	29	24	-012
			-4		-10	-4	-3	-3	-4	-10	
1	1	130	051	132	047	051	050	035	025	014	-012
13	14	15 16 17	18 19 20	21 22 23	24 25 26	27 28 29	30 31 32	33 34 35	36 37 38	39 40 41	42 43 44 45
2											

Duplicate columns 1-8
from the previous card.

Module W T Format 0 1
9 10 11 12

WHEELS AND TIRES

WT-1

WHEELS--DAMAGED

- (0) NO
(1) YES
(9) UNKNOWN

LF 0
13

RF 1

RR 0

LR 0
16

TIRE TREAD TYPE

- (1) REGULAR
(2) SNOW
(3) SLICKS
(4) ALL WEATHER (MS)
(7) OTHER: _____
(9) UNKNOWN

LF 4
17

RF 4

RR 4

LR 4
20

CARCASS CONSTRUCTION

- (1) BIAS
(2) BELTED BIAS
(3) RADIAL
(4) ELLIPTICAL
(5) HI PRESSURE SPARE
(6) SPACE SAVER SPARE
(7) OTHER: _____
(9) UNKNOWN

LF 3
21

RF 3

RR 3

LR 3
24

SIZE (NOT DOT CODE. IF UNKNOWN, USE 9'S)

LF P25570R16
25

RF _____
35

RR _____
45

LR _____
55

IF VEHICLE IS EQUIPPED WITH DUAL
WHEELS, COMPLETE FOR OUTER WHEELS
AND MAKE NOTES ON INNER WHEELS.

NOTES: _____

Duplicate columns 1-8
from the previous card.

Module F T Format 0 1
9 10 11 12

FUEL AND FUEL TANKS FT-1

TYPE OF PROPULSIVE FUEL (1) GASOLINE (2) DIESEL OIL (3) LPG (4) ELECTRIC (7) OTHER: _____ (9) UNKNOWN	<u>1</u> 13	AUXILIARY TANK TYPE (1) OEM TANK (2) AFTER MARKET TANK (8) NOT APPLICABLE (NOT EQUIPPED) (9) UNKNOWN	<u>8</u> 21
MAIN TANK LOCATION	<u>222</u> 14 16	AUXILIARY TANK LOCATION	<u>888</u> 22 24
MAIN FILLER CAP LOCATION	<u>113</u> 17 19	AUXILIARY FILLER CAP LOCATION	<u>888</u> 25 27
MAIN TANK MATERIAL	<u>3</u> 20	AUXILIARY TANK MATERIAL	<u>8</u> 28

TANK AND FILLER CAP LOCATION CODES

FIRST DIGIT (LONGITUDINAL)

- (1) BEHIND KICK-UP
- (2) IN KICK-UP
- (3) BETWEEN KICK-UP & COWL
- (4) FORWARD OF COWL
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

SECOND DIGIT (LATERAL)

- (1) LEFT OF FRAME
- (2) WITHIN FRAME OR CENTERED
- (3) RIGHT OF FRAME
- (4) DUAL, RIGHT & LEFT TANKS
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

THIRD DIGIT (VERTICAL)

- (1) BELOW FRAME
- (2) WITHIN FRAME OR CENTERED
- (3) ABOVE FRAME
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

TANK MATERIAL CODES

- (1) STEEL
- (2) ALUMINUM
- (3) PLASTIC
- (7) OTHER
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

Duplicate columns 1-8
from the previous card.

Module F L Format 0 1
9 10 11 12

FUEL LEAKAGE FL-1

DID FUEL LEAKAGE RESULT FROM A CRASH EVENT

(0) NO KNOWN LEAKAGE SKIP PAGE.

(1) YES COMPLETE PAGE.

6
13

LEAK NUMBER	I LEAKING COMPONENT	II COMPONENT SOURCE	III TYPE OF DAMAGE	IV SEVERITY OF DAMAGE	V LOCATION OF LEAK	EVENT NUMBER
#1	<u> </u> <u> </u> 14 15	<u> </u>	<u> </u>	<u> </u>	<u> </u> <u> </u>	<u> </u> 21
#2	<u> </u> <u> </u> 22 23	<u> </u>	<u> </u>	<u> </u>	<u> </u> <u> </u>	<u> </u> 29
#3	<u> </u> <u> </u> 30 31	<u> </u>	<u> </u>	<u> </u>	<u> </u> <u> </u>	<u> </u> 37
#4	<u> </u> <u> </u> 38 39	<u> </u>	<u> </u>	<u> </u>	<u> </u> <u> </u>	<u> </u> 45
#5	<u> </u> <u> </u> 46 47	<u> </u>	<u> </u>	<u> </u>	<u> </u> <u> </u>	<u> </u> 53

I LEAKING COMPONENT

TANK AREA

- (11) MAIN FUEL TANK (INCLUDING VAPOR RECOVERY DOME)
- (12) AUXILIARY FUEL TANK
- (13) MAIN TANK FILLER TUBE
- (14) MAIN TANK CAP (GAS CAP)
- (15) AUXILIARY TANK FILLER TUBE
- (16) AUXILIARY TANK CAP (GAS CAP)
- (19) TANK AREA, DETAILS UNKNOWN

DELIVERY SYSTEM

- (21) FUEL FEED LINE (MAIN TANK TO FUEL PUMP)
- (22) FUEL FEED LINE (AUXILIARY TANK TO FUEL PUMP)
- (23) FUEL RETURN LINE (FUEL PUMP TO TANK)
- (24) INLINE FUEL FILTER
- (25) FUEL LINE (PUMP TO CARBURETOR OR INJECTOR PUMP)
- (26) CARBURETOR TO INJECTOR PUMP
- (27) FUEL PUMP
- (29) DELIVERY SYSTEM, DETAILS UNKNOWN

EVAPORATIVE EMISSION CONTROL SYSTEM

- (31) ATMOSPHERIC VENT PIPE (NON-EEC EQUIPPED)
- (32) EEC PIPE (VAPOR CANISTER TO CARBURETOR)

EEC SYSTEM (CONTINUED)

- (33) VAPOR RECOVERY HOSES (CANISTER TO CARBURETOR)
- (34) LIQUID-VAPOR SEPARATOR (UNLESS PART OF TANK)
- (35) CANISTER
- (39) EEC SYSTEM, DETAILS UNKNOWN
- (49) ENGINE COMPARTMENT, COMPONENT UNKNOWN
- (99) COMPONENT UNKNOWN

II COMPONENT SOURCE

- (1) OEM
- (2) AFTER MARKET
- (9) UNKNOWN

III TYPE OF DAMAGE

- (1) DENTED/CRUSHED
- (2) PUNCTURED
- (3) RUPTURED
- (4) SEVERED/GROSS TEARS
- (5) DISCONNECTED/DEFEATED
- (9) UNKNOWN

IV SEVERITY OF DAMAGE

- (1) MINOR
- (2) MODERATE
- (3) SEVERE
- (4) DISCONNECTED/DEFEATED
- (9) UNKNOWN

V LOCATION OF LEAK

FIRST DIGIT
(LONGITUDINAL LOCATION)

- (1) F, FORWARD OF COWL
- (2) P, BETWEEN COWL & REAR BULKHEAD
- (3) B, BEHIND REAR BULKHEAD
- (4) Y, F, & P
- (5) Z, P, & B
- (6) D, DISTRIBUTED (F, P & B)
- (9) UNKNOWN

SECOND DIGIT
(LATERAL LOCATION)

- (1) L, LEFT
- (2) C, CENTER
- (3) R, RIGHT
- (4) Y, LEFT CENTER (L & C)
- (5) Z, RIGHT CENTER (R & C)
- (6) D, DISTRIBUTED (F, P & B)
- (9) UNKNOWN

Duplicate columns 1-8
from the previous card.

Module F R Format 0 1
9 10 11 12

FIRE FR-1

WAS THERE FIRE IN OR ON CASE VEHICLE?

(0) NO SKIP PAGE.

0
13

(1) YES COMPLETE PAGE.

DID FIRE START IN CASE VEHICLE?

- (0) NO
(1) YES
(9) UNKNOWN

14

SEVERITY OF FIRE DAMAGE

- (1) MINOR
(2) MODERATE
(3) SEVERE
(9) UNKNOWN

16

FLAME PROPOGATION RATE

- (1) RAPID/EXPLOSIVE
(2) SLOW/MODERATE
(9) UNKNOWN

15

DID AN INJURY TO CASE
VEHICLE OCCUPANT RESULT FROM
FIRE IN OR ON CASE VEHICLE?

- (0) NO
(1) YES
(9) UNKNOWN

17

PROVIDE NOTES IF FIRE OCCURRED.

Duplicate columns 1-8
from the previous card.

Module E 9 D 10 Format 0 1
11 12

EXTERIOR DAMAGE

ED-1

HOOD PERFORMANCE

FOR THE FOLLOWING, USE CODES:

- (0) NO
- (1) YES
- (8) NOT APPLICABLE
- (9) UNKNOWN

HOOD LATCH(ES)- -RELEASED

0
13

-DAMAGED

1
14

-JAMMED

1
15

HOOD HINGES- -LEFT, DAMAGED

0
16

-LEFT, SEPARATED
(COMPLETE)

8
17

-RIGHT, DAMAGED

1
18

-RIGHT, SEPARATED
(COMPLETE)

0
19

HOOD REMAINED ON VEHICLE

1
20

REAR EDGE OF HOOD- -ELEVATED

1
21

-CONTACTED WINDSHIELD

0
22

-PENETRATED WINDSHIELD

8
23

HOOD LATCH LOCATION

- (1) FRONT OF VEHICLE
- (2) COWL AREA
- (3) SIDE
- (8) NOT APPLICABLE
- (9) UNKNOWN

1
24

STEERING COL FLEXIBLE COUPLING

FLEXIBLE COUPLING TYPE

- (0) NONE
- (1) FLEXIBLE MATERIAL
- (2) POT
- (3) SINGLE U-JOINT
- (4) DOUBLE U-JOINT
- (5) FLEXIBLE CABLE
- (6) COMBINATION OF ABOVE
(CIRCLE EACH)
- (7) OTHER: _____
- (8) EQUIPPED, TYPE UNKNOWN
- (9) UNKNOWN, IF EQUIPPED

9
26

COUPLING-

-DAMAGED

9
27

(USE CODES
FROM HOOD
PERFORMANCE)

-SEPARATED
(COMPLETE)

9
28

ENG COMPART TELESCOPING UNIT

TYPE OF UNIT

- (00) NONE INSTALLED
- (01) - (07) SEE UNITS ON PAGE ED-2
- (88) NOT COLLECTED
- (97) OTHER: _____
- (98) EQUIPPED, TYPE UNKNOWN
- (99) UNKNOWN IF EQUIPPED

8 8
29 30

ORIGINAL LENGTH (mm)

F (OR H): _____

TELESCOPED LENGTH (mm)

G: _____

DIFFERENCE (mm)

F (OR H) - G

(IF LESS THAN 15mm, ENTER "000".)

- (888) NOT COLLECTED
- (991) NOT MEASURED/NO
COMPRESSION
- (992) COMPRESSED, AMOUNT
UNKNOWN
- (993) DEVICE EXTENDED
- (997) UNABLE TO BE MEASURED
- (998) NOT APPLICABLE (NOT
EQUIPPED)
- (999) UNKNOWN

8 8 8
31 32 33

ENGINE OR TRANSMISSION MOUNT

SEPARATION (COMPLETE)

- (0) NO
- (1) YES
- (9) UNKNOWN

0
25

LEFT-SIDE BODY MOUNT

DID BODY MOUNT SEPARATE?

- (0) NO
 (1) YES
 (8) NOT APPLICABLE
 (9) UNKNOWN

0
 34

LEFT DOORS

HOW DID DOORS
OPEN DURING COLLISION?

USE CODES:

(0) DOOR DID NOT OPEN

OPENED BECAUSE OF

- (1) HINGE AREA SEPARATION
 (2) DOOR-LATCH SEPARATION
 (3) LATCH-STRIKER SEPARATION
 (4) STRIKER-PILLAR SEPARATION
 (5) BODY DISTORTION
 (6) COMBINATION OF ABOVE
 (CIRCLE EACH)
 (7) OPENED, REASON UNKNOWN

- (8) NOT APPLICABLE (NO DOOR)
 (9) UNKNOWN

-FRONT

0
 43

-REAR

8
 44

DOORS JAMMED CLOSED-

USE CODES:

- (0) NO
 (1) YES
 (8) NOT APPLICABLE (NO DOOR)
 (9) UNKNOWN

-FRONT

0
 45

-REAR

8
 46

LEFT PILLARS

PILLARS SEPARATED COMPLETELY -

USE CODES:

- (0) NO
 (1) YES
 (4) NO SEPARATION, BUT DAMAGED
 (8) NOT APPLICABLE (NOT EQUIPPED)
 (9) UNKNOWN

-A-PILLAR, UPPER

0
 35

LOWER

0
 36

-B-PILLAR, UPPER

0
 37

LOWER

0
 38

-C-PILLAR, UPPER

0
 39

LOWER

8
 40

-D-PILLAR, UPPER

8
 41

LOWER

8
 42

EXTERIOR DAMAGE

ED-3

REAR DOOR


REAR DOOR TYPE

- (0) NO DOOR (INCLUDES PICKUPS)
 (1) HATCHBACK
 (2) ONE-WAY TAILGATE
 (3) TWO-WAY TAILGATE
 (4) CLAMSHELL/DISAPPEARING TAILGATE
 (5) SINGLE DOOR
 (6) DOUBLE DOOR
 (9) UNKNOWN

Hatchback



One-way



Two-way



or



Clamshell



Single door



Double door

HOW DID DOOR
OPEN DURING COLLISION?

- (0) DOOR DID NOT OPEN

OPENED BECAUSE OF

- (1) HINGE AREA SEPARATION
 (2) DOOR-LATCH SEPARATION
 (3) LATCH-STRIKER SEPARATION
 (4) STRIKER-PILLAR SEPARATION
 (5) BODY DISTORTION
 (6) COMBINATION OF ABOVE
 (CIRCLE EACH)
 (7) OPENED, REASON UNKNOWN
 (8) NOT APPLICABLE (NO DOOR)
 (9) UNKNOWN

DOOR JAMMED CLOSED

- (0) NO
 (1) YES
 (8) NOT APPLICABLE (NO DOOR)
 (9) UNKNOWN

0
47

8
48

8
49

OTHER REAR DAMAGE

WAS PARTITION TO LUGGAGE AREA
DAMAGED DURING COLLISION?

- (0) NO
 (1) YES
 (8) NOT APPLICABLE
 (9) UNKNOWN

8
50

SPARE TIRE

- (0) NO SPARE TIRE
 (1) NOT ATTACHED BEFORE COLLISION
 (2) ATTACHED, NOT SEPARATED IN COLLISION
 (3) ATTACHED, SEPARATED DUE TO COLLISION
 (8) NOT COLLECTED
 (9) UNKNOWN

8
51

TRAILER HITCH TYPE

- (0) NO HITCH

BALL-AND-SOCKET TYPES

- (1) TEMPORARY FRAMEWORK (E.G. RENTAL CLAMP-ON)
 (2) BUMPER-MOUNT ONLY (E.G. LIGHT TRUCK)
 (3) BUMPER-AND-FRAME (BUT NON-EQUALIZING)
 (4) LOAD EQUALIZING

OTHER TYPES

- (5) RING-AND-PINTLE
 (6) FIFTH-WHEEL (INCL. P/U)
 (7) OTHER (E.G. CLEVIS-AND-PIN)

- (8) EQUIPPED, TYPE UNKNOWN
 (9) UNKNOWN IF EQUIPPED

4
52

TRAILER TYPE
(AT TIME OF COLLISION)

- (0) NO TRAILER
 (1) TRAVEL-TRAILER/CAMPER
 (2) MOBILE HOME
 (3) BOAT/SNOWMOBILE/ATV TRAILER
 (4) UTILITY TRAILER
 (5) TOWED CAR
 (7) OTHER: _____
 (8) TRAILER, TYPE UNKNOWN
 (9) UNKNOWN

0
53

RIGHT-SIDE BODY MOUNT

DID BODY MOUNT SEPARATE?

- (0) NO
 (1) YES
 (8) NOT APPLICABLE
 (9) UNKNOWN

0
 54

RIGHT PILLARS

PILLARS SEPARATED COMPLETELY -

USE CODES:

- (0) NO
 (1) YES
 (4) NO SEPARATION, BUT DAMAGED
 (8) NOT APPLICABLE (NOT EQUIPPED)
 (9) UNKNOWN

-A-PILLAR, UPPER

0
 55

LOWER

0
 56

-B-PILLAR, UPPER

8
 57

LOWER

8
 58

-C-PILLAR, UPPER

0
 59

LOWER

0
 60

-D-PILLAR, UPPER

8
 61

LOWER

8
 62

RIGHT DOORS

HOW DID DOORS
OPEN DURING COLLISION?

USE CODES:

(00) DOOR DID NOT OPEN

OPENED BECAUSE OF

- (01) HINGE AREA SEPARATION
 (02) DOOR-LATCH SEPARATION
 (03) LATCH-STRIKER SEPARATION
 (04) STRIKER-PILLAR SEPARATION
 (05) BODY DISTORTION
 (06) COMBINATION OF ABOVE
 (CIRCLE EACH)
 (07) OPENED, REASON UNKNOWN
 (11) VAN RIGHT-REAR DOOR OPENED
 (ANY MECHANISM)

(98) NOT APPLICABLE (NO DOOR)

(99) UNKNOWN

-FRONT

0 0
 63 64

-REAR

0 0
 65 66

DOORS JAMMED CLOSED-

USE CODES:

- (0) NO
 (1) YES
 (8) NOT APPLICABLE (NO DOOR)
 (9) UNKNOWN

-FRONT

0
 67

-REAR

0
 68

VAN REAR DOOR TYPE

- (0) VAN, NO REAR DOOR
 (1) TRACK (SLIDING) - RIGHT SIDE
 (2) SINGLE-HINGED - RIGHT SIDE
 (3) DOUBLE-HINGED - RIGHT SIDE
 (4) TRACK (SLIDING) - RIGHT & LEFT SIDE
 (5) SINGLE-HINGED - RIGHT & LEFT SIDE
 (6) DOUBLE-HINGED - RIGHT & LEFT SIDE
 (7) TRACK AND HINGED COMBINATION
 (8) NOT APPLICABLE (NOT A VAN)
 (9) UNKNOWN

8
 69

WINDSHIELD DAMAGE

WINDSHIELD CRACKED

- (0) NO
 (1) YES
 (8) NOT APPLICABLE
 (9) UNKNOWN

WINDSHIELD BROKEN
(PLASTIC INTERLAYER TORN)

- (0) NO
 (1) YES
 (8) NOT APPLICABLE
 (9) UNKNOWN

CRACKED OR BROKEN
BY OCCUPANT CONTACT

- (0) NO
 (1) YES
 (8) NOT APPLICABLE
 (9) UNKNOWN

EXTENT OF BOND SEPARATION


- (0) NONE
 (1) 1 - 20%
 (2) 21 - 40
 (3) 41 - 60
 (4) 61 - 80
 (5) 81 - 99
 (6) TOTAL
 (7) SEPARATED, AMOUNT
 UNKNOWN
 (8) NOT APPLICABLE
 (9) UNKNOWN

WINDSHIELD MARK ON CASE VEHICLE:

SOLAR TINT



Ⓢ LAMINATED Ⓢ
 SUN VISION

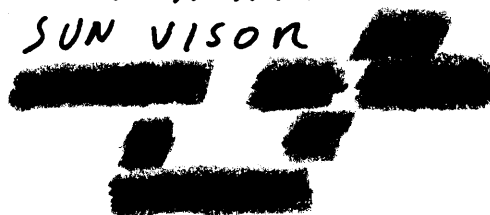

WINDSHIELD CODE

- (97) DESCRIBED BUT NOT CODED
 (98) NOT APPLICABLE (NO WINDSHIELD)
 (99) UNKNOWN

97
 74 75


ROOF

DID T-ROOF/SUN ROOF OPEN
DURING COLLISION?

- (0) NO
 (1) YES
 (8) NOT APPLICABLE
 (NOT A T-ROOF OR SUN ROOF)
 (9) UNKNOWN

8
 76

LOCATE AREA OF WINDSHIELD INTEREST OR DAMAGE WITH DIMENSIONS (VERTICAL
 & HORIZONTAL) ON THIS DIAGRAM OF THE WINDSHIELD AS VIEWED FROM INSIDE.

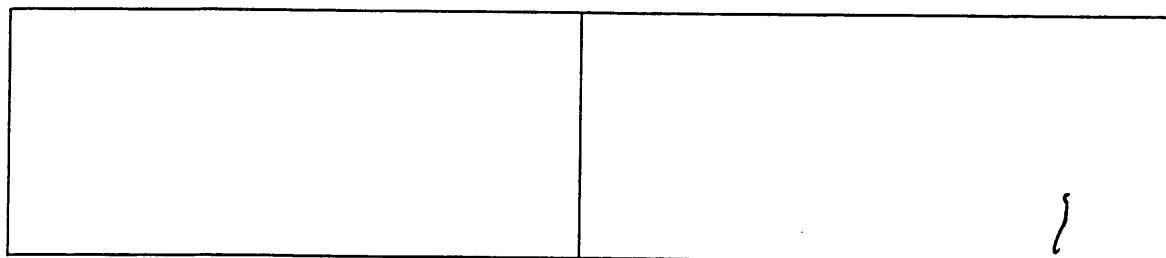

CRACKED

L

C

R

STEERING WHEEL

STEERING WHEEL RIM DAMAGE

- (0) NONE
- (1) DEFORMED SLIGHTLY
- (2) SEVERELY BENT
- (3) BROKEN
- (9) UNKNOWN

0
13

NUMBER OF STEERING WHEEL SPOKES

- (9) UNKNOWN

2
14

STEERING WHL SPOKE DAMAGE

- (0) NONE
- (1) DEFORMED SLIGHTLY
- (2) SEVERELY BENT
- (3) BROKEN
- (9) UNKNOWN


0
15

STEERING WHEEL POSITION AT TIME OF COLLISION

IN WHAT O'CLOCK POSITION WAS THE
NORMAL TOP OF THE WHEEL POINTED
WHEN THE COLLISION OCCURRED?

EXAMPLES

O'CLOCK = 1 2

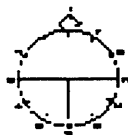

(NORMAL STRAIGHT
AHEAD)

O'CLOCK = 0 2



O'CLOCK = 0 9
on 10

(99) UNKNOWN


STEERING WHEEL ENERGY ABSORBING DEVICE

(1) EXAMPLES:



BARRACUDA, 70 - 74
CHALLENGER, 70 - 74
CAPRI, 71 - 77

(2) EXAMPLES:

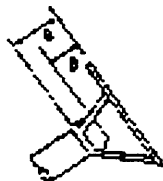

OMNI, 78 -
HORIZON, 78 -

STEERING COLUMN OPTIONS

TILT FEATURE

- (0) NOT EQUIPPED
- (1) YES, EQUIPPED, UNK POSITION
- (2) UP
- (3) MIDDLE
- (4) LOWER
- (9) UNKNOWN IF EQUIPPED

3
16

SWING-AWAY FEATURE

- (0) NOT EQUIPPED
- (1) YES, EQUIPPED
- (9) UNKNOWN IF EQUIPPED

0
17

TELESCOPING FEATURE

- (0) NOT EQUIPPED
- (1) YES, EQUIPPED
- (9) UNKNOWN IF EQUIPPED

0
18

TYPE OF DEVICE

- (0) NONE
- (1) CONVOLUTED OR MESH CYLINDER
- (2) DEEP DISH STEERING WHEEL
- (7) OTHER: _____
- (8) NOT COLLECTED
- (9) UNKNOWN IF EQUIPPED

8
19

ORIGINAL DIMENSION (mm)

A: _____

DAMAGE DIMENSION (mm)

B: _____

DIFFERENCE (mm)

A - B

- (888) NOT COLLECTED
- (991) NOT MEASURED/NO APPARENT COMPRESSION
- (992) COMPRESSED, AMOUNT UNKNOWN
- (993) DEVICE EXTENDED
- (997) UNABLE TO MEASURE
- (998) NOT APPLICABLE (NOT EQUIPPED)
- (999) UNKNOWN

8 8 8
20 22

STEERING WHEEL AND COLUMN SC-2

STEERING COLUMN
ENERGY ABSORBING DEVICE

TYPE OF DEVICE * (IF 27 OR 28)

- (00) NOT EQUIPPED
(88) NOT COLLECTED
(99) UNKNOWN

$$\frac{8}{23} \quad \frac{8}{24}$$

ORIGINAL LENGTH (mm)

C: _____

COMPRESSED LENGTH (mm)

D: _____

BRACKET DEFLECTION (IF CODE 36, 48,
OR 49 ABOVE)

OR

COMPRESSION (OR EXTRUSION) (mm)

C - D (OR E) (TOLERANCE: ± 10)

- (888) NOT COLLECTED
(991) NOT MEASURED/NO APPARENT
COMPRESSION
(992) COMPRESSED, AMOUNT UNKNOWN
(993) DEVICE EXTENDED
(997) UNABLE TO BE MEASURED
(998) NOT APPLICABLE (NOT EQUIPPED)
(999) UNKNOWN


$$\frac{8}{25} \quad \frac{8}{26} \quad \frac{8}{27}$$

* (ADD A & B FOR TOTAL COMPRESSION)

SHEAR CAPSULE SEPARATION (mm)

S (USE AVG. OF LEFT & RIGHT CAPSULES.)

LT:

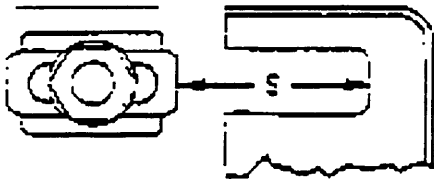

RT:

- (888) NOT COLLECTED
(991) NOT MEASURED/NO APPARENT
SEPARATION
(992) SEPARATED, AMOUNT UNKNOWN
(997) UNABLE TO BE MEASURED
(998) NOT APPLICABLE (NOT EQUIPPED)
(999) UNKNOWN

$$\frac{8}{28} \quad \frac{8}{29} \quad \frac{8}{30}$$

COLUMN VERTICAL ROTATION

- (0) NO APPARENT ROTATION
(1) UPWARD APPARENT ROTATION
(2) DOWNWARD APPARENT ROTATION
(9) UNKNOWN

$$\frac{0}{31}$$

COLUMN LATERAL ROTATION

- (0) NO APPARENT ROTATION
(1) LEFT APPARENT ROTATION
(2) RIGHT APPARENT ROTATION
(9) UNKNOWN

$$\frac{0}{32}$$

STEERING WHEEL (CONTINUED)

STEERING WHEEL HUB DAMAGE

- (0) NONE
(1) OCCUPANT CONTACT
(2) AIRBAG
(3) OTHER _____
(9) UNKNOWN

$$\frac{1}{33}$$


INTRUSION IT-1

[illegible]

OCCUPANT CONTACT WORKSHEET

Contact	Interior Component Contacted	Occupant No. if Known	Body Region if Known	Supporting Physical Evidence	Confidence Level of Contact Point
A	Knee Bolster	DR	Lt. Knee/leg	Scuff	1
B	"	DR	Rt. Knee/leg	Scuff	1
C	SW Hub	DR	Handy forearm	Deformed + marked	2
D	Glove box	RF	Rt. leg	Scuff	1
E	"	"	"	Scuff	1
F	Duct	"	"	"	1
G	center console	RC	Arms/face	Scuff	2
H					
I					
J					

VEHICLE OCCUPANT CONTACT DIAGRAM

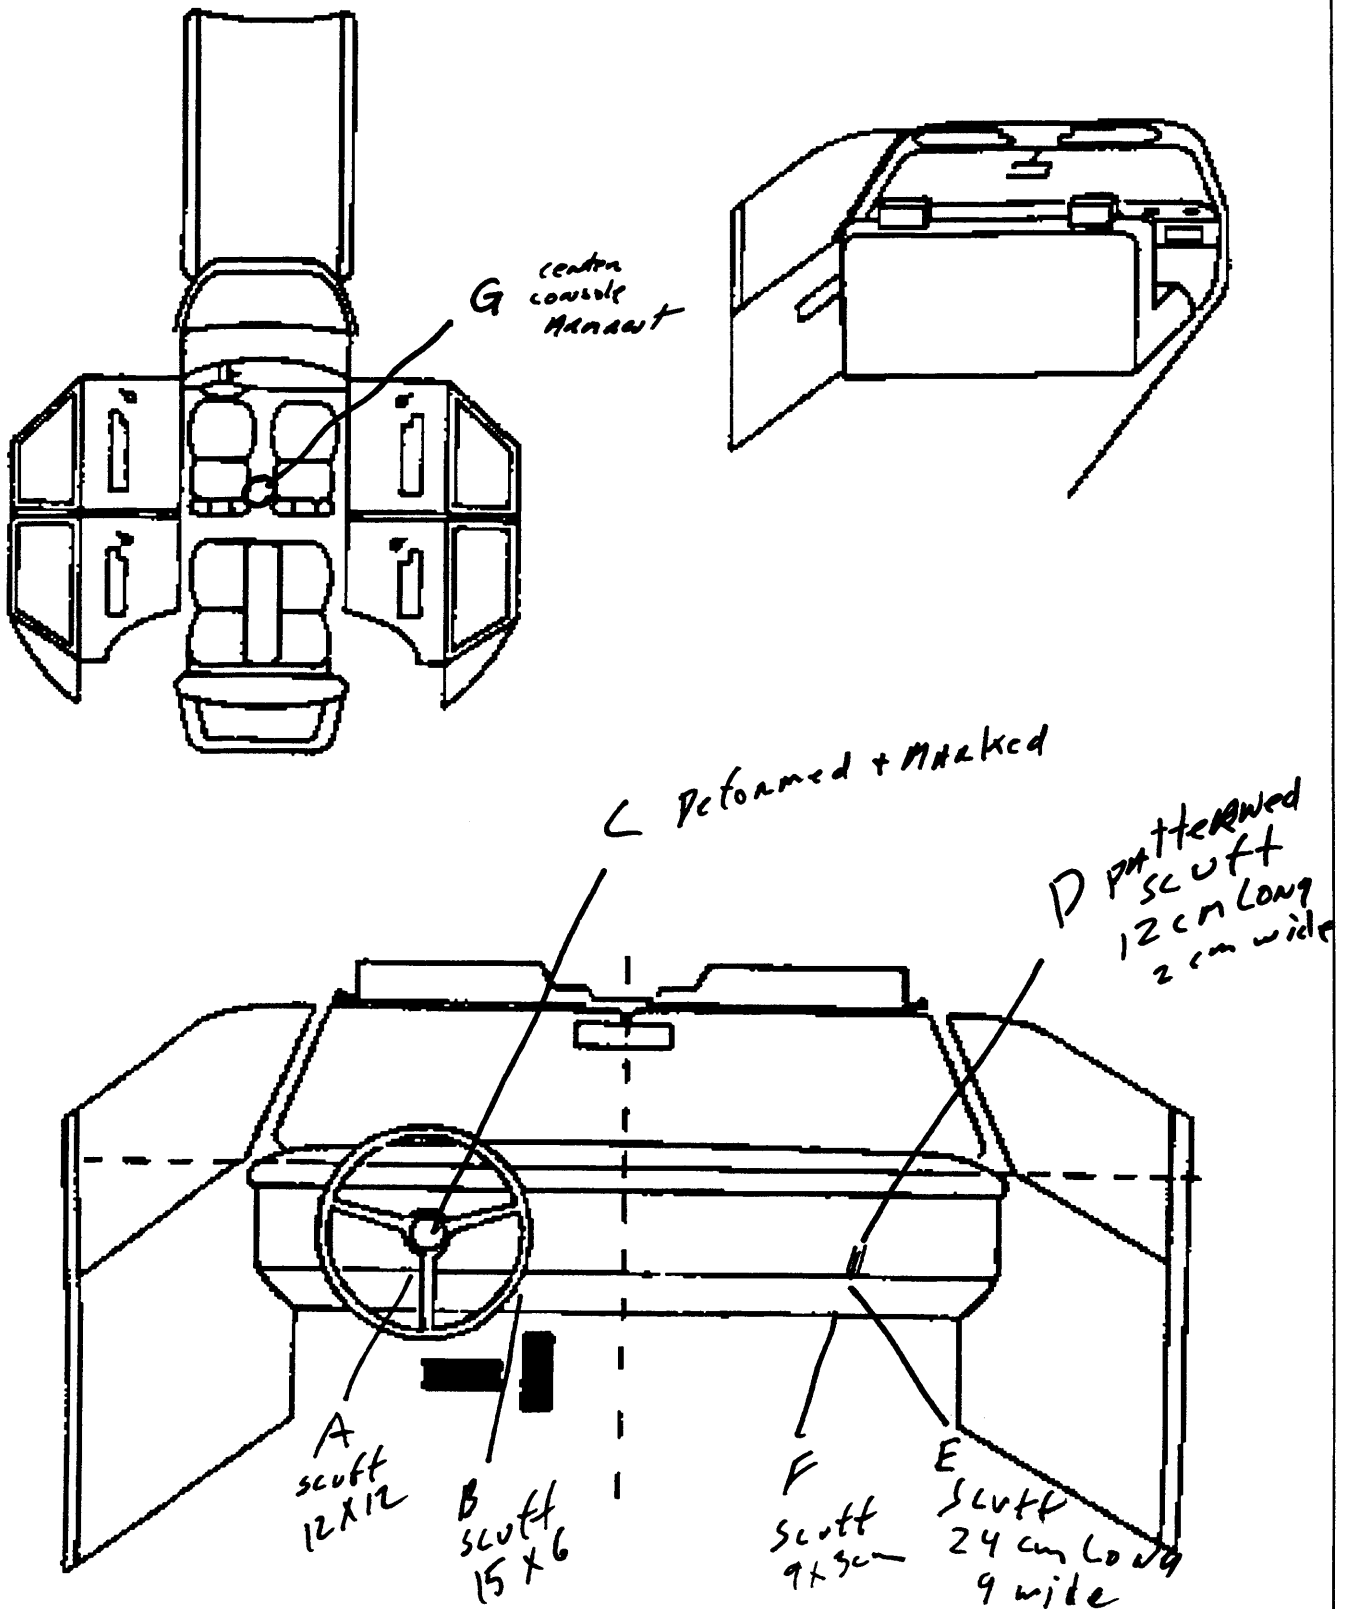

CODES FOR COLUMN B, OCCUPANT SPACE NUMBER

OCCUPANT SPACE NUMBER IS A TWO-DIGIT CODE. THE USE OF THE CODE IS DETERMINED BY THE VEHICLE SEAT CONFIGURATION AT THE TIME OF THE ACCIDENT.

FIRST DIGIT

THE FIRST DIGIT (LEFT DIGIT) DENOTES THE SEAT ROW, WITH CODE VALUES FROM 1 TO 5.

SECOND DIGIT

THE SECOND DIGIT (RIGHT DIGIT) DENOTES THE POSITION ON THE SEAT AND, IN SOME INSTANCES, THE WIDTH OF THE SEAT.

- | | | | |
|--------------------------|-----------------|-------------------------|---|
| (1) LEFT | (3) RIGHT | | INDIVIDUAL SEAT |
| (1) LEFT | (2) CENTER | (3) RIGHT | BENCH: FULL WIDTH 3 PASSENGER |
| (1) LEFT | (2) LEFT CENTER | (6) RIGHT CENTER | (3) RIGHT BENCH: FULL WIDTH 4 PASSENGER |
| (1) LEFT | (2) CENTER | (5) RIGHT & AISLE SPACE | BENCH: PARTIAL WIDTH, LEFT |
| (0) LEFT & SPACE | (2) CENTER | (5) RIGHT & SPACE | BENCH: PARTIAL WIDTH, CENTERED |
| (4) ENTIRE VEHICLE WIDTH | | CARGO AREA | |

EXAMPLES

THE TWO FIGURES BELOW PROVIDE EXAMPLES OF THE OCCUPANT SPACE NUMBER.

PASSENGER CAR
5 PASSENGERS

X	X	11	13
X	X	X	21 22 23

VAN
12 PASSENGER CAPACITY

X	X	11	13
X	X	X	21 22 25
X	X	X	31 32 35
X	X	X	X 41 42 46 43

CODES FOR COLUMN F, MEASUREMENT AXIS

- (X) X-AXIS (FORE & AFT)
(Y) Y-AXIS (LATERAL)
(Z) Z-AXIS (VERTICAL)

CODES FOR COLUMNS G, H, I & J, OCCUPANT & INJURY NUMBERS

OCCUPANT NUMBER	INJURY NUMBER	<u>CONTACT</u>
(00)	(00)	NO CONTACT
(##)	(00)	CONTACT, NO INJURY
(97)	(99)	CONTACT, OCCUPANT UNKNOWN, INJURY UNKNOWN
(99)	(00) OR (99)	UNKNOWN IF CONTACT

CODES FOR COLUMN C, INTRUDING COMPONENT OR OBJECT

NOTE: DO NOT CODE OBJECTS OTHER THAN COMPONENTS OF CASE VEHICLE.

INDIVIDUAL COMPONENT

INTERNAL

- (01) INSTRUMENT PANEL
- (02) FIRE WALL
- (03) TOE PAN
- (04) FLOOR PAN
- (05) STEERING COLUMN
- (06) WINDSHIELD
- (07) WINDSHIELD HEADER
- (08) A-PILLAR
- (09) DOOR PANEL OR SIDE PANEL
- (10) WINDOW FRAME
- (11) B-PILLAR
- (12) C-PILLAR
- (13) D-PILLAR
- (14) ROOF SIDE RAILS
- (15) ROOF OR CONVERTIBLE TOP
- (16) BACKLIGHT HEADER
- (17) FRONT SEAT-BACK SURFACE/
SEAT-BACK BACK SURFACE
- (18) SECOND SEAT-BACK SURFACE
SEAT-BACK BACK SURFACE
- (19) THIRD SEAT-BACK SURFACE
SEAT-BACK BACK SURFACE
- (20) FOURTH SEAT-BACK SURFACE
SEAT-BACK BACK SURFACE
- (21) FIFTH SEAT-BACK SURFACE
SEAT-BACK BACK SURFACE
- (22) BACK PANEL/BACK DOOR SURFACE
- (23) SEAT CUSHION SURFACE/EDGE
- (24) CONSOLE
- (25) OTHER (*DESCRIBE*)
- (26) UNKNOWN INTERNAL SURFACES
- (28) TRANSMISSION TUNNEL (HUMP)
- (29) SIDE FOOTWELL PANEL (KICKPANEL)
- (30) SILL

EXTERNAL

- (43) HOOD
- (44) OBJECT EXTERNAL TO PASSENGER
COMPARTMENT BUT PART
OF CASE VEHICLE
- (45) OUTSIDE SURFACE OF CASE VEHICLE
- (46) OTHER (*E.G. SPARE TIRE,
JACK. DESCRIBE.*)
- (49) UNKNOWN EXTERNAL OBJECT

GROUPED FOR MASSIVE INTRUSION INTO AN OCCUPANT SPACE

USE ONLY IF ALL THESE COMPONENTS
INTRUDED INTO A SINGLE OCCUPANT SPACE.

- | | |
|--|--|
| (50) WINDSHIELD HEADER
A-PILLAR
ROOF SIDE RAIL | (60) ROOF
ROOF RAIL
A-PILLAR
B-PILLAR
C-PILLAR
WINDOW FRAME
DOOR PANEL
FLOOR PAN |
| (51) INSTRUMENT PANEL
A-PILLAR
DOOR PANEL | (61) INSTRUMENT PANEL
TOE PAN
WINDSHIELD HEADER
A-PILLAR
ROOF RAIL
WINDOW FRAME
DOOR PANEL
ROOF |
| (52) INSTRUMENT PANEL
A-PILLAR
WINDSHIELD HEADER | (62) ROOF
ROOF RAIL
C-PILLAR
WINDOW FRAME
FLOOR PAN
SECOND SEAT
DOOR PANEL |
| (53) DOOR PANEL
B-PILLAR
ROOF RAIL | (63) ROOF RAIL
ROOF
B-PILLAR
WINDOW FRAME
FLOOR PAN
DOOR PANEL
SECOND SEAT
FRONT SEAT |
| (54) DOOR PANEL
A-PILLAR
ROOF RAIL | (64) ROOF RAIL
ROOF OR CONVERTIBLE TOP
A-PILLAR
B-PILLAR
WINDOW FRAME
WINDOW HEADER |
| (55) INSTRUMENT PANEL
FLOOR PAN
A-PILLAR
DOOR FRAME | (65) WINDSHIELD
WINDSHIELD HEADER
ROOF SIDE RAIL |
| (56) ROOF RAIL
A-PILLAR
B-PILLAR
WINDOW FRAME | (66) WINDSHIELD
WINDSHIELD HEADER
A-PILLAR |
| (57) ROOF RAIL
A-PILLAR
B-PILLAR
C-PILLAR
DOOR PANEL | (98) NOT APPLICABLE |
| (58) ROOF
ROOF RAIL
WINDOW FRAME
DOOR PANEL | (99) UNKNOWN |
| (59) BACKLIGHT HEADER
ROOF
C-PILLAR
THIRD SEAT-BACK | |

Duplicate columns 1-8
from the previous card.

Module 1 T Format 0 1
9 10 11 12

INTRUSION IT-5

WAS THERE OCCUPANT COMPARTMENT INTRUSION? 0

13

WAS INTRUSION CATASTROPHIC?

14

- (0) NO DO NOT ANSWER NEXT QUESTION. SKIP PAGE.
(1) YES ANSWER NEXT QUESTION.
(9) UNKNOWN SKIP PAGE.

- (0) NO COMPLETE PAGE.
(1) YES SKIP PAGE.

Duplicate columns 1-8
from the previous card.

Module 1 T Format 0 2
9 10 11 12

NOTE: Each line in the table below is a separate record (card). Duplicate columns 1 - 12 for each completed line.

INTRUSIONS CODE INTRUSIONS IN THIS ORDER: LEFT TO RIGHT ON ROW; FRONT TO BACK IN VEHICLES.
CODES FOR B, F, G, H, I, J ON PAGE IT-3
CODES FOR C ON PAGE IT-4

OCCUPANT CONTACT AND INJURY

A	B	C	D	E	F	G	H	I	J	K
INTRUSION NUMBER	OCC. SPACE NO.	INTRUDING COMPONENT OR OBJECT	ASSOC. EVENT NO.	MAXIMUM INTRUSION X AXIS (cm)	MAXIMUM INTRUSION Y AXIS (cm)	MAXIMUM INTRUSION Z AXIS (cm)	OCCUPANT NUMBER	INJURY NUMBER	OCCUPANT NUMBER	INJURY NUMBER
13-14	15-16	17-18	19	20-21	22-23	24-25	26-27	28-29	30-31	32-33
<u>0 1</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>0 2</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>0 3</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>0 4</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>0 5</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>0 6</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>0 7</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —

NOTE: USE ADDITIONAL PAGE IF MORE THAN 7 INTRUSIONS.

Duplicate columns 1-8
from the previous card.

Module 1 T Format 0 3
9 10 11 12

NOTE: IF NO SIDE DOOR INTRUSION,
SKIP REMAINDER OF PAGE.

**SIDE DOOR INTRUSION
RESULTED FROM**

INTRUSION NUMBER	CAUSE	CODES FOR CAUSE:
13 —	15 —	(1) DIRECT IMPACT
16 —	18 —	(2) INDUCED DAMAGE
19 —	21 —	(9) UNKNOWN

**IF DAMAGE TO DOOR COMPONENT RESULTED IN INCREASED
DOOR INTRUSION, CODE COMPONENT**

INTRUSION NUMBER	DAMAGED COMPONENT 1	DAMAGED COMPONENT 2	CODES FOR COMPONENTS
A <u> </u> <u> </u> 22 23	—	<u> </u> 25	(0) NONE
B <u> </u> <u> </u> 26 27	—	<u> </u> 29	(1) A-PILLAR
C <u> </u> <u> </u> 30 31	—	<u> </u> 33	(2) B-PILLAR
D <u> </u> <u> </u> 34 35	—	<u> </u> 37	(3) C-PILLAR
			(4) LATCH/STRIKER
			(5) HINGES
			(7) OTHER: <u> </u>
			(8) NOT APPLICABLE
			(9) UNKNOWN

Duplicate columns 1-8
from the previous card.

Module 1 T Format 0 2
9 10 11 12

INTRUSION IT-6

NOTE: Each line in the table below is a separate record (card).
Duplicate columns 1 - 12 for each completed line.

-- ADDITIONAL PAGE --

INTRUSIONS CODE INTRUSIONS IN THIS ORDER: LEFT TO RIGHT ON ROW; FRONT TO BACK IN VEHICLES.
CODES FOR B, F, G, H, I, J ON PAGE IT-3
CODES FOR C ON PAGE IT-4

OCCUPANT CONTACT AND INJURY

A	B	C	D	E	F	G	H	I	J	K
INTRUSION NUMBER	OCC. SPACE NO.	INTRUDING COMPONENT OR OBJECT	ASSOC. EVENT NO.	MAXIMUM INTRUSION X AXIS (cm)	MAXIMUM INTRUSION Y AXIS (cm)	MAXIMUM INTRUSION Z AXIS (cm)	OCCUPANT NUMBER	INJURY NUMBER	OCCUPANT NUMBER	INJURY NUMBER
13-14	15-16	17-18	19	20-21	22-23	24-25	26-27	28-29	30-31	32-33
<u>0 8</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>0 9</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>1 0</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>1 1</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>1 2</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>1 3</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>1 4</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>1 5</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>1 6</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>1 7</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>1 8</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>1 9</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>2 0</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>2 1</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>2 2</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>2 3</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>2 4</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>2 5</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —

Duplicate columns 1-8 from the previous card.		Module <u>1</u> <u>D</u> Format <u>0</u> <u>1</u> 9 10 11 12		INTERIOR DAMAGE		ID-1	
<p>CODES:</p> <div style="display: flex; justify-content: space-between;"> <div> (0) NO (1) YES (3) NO, and OCCUPANT CONTACT </div> <div> (4) YES, and OCCUPANT CONTACT (8) NOT APPLICABLE (9) UNKNOWN </div> </div>							
SIDES	LEFT	RIGHT	FRONT		INSTRUMENT PANEL		
FRONT DOOR	<u>0</u> 13	<u>4</u> 14	FOOT CONTROLS	<u>0</u> 45	UPPER PANEL	<u>0</u> 55	
FRONT HARDWARE	<u>0</u> 15	<u>0</u> 16	IGNITION KEYS	<u>6</u> 46	MID PANEL	<u>3</u> 56	
FRONT ARMREST	<u>0</u> 17	<u>0</u> 18	REAR VIEW MIRROR	<u>1</u> 47	LOWER PANEL	<u>4</u> 57	
FRONT GLASS	<u>0</u> 19	<u>0</u> 20	SUNVISOR/FITTINGS	<u>0</u> 48	ASHTRAY	<u>0</u> 58	
REAR DOOR AREA	<u>0</u> 21	<u>0</u> 22	(5) LEFT SIDE ONLY (6) RIGHT SIDE ONLY (7) BOTH SIDES		CONTROL KNOBS & LEVERS	<u>0</u> 59	
REAR HARDWARE	<u>0</u> 23	<u>0</u> 24	WINDSHIELD TOP MOLDINGS	<u>0</u> 49	GLOVE COMPARTMENT AREA	<u>3</u> 60	
REAR ARMREST	<u>0</u> 25	<u>0</u> 26	LEFT A-PILLAR (UPPER OR LOWER)	<u>0</u> 50	INSTRUMENTS	<u>0</u> 61	
REAR GLASS	<u>0</u> 27	<u>0</u> 28	RIGHT A-PILLAR (UPPER OR LOWER)	<u>0</u> 51	PARKING BRAKE RELEASE	<u>0</u> 62	
ROOF SIDE RAIL	<u>0</u> 29	<u>0</u> 30	CENTER CONSOLE	<u>8</u> 52	PARKING BRAKE PEDAL	<u>0</u> 63	
B-PILLAR	<u>0</u> 31	<u>8</u> 32	TRANSMISSION SELECTOR LEVER	<u>0</u> 53	A/C OR UPPER VENT OUTLETS	<u>4</u> 64	
C-PILLAR	<u>0</u> 33	<u>0</u> 34	RIM, HORN, SPOKE	<u>4</u> 54	HEATER OR A/C DUCTS	<u>3</u> 65	
D-PILLAR	<u>8</u> 35	<u>8</u> 36			RADIO	<u>0</u> 66	
HEADLINING	<u>0</u> 37	<u>0</u> 38			OTHER: * _____	<u>8</u> 67	
ROOF STRUCTURE	<u>0</u> 39	<u>0</u> 40					
T-ROOF/SUN ROOF	<u>8</u> 41	<u>8</u> 42					
OTHER: * _____	<u>8</u> 43	<u>8</u> 44					
					REAR		
					WINDOW	<u>0</u> 68	
					WINDOW HEADER	<u>6</u> 69	
					CONSOLES		
					VERTICAL	<u>8</u> 70	
					ROOF	<u>8</u> 71	

* MORE THAN ONE ITEM MAY BE NOTED.

Duplicate columns 1-8
from the previous card.

Module S T Format 0 2
9 10 11 12

SEATS

ST-1

FRONT SEAT		DRIVER	PASSENR	FRONT SEAT-BACK		DRIVER	PASSENR
TYPE OF FRONT SEAT (00) NO SEAT (01) STANDARD BENCH (02) SPLIT BACK, 50-50 (03) SPLIT BACK, DRIVER WIDE (04) SPLIT BACK, PASS. WIDE (05) BUCKET (06) CAPTAIN'S CHAIR (07) INDIV. BENCH, 50-50 (08) INDIV. BENCH, DRIVER WIDE (09) INDIV. BENCH, PASS. WIDE (97) OTHER: _____ (99) UNKNOWN		<u>04</u> 13 14	<u>04</u> 15 16	SEAT-BACK TYPE (1) FORWARD FOLDING (2) RIGID (3) RECLINING (7) OTHER: _____ (8) NOT APPLICABLE (9) UNKNOWN		<u>3</u> 30	<u>1</u> 31
TYPE OF SEAT MOUNT (1) STANDARD (2) PEDESTAL (7) OTHER: _____ (8) NOT APPLICABLE (9) UNKNOWN		<u>1</u> 17	<u>1</u> 18	SEAT-BACK LOCK TYPE (0) NONE (1) MANUAL (2) INERTIA (3) POWER (7) OTHER: _____ (8) NOT APPLICABLE (9) UNKNOWN		<u>1</u> 32	<u>1</u> 33
SWIVEL MECHANISM EQUIPPED (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN		<u>0</u> 19	<u>0</u> 20	LOCKS HELD (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN		<u>1</u> 34	<u>1</u> 35
ORIGINAL EQUIPMENT SEATS (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN		<u>1</u> 21	<u>1</u> 22	RECLINER MECHANISM HELD (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN		<u>1</u> 36	<u>2</u> 37
CONTACT OF SEAT BY REAR OCCUPANT (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN		<u>0</u> 23	<u>1?</u> 24	HEAD RESTRAINT HEAD RESTRAINT TYPE (0) NONE (1) ADJUSTABLE (2) INTEGRAL (3) NOT INTEGRAL, BUT CANNOT BE REMOVED (7) OTHER: _____ (8) NOT APPLICABLE (9) UNKNOWN			
FRONT SEAT DAMAGE (0) NONE (1) BACKREST ONLY DAMAGED (2) CUSHION ONLY DAMAGED (3) BACKREST & CUSHION DAMAGED (8) NOT APPLICABLE (9) UNKNOWN		<u>0</u> 25	<u>0</u> 26	REMOVED PRE-CRASH (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN		<u>8</u> 40	<u>8</u> 41
CENTER ARMREST DAMAGED (0) NO (1) YES (7) EQUIPPED, DAMAGE UNKNOWN (8) NOT APPLICABLE (NO CENTER ARMREST) (9) UNKNOWN IF EQUIPPED		<u>1</u> 27		ADJUSTMENT AT CRASH (1) UP (2) DOWN (8) NOT APPLICABLE (9) UNKNOWN		<u>8</u> 42	<u>8</u> 43
FRONT SEAT ROTATION (0) NONE APPARENT (1) FORWARD APPARENT (2) REARWARD APPARENT (3) LEFT APPARENT (4) RIGHT APPARENT (5) MULTIPLE ROTATIONS SPECIFY _____ (8) NOT APPLICABLE (9) UNKNOWN		<u>0</u> 28	<u>0</u> 29	HEAD RESTRAINT DAMAGE (0) NONE (1) DAMAGED BUT NOT SEPARATED (2) SEPARATED (8) NOT APPLICABLE (9) UNKNOWN		<u>0</u> 44	<u>0</u> 45

FRONT SEAT ADJUSTMENT		DRIVER	PASSENGER	SECOND SEAT (CONT.)	
SEAT ADJUSTMENT TYPE (0) NONE (RIGID) (1) MANUAL (2) POWER (7) OTHER: _____ (8) NOT APPLICABLE (NO SEAT) (9) UNKNOWN		<u>1</u> 46	<u>1</u> 47	CENTER ARMREST DAMAGED (0) NO (1) YES (7) EQUIPPED, DAMAGE UNKNOWN (8) NOT APPLICABLE (NO CENTER ARMREST) (9) UNKNOWN IF EQUIPPED	
ADJUSTMENT PROVIDED (1) 2-WAY (2) 4-WAY (3) 6-WAY (7) OTHER: _____ (8) NOT APPLICABLE (9) UNKNOWN		<u>1</u> 48	<u>1</u> 49	SECOND SEAT-BACK LOCKS FOR THE FOLLOWING, USE: (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN	
SEAT ADJUSTER DAMAGE (0) NONE (1) CHUCKING (FREE PLAY) (2) DEFORMED (RELEASED/JAMMED) (3) SEPARATED (7) OTHER: _____ (8) NOT APPLICABLE (9) UNKNOWN		<u>0</u> 50	<u>0</u> 51	LEFT OR CENTER, EQUIPPED <u>0</u> 61	
SEAT ADJUSTER SEPARATION (0) NONE (1) SEPARATED AT FLOOR (2) SEPARATION OF ADJUSTER (3) SEPARATED AT SEAT (8) NOT APPLICABLE (9) UNKNOWN		<u>8</u> 52	<u>8</u> 53	LEFT OR CENTER, HELD (3) SEAT FOLDED DOWN <u>8</u> 63	
PRE-CRASH POSITION (1) FORWARD (2) MIDDLE (3) REARWARD (8) NOT APPLICABLE (9) UNKNOWN		<u>1</u> 54	<u>3</u> 55	RIGHT, EQUIPPED <u>0</u> 65	
				RIGHT, HELD (3) SEAT FOLDED DOWN <u>8</u> 67	
SECOND SEAT TYPE OF SECOND SEAT (0) NONE (1) NON-FOLDING (2) FOLDING (3) CAPTAIN'S CHAIR (4) JUMP SEAT (5) INTEGRAL CHILD SEAT (6) LUGGAGE AREA ACCESS PANEL (9) UNKNOWN		LEFT	RIGHT	THIRD SEAT EQUIPPED <u>0</u> 69	
				BACKREST DAMAGED <u>8</u> 71	
				CUSHION DAMAGED <u>8</u> 73	
SECOND SEAT DAMAGE (0) NONE (1) BACKREST ONLY (DAMAGED OR LOOSENED) (2) CUSHION ONLY (DAMAGED OR LOOSENED) (3) BACKREST & CUSHION (DAMAGED OR LOOSENED) (4) INTEGRAL CHILD SEAT (PRIORITY CODE) (5) LUGGAGE AREA ACCESS PANEL (DAMAGED OR LOOSENED) (8) NOT APPLICABLE (9) UNKNOWN		<u>0</u> 58	<u>0</u> 59	VEHICLE EQUIPPED WITH REAR HEAD RESTRAINTS (0) NOT EQUIPPED (OR REMOVED) (1) EQUIPPED (2) EQUIPPED & DAMAGED (8) NOT APPLICABLE (NO REAR SEAT) (9) UNKNOWN <i>Applies to any rear-seat position</i>	

Duplicate columns 1-8
from the previous card.

Module A B Format 0 1
9 10 11 12

AIRBAG AB-1


<p>DRIVER SIDE</p> <p>LOCATION OF AIRBAG</p> <p>STEERING WHEEL</p> <p>EQUIPPED</p> <p>(0) NO (1) YES (4) PRIOR DEPLOYMENT NOT REINSTALLED (9) UNKNOWN IF AIRBAG EQUIPPED</p> <p>DEPLOYED</p> <p>(0) NO (1) YES (2) PARTIAL/IMPROPER DEPLOYMENT (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN</p>	<p><u>1</u> 13</p> <p><u>1</u> 14</p>	<p>PASSENGER SIDE</p> <p>LOCATION OF AIRBAG</p> <p>INSTRUMENT PANEL (GLOVE BOX)</p> <p>EQUIPPED</p> <p>(0) NO (1) YES (4) PRIOR DEPLOYMENT NOT REINSTALLED (9) UNKNOWN IF AIRBAG EQUIPPED</p> <p>DEPLOYED</p> <p>(0) NO (1) YES (2) PARTIAL/IMPROPER DEPLOYMENT (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN</p>	<p><u>1</u> 16</p> <p><u>1</u> 17</p>
<p>CONDITION OF AIRBAG</p> <p>STEERING WHEEL</p> <p>(0) NO DAMAGE (2) SPLIT OR TORN (3) CUT DURING CRASH (4) BURNED/MELTED (5) CUT POST CRASH (6) OTHER _____ (7) DAMAGED, CONDITION UNKNOWN (8) NOT APPLICABLE (NOT EQUIPPED/NOT DEPLOYED) (9) UNKNOWN IF EQUIPPED OR CONDITION</p>	<p><u>4</u> 15</p>	<p>CONDITION OF AIRBAG</p> <p>INSTRUMENT PANEL (GLOVE BOX)</p> <p>(0) NO DAMAGE (2) SPLIT OR TORN (3) CUT DURING CRASH (4) BURNED/MELTED (5) CUT POST CRASH (6) OTHER _____ (7) DAMAGED, CONDITION UNKNOWN (8) NOT APPLICABLE (NOT EQUIPPED/NOT DEPLOYED) (9) UNKNOWN IF EQUIPPED OR CONDITION</p>	<p><u>0</u> 18</p>
<p>DRIVER SIDE</p> <p>AIRBAG</p> <p>STEERING WHEEL</p> <p>TETHER</p> <p>(0) NO (1) YES (6) OTHER _____ (7) UNKNOWN IF TETHERED (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN IF AIRBAG EQUIPPED</p> <p>MARKED BY CONTACT</p> <p>(0) NO (1) YES (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN</p>	<p><u>1</u> 19</p> <p><u>0</u> 20</p>	<p>PASSENGER SIDE</p> <p>AIRBAG</p> <p>INSTRUMENT PANEL (GLOVE BOX)</p> <p>TETHER</p> <p>(0) NO (1) YES (6) OTHER _____ (7) UNKNOWN IF TETHERED (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN IF AIRBAG EQUIPPED</p> <p>MARKED BY CONTACT</p> <p>(0) NO (1) YES (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN</p>	<p><u>1</u> 21</p> <p><u>0</u> 22</p>

AIRBAG NUMBER ON DRIVER SIDE:

UF 19 wide
17 TALL
LF 18 wide
7 TALL

NOTE AND DESCRIBE ANY AIRBAG CONTACT OR
DAMAGE ON DIAGRAM BELOW:


2 VENTS @
11 + 1 o'clock

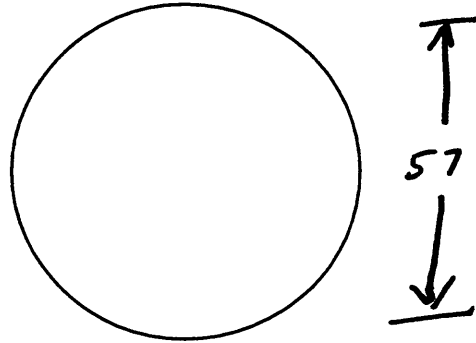

AIRBAG NUMBER ON PASSENGER SIDE:

NO VENTS
17 TALL
39 WIDE

NOTE AND DESCRIBE ANY AIRBAG CONTACT OR
DAMAGE ON DIAGRAM BELOW:

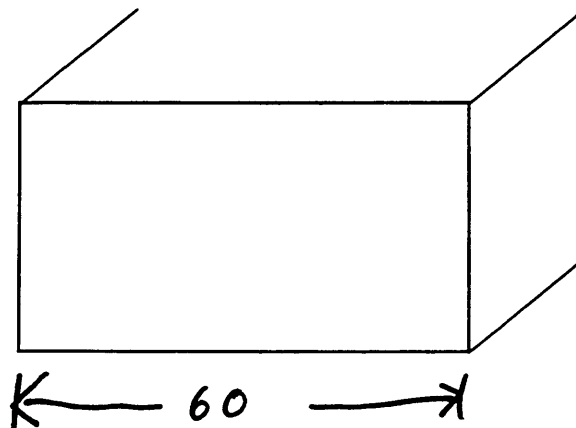

NOTE TO THE INVESTIGATOR:

THE FOLLOWING TWO SECTIONS,
OCCUPANT INFORMATION AND INJURY CLASSIFICATION,
ARE TO BE FILLED IN
FOR EACH CASE VEHICLE OCCUPANT,
WHETHER INJURED OR NOT.

IF THERE IS MORE THAN ONE OCCUPANT,
USE ADDITIONAL COPIES
OF PAGES OC-1, OC-2, OC-3,
AND IC-2 TO DESCRIBE THEM
AND ATTACH THE COPIES TO THIS REPORT.

Duplicate columns 1-8
from the previous card.

Module 0 C Format 0 2
9 10 11 12

OCCUPANT INFORMATION OC-1

OCCUPANT IDENTIFICATION

OCCUPANT NUMBER

01
13 14

ROLE OF OCCUPANT AT 1ST IMPACT

- (1) MOTOR VEHICLE DRIVER
(2) MOTOR VEHICLE PASSENGER
(NOT DRIVER)
(9) UNKNOWN

1
15

OCCUPANT POSITION

ROW LOCATION

- (1) FRONT
(2) SECOND
(3) THIRD
(4) FOURTH
(7) OTHER: _____
(8) EXTERNAL TO PASSENGER
COMPARTMENT (E.G. BED OF PICKUP)
(9) UNKNOWN

1
16

LATERAL LOCATION

- (1) LEFT
(2) LEFT CENTER
(3) CENTER
(4) RIGHT CENTER
(5) RIGHT
(6) ALL (LYING ON SEAT)
(8) EXTERNAL TO PASSENGER
COMPARTMENT
(9) UNKNOWN

1
17

POSTURE

- (10) SITTING ON SEAT
(11) SITTING ON SEAT IN ABNORMAL
POSITION (E.G. FEET ON DASH,
SIDEWAYS)
(12) SITTING ON CONSOLE
(20) ON LAP OR IN ARMS
(30) STANDING ON SEAT
(40) STANDING ON FLOOR
(47) STANDING, EXTERNAL TO
PASSENGER COMPARTMENT
(50) IN BASSINET
(60) IN CHILD SEAT
(65) IN CHILD HARNESS
(70) LYING ON SEAT
(80) LYING/SITTING ON PASSENGER
FLOOR
(83) LYING/SITTING ON OTHER
OBJECT IN PASSENGER
COMPARTMENT: _____
(85) ON CARGO FLOOR/FOLDED
SEAT-BACK
(87) LYING/SITTING, EXTERNAL TO
PASSENGER COMPARTMENT
(97) OTHER: _____
(99) UNKNOWN

10
18 19

PHYSICAL DESCRIPTION

AGE IN YEARS

- (00) LESS THAN 1 YEAR
(98) 98 YEARS OR OLDER
(99) UNKNOWN

43
20 21

AGE IN MONTHS

- (00) LESS THAN 1 MONTH
(25) 25 MONTHS OR OLDER
(99) UNKNOWN

25
22 23

MASS (kg)

- (999) UNKNOWN

(150 lb)

068
24 25 26

HEIGHT (cm)

- (999) UNKNOWN

(5 ft, 2 in)

157
27 28 29

SEX

- (1) MALE
(2) FEMALE
(9) UNKNOWN

2
30

MEDICAL CONDITIONS

TREATMENT/MORTALITY

- (00) NONE
(01) FIRST AID AT SCENE
(02) TREATED AT HOSPITAL/CLINIC
BUT NOT ADMITTED
(03) HOSPITALIZED FOR OBSERVATION
LESS THAN 24 HOURS
(04) HOSPITALIZED OVER 24 HOURS
OR FOR SIGNIFICANT TREATMENT
(05) FATAL, DEAD AT SCENE
(06) FATAL, DOA
(07) FATAL, DEAD WITHIN 24 HOURS
(08) FATAL, DEAD 24 HOURS TO
31 DAYS LATER
(09) FATAL, DEAD 31 DAYS TO
1 YEAR LATER
(10) FATAL DEAD WITHIN UNKNOWN
PERIOD
(99) UNKNOWN

00
31 32

INJURY SEVERITY SCORE (ISS)

- (99) UNKNOWN

00
33 34

NON-IMPACT MED. CONDITIONS

- (0) NONE
(1) YES, TIME & TYPE UNKNOWN
(2) PRE-CRASH FATAL (CLINICAL
DEATH AT WHEEL)
(3) PRE-CRASH NON-FATAL (E.G.
PRIOR INJURY, STROKE)
(4) PREGNANT
(5) POST-CRASH FATAL (DROWNING)
(6) POST-CRASH NON-FATAL INJURY
(7) OTHER: _____
(8) COMBINATION OF ABOVE
(CIRCLE EACH)
(9) UNKNOWN

0
35

OCCUPANT INFORMATION OC-2

MEDICAL CONDITIONS (CONT.)

POLICE INJURY SEVERITY
CODE FOR THIS OCCUPANT

- (0) O - NO INJURY
- (1) C - POSSIBLE INJURY
- (2) B - NON-INCAPACITATING
- (3) A - INCAPACITATING INJURY
- (4) K - FATAL
- (5) INJURED, SEVERITY UNKNOWN
- (6) DIED PRIOR TO IMPACT
- (7) NON-FATAL INJURY,
SEVERITY UNKNOWN
- (9) UNKNOWN

0
36

CHILD SEAT TYPE

- (00) NONE USED
- (01) YES, USED
- (02) INTEGRAL, Chrysler Mini-van
- (88) NOT APPLICABLE
(ADULT OR OLDER CHILD)
- (99) UNKNOWN

88
41 42

CHILD SEAT MAKE/MODEL

RESTRAINT SYSTEM

ACTIVE RESTRAINT SYSTEM

- (0) NONE
- (1) LAP BELT
- (2) SHOULDER HARNESS ONLY
- (3) BOTH LAP BELT &
SHOULDER HARNESS
- (9) UNKNOWN

3
37

ACTIVE RESTRAINT SYSTEM USAGE

- (0) NONE (AVAILABLE BUT NOT USED)
- (1) LAP BELT ONLY
- (2) SHOULDER HARNESS ONLY
- (3) BOTH LAP BELT &
SHOULDER HARNESS
- (7) IMPROPER USAGE
- (8) NOT APPLICABLE (NONE AVAILABLE)
- (9) UNKNOWN

3
38

PASSIVE RESTRAINT SYSTEM

- (0) NONE
- (1) AIRBAG INSTALLED
- (2) PASSIVE UPPER TORSO
WITH KNEE BOLSTERS
- (3) PASSIVE UPPER TORSO
WITHOUT KNEE BOLSTERS
- (4) PASSIVE LAP & UPPER TORSO
- (5) AIRBAG INSTALLED &
PASSIVE RESTRAINT
- (7) OTHER: _____
- (9) UNKNOWN

1
39

PASSIVE RESTRAINT SYSTEM USAGE

- (0) SYSTEM DEFEATED
- (1) AIRBAG NOT DEPLOYED
- (2) AIRBAG DEPLOYED
- (3) AIRBAG NOT REINSTALLED
- (4) PASSIVE UPPER TORSO USED
- (5) PASSIVE LAP & UPPER TORSO USED
- (6) SYSTEM USED IN MANUAL MODE
- (7) IMPROPER USAGE
- (8) NOT APPLICABLE (NOT ORIGINALLY
EQUIPPED)
- (9) UNKNOWN

2
40

EJECTION

DEGREE OF EJECTION

- (0) NONE
- (1) PARTIAL
- (2) COMPLETE
- (7) EJECTED, DEGREE UNKNOWN
- (9) UNKNOWN IF EJECTED

0
43

AREA OF EJECTION

- (01) WINDOW, LEFT SIDE
- (02) WINDOW, RIGHT SIDE
- (03) WINDOW, REAR
- (04) DOOR, LEFT SIDE
- (05) DOOR, RIGHT SIDE
- (06) DOOR, REAR OR TAILGATE
- (07) WINDSHIELD
- (08) ROOF OR OPEN CONVERTIBLE OR
FROM EXTERNAL AREA
- (96) EJECTED AREA UNKNOWN
- (97) OTHER AREA: _____
- (98) NOT APPLICABLE (NOT EJECTED)
- (99) UNKNOWN IF EJECTED

98
44 45

IF OCCUPANT WAS EJECTED, DESCRIBE
IN DETAIL BELOW:

HEAD RESTRAINT

HEAD RESTRAINT AVAILABLE
FOR THIS POSITION

- (0) NOT EQUIPPED OR REMOVED
- (1) EQUIPPED
- (9) UNKNOWN

1
46

OCCUPANT INFORMATION OC-3

OCCUPANT EYEWEAR

- (0) NONE
- (1) GLASSES
- (2) CONTACTS
- (3) BOTH GLASSES AND CONTACTS
- (4) OTHER _____
- (8) NOT APPLICABLE
- (9) UNKNOWN

9
47



SOURCE OF INFORMATION

- ☒ (0) INTERVIEW
- (1) HOSPITAL
- (2) AUTOPSY
- ☒ (3) POLICE
- (4) OTHER _____
- (5) LAY CORONER/EXTERNAL EXAM
- (7) COMBINATION OF ABOVE (CIRCLE)
- (8) NOT APPLICABLE
- (9) UNKNOWN

7
48

INDICATE LOCATION OF INJURIES.

No reported injury

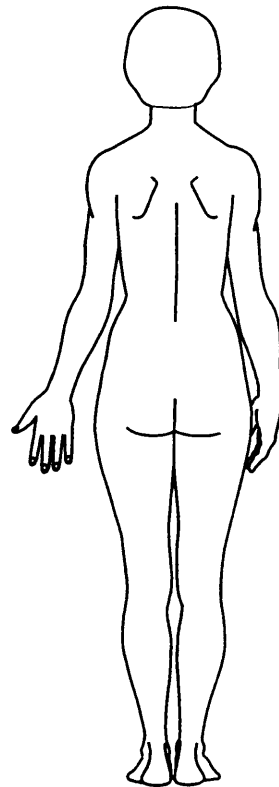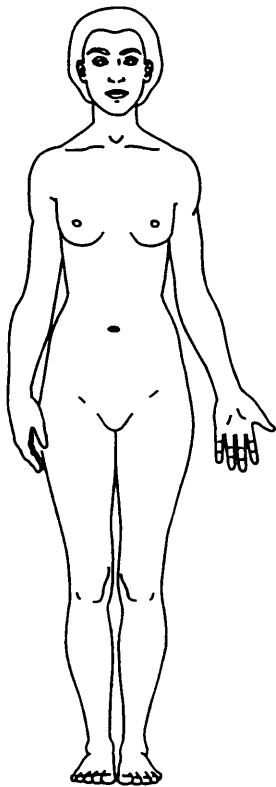

Duplicate columns 1-8 from the previous card. Module 1 C Format 0 1
9 10 11 12

INJURY CLASSIFICATION IC-1

NOTE: Each line in the table below is a separate record (card).
Duplicate columns 1 - 12 for each completed line.

OCCUPANT INJURY CLASSIFICATION

					PRIMARY OIC					ASSOCIATED OIC					COMMENTS
OCCUPANT NUMBER	INJURY NUMBER	PLACE CONTACTS IN ORDER OF PROBABILITY (HORIZONTALLY). START WITH MOST PROBABLE IN 1ST CONTACT AREA COLUMN.		AREA(S) OF POSSIBLE CONTACT 1ST 2ND	BODY REGION 1	ASPECT 2	LESION 3	SYSTEM/ORGAN 4	SEVERITY 5	BODY REGION 1	ASPECT 2	LESION 3	SYSTEM/ORGAN 4	SEVERITY 5	
		17-18	19-20												
13-14	15-16	17-18	19-20	COMMENTS	21	22	23	24	25	26	27	28	29	30	
01	---	---	---	<i>No Injury</i>	---	---	---	---	---	---	---	---	---	---	
---	---	---	---		---	---	---	---	---	---	---	---	---	---	
---	---	---	---		---	---	---	---	---	---	---	---	---	---	
---	---	---	---		---	---	---	---	---	---	---	---	---	---	
---	---	---	---		---	---	---	---	---	---	---	---	---	---	
---	---	---	---		---	---	---	---	---	---	---	---	---	---	
---	---	---	---		---	---	---	---	---	---	---	---	---	---	
---	---	---	---		---	---	---	---	---	---	---	---	---	---	
---	---	---	---		---	---	---	---	---	---	---	---	---	---	
---	---	---	---		---	---	---	---	---	---	---	---	---	---	
---	---	---	---		---	---	---	---	---	---	---	---	---	---	
---	---	---	---		---	---	---	---	---	---	---	---	---	---	
---	---	---	---		---	---	---	---	---	---	---	---	---	---	
---	---	---	---		---	---	---	---	---	---	---	---	---	---	
---	---	---	---		---	---	---	---	---	---	---	---	---	---	
---	---	---	---		---	---	---	---	---	---	---	---	---	---	
---	---	---	---		---	---	---	---	---	---	---	---	---	---	
---	---	---	---		---	---	---	---	---	---	---	---	---	---	
---	---	---	---		---	---	---	---	---	---	---	---	---	---	

NOTE: USE ADDITIONAL PAGES IF NECESSARY.

CODES FOR AREAS OF POSSIBLE OCCUPANT CONTACT

FRONT OF PASSENGER COMPARTMENT

- (10) SUNVISOR, FITTING(S) &/OR TOP MOLDING
- (12) WINDSHIELD
- (05) INSTRUMENT PANEL (*SPECIFIC AREA UNKNOWN*)
- (54) UPPER INSTRUMENT PANEL (*X*)
- (55) MIDDLE INSTRUMENT PANEL (*Y*)
- (56) LOWER INSTRUMENT PANEL (*Z*)
- (81) ASH TRAY (*INSTRUMENT PANEL*)
- (02) GLOVE COMPARTMENT AREA
- (47) AIRBAG (*ACRS*) COMPARTMENT DOOR/COVER
- (57) BENEATH INSTRUMENT PANEL
- (53) PARCEL TRAY
- (48) KNEE RESTRAINT
- (86) VERTICAL CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (09) STEERING ASSEMBLY (*SPECIFIC AREA UNKNOWN*)
- (65) STEERING WHEEL
- (66) STEERING WHEEL COLUMN
- (59) TRANSMISSION LEVER ON COLUMN
- (03) HARDWARE ITEM (*SPECIFIC AREA UNKNOWN*)
- (82) INSTRUMENT(S)
- (83) CONTROL KNOB(S) & LEVER(S) (*FRONT*)
- (84) PARKING BRAKE HANDLE IN FRONT
- (67) IGNITION KEY
- (06) MIRROR
- (04) HEATER OR AIR CONDITIONING DUCTS
- (01) AIR CONDITIONING OR VENTILATION OUTLET(S)
- (08) RADIO (*BUILT IN*)
- (58) ADD-ON TAPE DECK, RADIO, A/C
- (68) ROOF MOUNTED CONTROLS/CONSOLES

REAR

- (88) SURFACE OF REAR INTERIOR
- (23) REAR WINDOW
- (39) REAR WINDOW HEADER
- (50) REAR SEAT CUSHION & BACK

INTERIOR-GENERAL

- (11) TRANSMISSION SELECTION LEVER (*LOCATION UNK.*)
- (59) TRANSMISSION LEVER ON STEERING COLUMN
- (44) TRANSMISSION LEVER ON FLOOR OR CONSOLE
- (07) PARKING BRAKE HANDLE (*LOCATION UNKNOWN*)
- (84) PARKING BRAKE HANDLE IN FRONT
- (85) PARKING BRAKE HANDLE ON FLOOR OR CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (29) FRONT SEAT-BACK(S)
- (51) FRONT SEAT CUSHION
- (50) REAR SEAT CUSHION & BACK
- (49) ARMREST ON SEAT
- (89) UNDER SEAT BOTTOM
- (33) RESTRAINT SYSTEM HARDWARE
- (34) RESTRAINT SYSTEM WEBBING
- (87) AIR CUSHION SKIN (*AIRBAG*)
- (47) AIRBAG (*ACRS*) COMPARTMENT DOOR/COVER
- (46) AIRBAG GAS
- (48) KNEE RESTRAINT
- (30) HEAD RESTRAINT
- (42) CHILD SEAT RESTRAINTS
- (43) CHILD SEAT
- (31) INTERIOR LOOSE OBJECT
- (32) OTHER OCCUPANT(S)
- (52) INTERNAL FLYING GLASS (*FROM ANY SOURCE*)
- (41) UNKNOWN INTERIOR SURFACE

SIDES

- (20) SURFACE OF SIDE INTERIOR
- (19) HARDWARE ON SIDE OR DOOR
- (13) ARMREST ON SIDE OR DOOR
- (24) COAT HOOK
- (22) WINDOW GLASS (*SIDE*)
- (21) WINDOW FRAMES (*SIDE*)
- (26) ROOF SIDE RAIL
- (14) A-PILLAR
- (15) B-PILLAR
- (16) C-PILLAR
- (17) D-PILLAR

FLOOR

- (40) FLOOR
- (27) CONSOLE ON FLOOR OR BETWEEN SEATS
- (44) TRANSMISSION LEVER ON FLOOR OR CONSOLE
- (85) PARKING BRAKE HANDLE ON FLOOR OR CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (91) KICKPANEL

ROOF

- (25) ROOF OR CONVERTIBLE TOP
- (10) SUNVISOR, FITTING(S) &/OR TOP MOLDING
- (26) ROOF SIDE RAIL
- (24) COAT HOOK
- (18) DOME LIGHT
- (39) BACKLIGHT HEADER
- (68) ROOF MOUNTED CONTROLS/CONSOLE
- (69) ROLL BAR

EXTERIOR SURFACE OF CASE VEHICLE

- (37) OUTSIDE SURFACE OF CASE VEHICLE (*SPECIFIC AREA UNKNOWN*)
- (35) HOOD OF CASE VEHICLE
- (60) EXTERIOR OF CASE VEHICLE (*E.G. OUTSIDE MIRRORS, ANTENNA, TRIM*)
- (62) EXTERIOR SIDE ROOF RAIL OF CASE VEHICLE
- (63) TRUNK LID OF CASE VEHICLE
- (64) TIRES OF CASE VEHICLE

BEYOND CASE VEHICLE BOUNDARY

- (36) AREA EXTERIOR TO CAR (*SPECIFIC AREA UNK.*)
- (70) HOOD OF OTHER VEHICLE
- (71) OTHER VEHICLE EXTERIOR HARDWARE (*E.G. OUTSIDE MIRRORS, ANTENNA, TRIM*)
- (73) EXTERIOR SIDE ROOF RAIL OF OTHER VEHICLE
- (74) HEADLIGHT OR FRONT GRILL OF OTHER VEH.
- (75) TRUNK OF OTHER VEHICLE
- (76) OUTSIDE SURFACE OF OTHER VEHICLE
- (77) TIRES OF OTHER VEHICLE
- (78) GROUND
- (79) WATER
- (80) EXTERIOR OBJECT (*NOT VEHICLE, GROUND, OR WATER. PLEASE DESCRIBE.*)


PENETRATING OBJECTS

- (61) OTHER VEHICLE
- (72) OBJECTS (*DESCRIBE*)

MISCELLANEOUS

- (00) NO CONTACT (*INVALID FIELD FORM CODE*)
- (38) OTHER (*E.G. FIRE. DESCRIBE*)
- (90) SPARE TIRE
- (96) INDUCED
- (97) EJECTED, UNKNOWN CONTACT
- (98) IMPACT FORCE, "WHIPLASH", HYPEREXTENSION/COMPRESSION
- (99) UNKNOWN AREA OF CONTACT

THE FIGURE BELOW
IS AN EXPLANATION OF THE BODY REGION CODES
LISTED ON PAGE IC - 4.

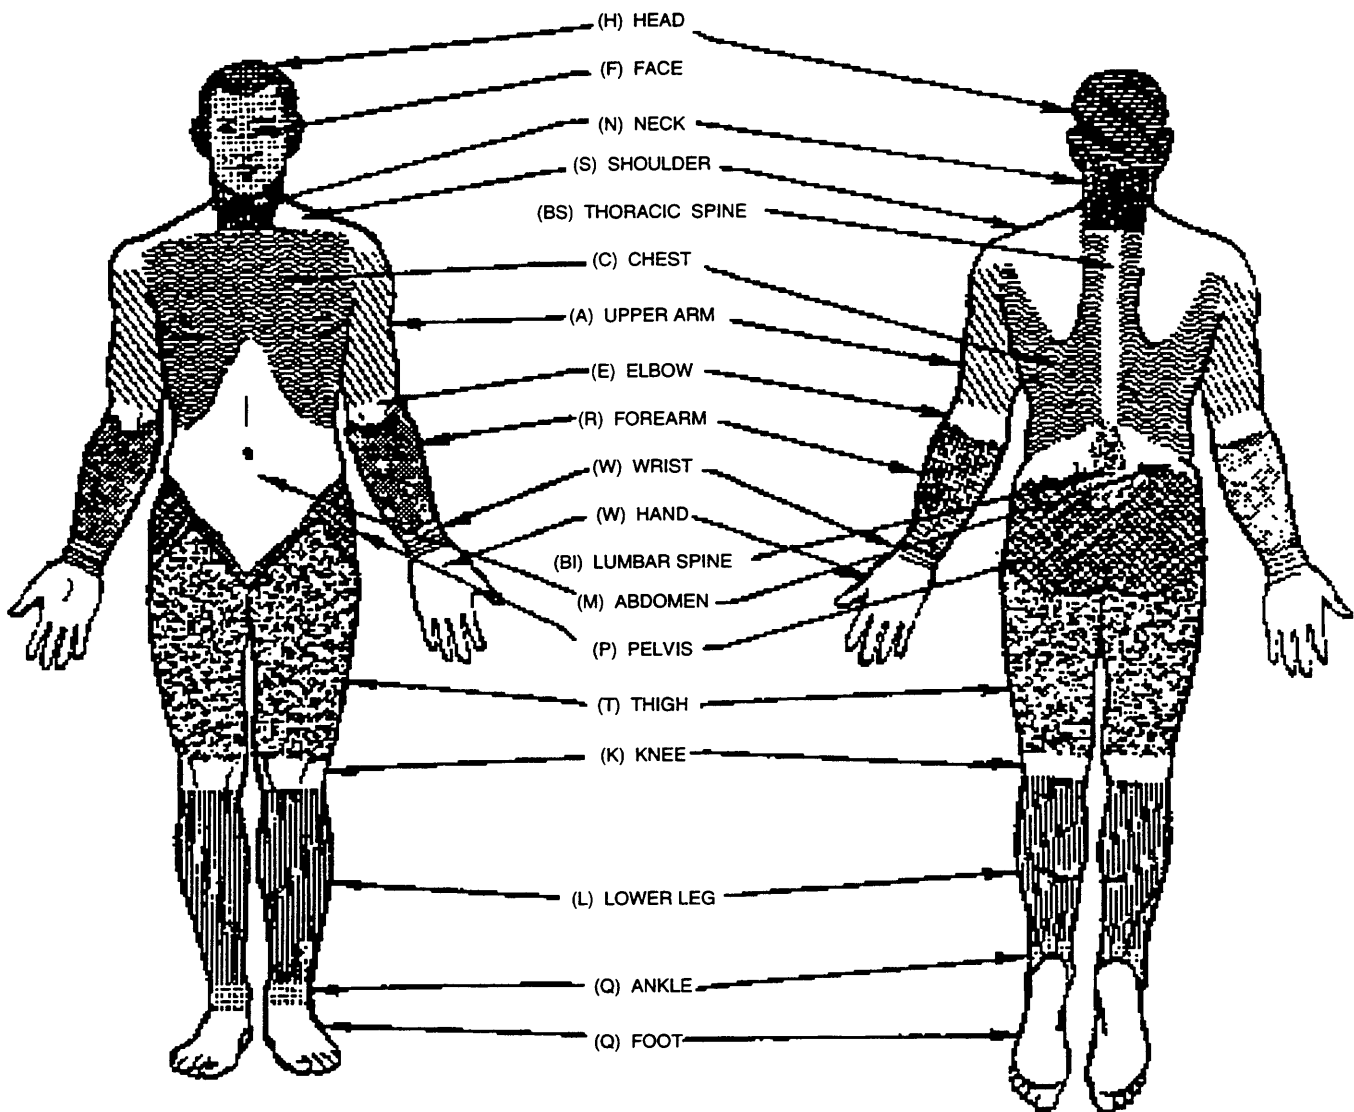

CODES FOR OCCUPANT INJURY CLASSIFICATION (OIC)

1 BODY REGION

(H) HEAD/SKULL
 (F) FACE
 (N) NECK
 (S) SHOULDER
 (X) UPPER EXTREMITIES
 (A) ARM (*UPPER*)
 (E) ELBOW
 (R) FOREARM
 (W) WRIST/HAND
 (C) CHEST
 (M) ABDOMEN
 (B) BACK
 (P) PELVIC/HIP
 (Y) LOWER EXTREMITIES
 (T) THIGH
 (K) KNEE
 (L) LEG (*LOWER*)
 (Q) ANKLE/FOOT
 (O) WHOLE BODY
 (U) UNKNOWN

3 LESION

(L) LACERATION
 (C) CONTUSION
 (A) ABRASION
 (F) FRACTURE
 (P) PERFORATION,
 PUNCTURE
 (K) CONCUSSION
 (V) AVULSION
 (R) RUPTURE
 (S) SPRAIN
 (D) DISLOCATION
 (N) CRUSH
 (M) AMPUTATION
 (B) BURN
 (G) DETACHMENT,
 SEPARATION
 (Z) FRACTURE AND
 DISLOCATION
 (T) STRAIN
 (E) TOTAL SEVERANCE,
 TRANSECTION
 (O) OTHER
 (U) UNKNOWN

4 SYSTEM/ORGAN

(S) SKELETAL
 (V) VERTEBRAE
 (J) JOINTS
 (D) DIGESTIVE
 (L) LIVER
 (N) NERVOUS SYSTEM
 (B) BRAIN
 (C) SPINAL CORD
 (E) EARS
 (O) EYES
 (A) ARTERIES
 (H) HEART
 (Q) SPLEEN
 (G) UROGENITAL
 (K) KIDNEYS
 (R) RESPIRATORY
 (P) PULMONARY/LUNGS
 (M) MUSCLES
 (T) THYROID, OTHER
 ENDOCRINE GLAND
 (I) INTEGUMENTARY (*SKIN*)
 (W) ALL SYSTEMS IN REGION
 (U) UNKNOWN

2 ASPECT

(R) RIGHT
 (L) LEFT
 (B) BILATERAL
 (C) CENTRAL
 (A) ANTERIOR/FRONT
 (P) POSTERIOR/BACK
 (S) SUPERIOR/UPPER
 (I) INFERIOR/LOWER
 (W) WHOLE REGION
 (U) UNKNOWN

BODY REGION	ASPECT	LESION	SYSTEM/ORGAN	SEVERITY
1	2	3	4	5

5 SEVERITY
(OR "AIS", ABBREVIATED INJURY SCALE)

(0) NONE
 (1) MINOR
 (2) MODERATE
 (3) SERIOUS
 (4) SEVERE
 (5) CRITICAL
 (6) MAXIMUM
 (9) UNKNOWN

Duplicate columns 1-8
from the previous card.

Module 0 C Format 0 2
9 10 11 12

OCCUPANT INFORMATION OC-1

OCCUPANT IDENTIFICATION

OCCUPANT NUMBER

02
13 14

ROLE OF OCCUPANT AT 1ST IMPACT

- (1) MOTOR VEHICLE DRIVER
(2) MOTOR VEHICLE PASSENGER
(NOT DRIVER)
(9) UNKNOWN

2
15

PHYSICAL DESCRIPTION

AGE IN YEARS

- (00) LESS THAN 1 YEAR
(98) 98 YEARS OR OLDER
(99) UNKNOWN

14
20 21

AGE IN MONTHS

- (00) LESS THAN 1 MONTH
(25) 25 MONTHS OR OLDER
(99) UNKNOWN

25
22 23

MASS (kg)

- (999) UNKNOWN

(112 lb)

051
24 25 26

HEIGHT (cm)

- (999) UNKNOWN

(5 ft, 3 in)

160
27 28 29

SEX

- (1) MALE
(2) FEMALE
(9) UNKNOWN

1
30

OCCUPANT POSITION

ROW LOCATION

- (1) FRONT
(2) SECOND
(3) THIRD
(4) FOURTH
(7) OTHER: _____
(8) EXTERNAL TO PASSENGER
COMPARTMENT (E.G. BED OF PICKUP)
(9) UNKNOWN

1
16

LATERAL LOCATION

- (1) LEFT
(2) LEFT CENTER
(3) CENTER
(4) RIGHT CENTER
(5) RIGHT
(6) ALL (LYING ON SEAT)
(8) EXTERNAL TO PASSENGER
COMPARTMENT
(9) UNKNOWN

5
17

POSTURE

- (10) SITTING ON SEAT
(11) SITTING ON SEAT IN ABNORMAL
POSITION (E.G. FEET ON DASH,
SIDEWAYS)
(12) SITTING ON CONSOLE
(20) ON LAP OR IN ARMS
(30) STANDING ON SEAT
(40) STANDING ON FLOOR
(47) STANDING, EXTERNAL TO
PASSENGER COMPARTMENT
(50) IN BASSINET
(60) IN CHILD SEAT
(65) IN CHILD HARNESS
(70) LYING ON SEAT
(80) LYING/SITTING ON PASSENGER
FLOOR
(83) LYING/SITTING ON OTHER
OBJECT IN PASSENGER
COMPARTMENT: _____
(85) ON CARGO FLOOR/FOLDED
SEAT-BACK
(87) LYING/SITTING, EXTERNAL TO
PASSENGER COMPARTMENT
(97) OTHER: _____
(99) UNKNOWN

10
18 19

MEDICAL CONDITIONS

TREATMENT/MORTALITY

- (00) NONE
(01) FIRST AID AT SCENE
(02) TREATED AT HOSPITAL/CLINIC
BUT NOT ADMITTED
(03) HOSPITALIZED FOR OBSERVATION
LESS THAN 24 HOURS
(04) HOSPITALIZED OVER 24 HOURS
OR FOR SIGNIFICANT TREATMENT
(05) FATAL, DEAD AT SCENE
(06) FATAL, DOA
(07) FATAL, DEAD WITHIN 24 HOURS
(08) FATAL, DEAD 24 HOURS TO
31 DAYS LATER
(09) FATAL, DEAD 31 DAYS TO
1 YEAR LATER
(10) FATAL DEAD WITHIN UNKNOWN
PERIOD
(99) UNKNOWN

00
31 32

INJURY SEVERITY SCORE (ISS)

- (99) UNKNOWN

00
33 34

NON-IMPACT MED. CONDITIONS

- (0) NONE
(1) YES, TIME & TYPE UNKNOWN
(2) PRE-CRASH FATAL (CLINICAL
DEATH AT WHEEL)
(3) PRE-CRASH NON-FATAL (E.G.
PRIOR INJURY, STROKE)
(4) PREGNANT
(5) POST-CRASH FATAL (DROWNING)
(6) POST-CRASH NON-FATAL INJURY
(7) OTHER: _____
(8) COMBINATION OF ABOVE
(CIRCLE EACH)
(9) UNKNOWN

0
35

MEDICAL CONDITIONS (CONT.)

POLICE INJURY SEVERITY
CODE FOR THIS OCCUPANT

- (0) O - NO INJURY
 (1) C - POSSIBLE INJURY
 (2) B - NON-INCAPACITATING
 (3) A - INCAPACITATING INJURY
 (4) K - FATAL
 (5) INJURED, SEVERITY UNKNOWN
 (6) DIED PRIOR TO IMPACT
 (7) NON-FATAL INJURY,
 SEVERITY UNKNOWN
 (9) UNKNOWN

0
36

CHILD SEAT TYPE

- (00) NONE USED
 (01) YES, USED
 (02) INTEGRAL, Chrysler Mini-van
 (88) NOT APPLICABLE
 (ADULT OR OLDER CHILD)
 (99) UNKNOWN

8 8
41 42

CHILD SEAT MAKE/MODEL

RESTRAINT SYSTEM

ACTIVE RESTRAINT SYSTEM

- (0) NONE
 (1) LAP BELT
 (2) SHOULDER HARNESS ONLY
 (3) BOTH LAP BELT &
 SHOULDER HARNESS
 (9) UNKNOWN

3
37

ACTIVE RESTRAINT SYSTEM USAGE

- (0) NONE (AVAILABLE BUT NOT USED)
 (1) LAP BELT ONLY
 (2) SHOULDER HARNESS ONLY
 (3) BOTH LAP BELT &
 SHOULDER HARNESS
 (7) IMPROPER USAGE
 (8) NOT APPLICABLE (NONE AVAILABLE)
 (9) UNKNOWN

3
38

PASSIVE RESTRAINT SYSTEM

- (0) NONE
 (1) AIRBAG INSTALLED
 (2) PASSIVE UPPER TORSO
 WITH KNEE BOLSTERS
 (3) PASSIVE UPPER TORSO
 WITHOUT KNEE BOLSTERS
 (4) PASSIVE LAP & UPPER TORSO
 (5) AIRBAG INSTALLED &
 PASSIVE RESTRAINT
 (7) OTHER: _____
 (9) UNKNOWN

1
39

PASSIVE RESTRAINT SYSTEM USAGE

- (0) SYSTEM DEFEATED
 (1) AIRBAG NOT DEPLOYED
 (2) AIRBAG DEPLOYED
 (3) AIRBAG NOT REINSTALLED
 (4) PASSIVE UPPER TORSO USED
 (5) PASSIVE LAP & UPPER TORSO USED
 (6) SYSTEM USED IN MANUAL MODE
 (7) IMPROPER USAGE
 (8) NOT APPLICABLE (NOT ORIGINALLY
 EQUIPPED)
 (9) UNKNOWN

2
40

EJECTION

DEGREE OF EJECTION

- (0) NONE
 (1) PARTIAL
 (2) COMPLETE
 (7) EJECTED, DEGREE UNKNOWN
 (9) UNKNOWN IF EJECTED

0
43

AREA OF EJECTION

- (01) WINDOW, LEFT SIDE
 (02) WINDOW, RIGHT SIDE
 (03) WINDOW, REAR
 (04) DOOR, LEFT SIDE
 (05) DOOR, RIGHT SIDE
 (06) DOOR, REAR OR TAILGATE
 (07) WINDSHIELD
 (08) ROOF OR OPEN CONVERTIBLE OR
 FROM EXTERNAL AREA
 (96) EJECTED AREA UNKNOWN
 (97) OTHER AREA: _____
 (98) NOT APPLICABLE (NOT EJECTED)
 (99) UNKNOWN IF EJECTED

9 8
44 45

IF OCCUPANT WAS EJECTED, DESCRIBE
IN DETAIL BELOW:

HEAD RESTRAINT

HEAD RESTRAINT AVAILABLE
FOR THIS POSITION

- (0) NOT EQUIPPED OR REMOVED
 (1) EQUIPPED
 (9) UNKNOWN

1
46

OCCUPANT INFORMATION OC-3

OCCUPANT EYEWEAR

- (0) NONE
- (1) GLASSES
- (2) CONTACTS
- (3) BOTH GLASSES AND CONTACTS
- (4) OTHER _____
- (8) NOT APPLICABLE
- (9) UNKNOWN

9
47



SOURCE OF INFORMATION

- ☒ (0) INTERVIEW
- (1) HOSPITAL
- (2) AUTOPSY
- ☒ (3) POLICE
- (4) OTHER _____
- (5) LAY CORONER/EXTERNAL EXAM
- (7) COMBINATION OF ABOVE (CIRCLE)
- (8) NOT APPLICABLE
- (9) UNKNOWN

7
48

INDICATE LOCATION OF INJURIES.

No reported injury

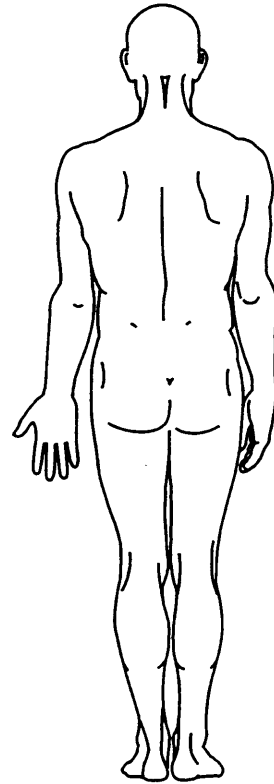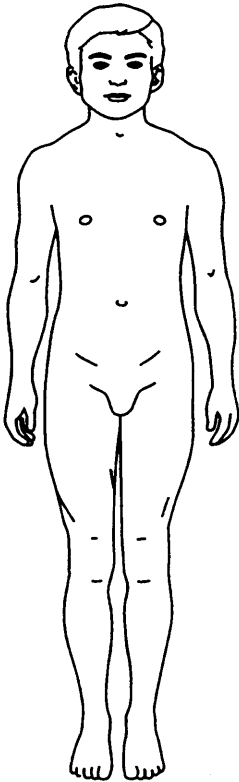

Duplicate columns 1-8
from the previous card.

Module 1 C Format 0 1
9 10 11 12

INJURY CLASSIFICATION IC-1

NOTE: Each line in the table below is a separate record (card).
Duplicate columns 1 - 12 for each completed line.

OCCUPANT INJURY CLASSIFICATION

					PRIMARY OIC					ASSOCIATED OIC					COMMENTS	
OCCUPANT NUMBER	INJURY NUMBER	PLACE CONTACTS IN ORDER OF PROBABILITY (HORIZONTALLY). START WITH MOST PROBABLE IN 1ST CONTACT AREA COLUMN.		AREA(S) OF POSSIBLE CONTACT 1ST 2ND	BODY REGION 1	ASPECT 2	LESION 3	SYSTEM/ORGAN 4	SEVERITY 5	BODY REGION 1	ASPECT 2	LESION 3	SYSTEM/ORGAN 4	SEVERITY 5		
		17-18	19-20													
13-14	15-16	17-18	19-20	COMMENTS	21	22	23	24	25	26	27	28	29	30		
02				No Injury												

NOTE: USE ADDITIONAL PAGES IF NECESSARY.

CODES FOR AREAS OF POSSIBLE OCCUPANT CONTACT

FRONT OF PASSENGER COMPARTMENT

- (10) SUNVISOR, FITTING(S) &/OR TOP MOLDING
- (12) WINDSHIELD
- (05) INSTRUMENT PANEL (*SPECIFIC AREA UNKNOWN*)
- (54) UPPER INSTRUMENT PANEL (X)
- (55) MIDDLE INSTRUMENT PANEL (Y)
- (56) LOWER INSTRUMENT PANEL (Z)
- (81) ASH TRAY (*INSTRUMENT PANEL*)
- (02) GLOVE COMPARTMENT AREA
- (47) AIRBAG (ACRS) COMPARTMENT DOOR/COVER
- (57) BENEATH INSTRUMENT PANEL
- (53) PARCEL TRAY
- (48) KNEE RESTRAINT
- (86) VERTICAL CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (09) STEERING ASSEMBLY (*SPECIFIC AREA UNKNOWN*)
- (65) STEERING WHEEL
- (66) STEERING WHEEL COLUMN
- (59) TRANSMISSION LEVER ON COLUMN
- (03) HARDWARE ITEM (*SPECIFIC AREA UNKNOWN*)
- (82) INSTRUMENT(S)
- (83) CONTROL KNOB(S) & LEVER(S) (*FRONT*)
- (84) PARKING BRAKE HANDLE IN FRONT
- (67) IGNITION KEY
- (06) MIRROR
- (04) HEATER OR AIR CONDITIONING DUCTS
- (01) AIR CONDITIONING OR VENTILATION OUTLET(S)
- (08) RADIO (*BUILT IN*)
- (58) ADD-ON TAPE DECK, RADIO, A/C
- (68) ROOF MOUNTED CONTROLS/CONSOLES

REAR

- (88) SURFACE OF REAR INTERIOR
- (23) REAR WINDOW
- (39) REAR WINDOW HEADER
- (50) REAR SEAT CUSHION & BACK

INTERIOR-GENERAL

- (11) TRANSMISSION SELECTION LEVER (*LOCATION UNK.*)
- (59) TRANSMISSION LEVER ON STEERING COLUMN
- (44) TRANSMISSION LEVER ON FLOOR OR CONSOLE
- (07) PARKING BRAKE HANDLE (*LOCATION UNKNOWN*)
- (84) PARKING BRAKE HANDLE IN FRONT
- (85) PARKING BRAKE HANDLE ON FLOOR OR CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (29) FRONT SEAT-BACK(S)
- (51) FRONT SEAT CUSHION
- (50) REAR SEAT CUSHION & BACK
- (49) ARMREST ON SEAT
- (89) UNDER SEAT BOTTOM
- (33) RESTRAINT SYSTEM HARDWARE
- (34) RESTRAINT SYSTEM WEBBING
- (87) AIR CUSHION SKIN (AIRBAG)
- (47) AIRBAG (ACRS) COMPARTMENT DOOR/COVER
- (46) AIRBAG GAS
- (48) KNEE RESTRAINT
- (30) HEAD RESTRAINT
- (42) CHILD SEAT RESTRAINTS
- (43) CHILD SEAT
- (31) INTERIOR LOOSE OBJECT
- (32) OTHER OCCUPANT(S)
- (52) INTERNAL FLYING GLASS (*FROM ANY SOURCE*)
- (41) UNKNOWN INTERIOR SURFACE

SIDES

- (20) SURFACE OF SIDE INTERIOR
- (19) HARDWARE ON SIDE OR DOOR
- (13) ARMREST ON SIDE OR DOOR
- (24) COAT HOOK
- (22) WINDOW GLASS (*SIDE*)
- (21) WINDOW FRAMES (*SIDE*)
- (26) ROOF SIDE RAIL
- (14) A-PILLAR
- (15) B-PILLAR
- (16) C-PILLAR
- (17) D-PILLAR

FLOOR

- (40) FLOOR
- (27) CONSOLE ON FLOOR OR BETWEEN SEATS
- (44) TRANSMISSION LEVER ON FLOOR OR CONSOLE
- (85) PARKING BRAKE HANDLE ON FLOOR OR CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (91) KICKPANEL

ROOF

- (25) ROOF OR CONVERTIBLE TOP
- (10) SUNVISOR, FITTING(S) &/OR TOP MOLDING
- (26) ROOF SIDE RAIL
- (24) COAT HOOK
- (18) DOME LIGHT
- (39) BACKLIGHT HEADER
- (68) ROOF MOUNTED CONTROLS/CONSOLE
- (69) ROLL BAR

EXTERIOR SURFACE OF CASE VEHICLE

- (37) OUTSIDE SURFACE OF CASE VEHICLE (*SPECIFIC AREA UNKNOWN*)
- (35) HOOD OF CASE VEHICLE
- (60) EXTERIOR OF CASE VEHICLE (E.G. *OUTSIDE MIRRORS, ANTENNA, TRIM*)
- (62) EXTERIOR SIDE ROOF RAIL OF CASE VEHICLE
- (63) TRUNK LID OF CASE VEHICLE
- (64) TIRES OF CASE VEHICLE

BEYOND CASE VEHICLE BOUNDARY

- (36) AREA EXTERIOR TO CAR (*SPECIFIC AREA UNK.*)
- (70) HOOD OF OTHER VEHICLE
- (71) OTHER VEHICLE EXTERIOR HARDWARE (E.G. *OUTSIDE MIRRORS, ANTENNA, TRIM*)
- (73) EXTERIOR SIDE ROOF RAIL OF OTHER VEHICLE
- (74) HEADLIGHT OR FRONT GRILL OF OTHER VEH.
- (75) TRUNK OF OTHER VEHICLE
- (76) OUTSIDE SURFACE OF OTHER VEHICLE
- (77) TIRES OF OTHER VEHICLE
- (78) GROUND
- (79) WATER
- (80) EXTERIOR OBJECT (*NOT VEHICLE, GROUND, OR WATER. PLEASE DESCRIBE.*)

PENETRATING OBJECTS

- (61) OTHER VEHICLE
- (72) OBJECTS (*DESCRIBE*)

MISCELLANEOUS

- (00) NO CONTACT (*INVALID FIELD FORM CODE*)
- (38) OTHER (E.G. *FIRE. DESCRIBE*)
- (90) SPARE TIRE
- (96) INDUCED
- (97) EJECTED, UNKNOWN CONTACT
- (98) IMPACT FORCE, "WHIPLASH", HYPEREXTENSION/COMPRESSION
- (99) UNKNOWN AREA OF CONTACT

Duplicate columns 1-8
from the previous card.

Module 0 C Format 0 2
9 10 11 12

OCCUPANT INFORMATION OC-1

OCCUPANT IDENTIFICATION

OCCUPANT NUMBER

03
13 14

ROLE OF OCCUPANT AT 1ST IMPACT

- (1) MOTOR VEHICLE DRIVER
(2) MOTOR VEHICLE PASSENGER
(NOT DRIVER)
(9) UNKNOWN

2
15

PHYSICAL DESCRIPTION

AGE IN YEARS

- (00) LESS THAN 1 YEAR
(98) 98 YEARS OR OLDER
(99) UNKNOWN

11
20 21

AGE IN MONTHS

- (00) LESS THAN 1 MONTH
(25) 25 MONTHS OR OLDER
(99) UNKNOWN

25
22 23

MASS (kg)

- (999) UNKNOWN

(71 lb)

032
24 25 26

HEIGHT (cm)

- (999) UNKNOWN

(4 ft, 5 in)

135
27 28 29

SEX

- (1) MALE
(2) FEMALE
(9) UNKNOWN

1
30

OCCUPANT POSITION

ROW LOCATION

- (1) FRONT
(2) SECOND
(3) THIRD
(4) FOURTH
(7) OTHER: _____
(8) EXTERNAL TO PASSENGER
COMPARTMENT (E.G. BED OF PICKUP)
(9) UNKNOWN

2
16

LATERAL LOCATION

- (1) LEFT
(2) LEFT CENTER
(3) CENTER
(4) RIGHT CENTER
(5) RIGHT
(6) ALL (LYING ON SEAT)
(8) EXTERNAL TO PASSENGER
COMPARTMENT
(9) UNKNOWN

3
17

POSTURE

- (10) SITTING ON SEAT
(11) SITTING ON SEAT IN ABNORMAL
POSITION (E.G. FEET ON DASH,
SIDEWAYS)
(12) SITTING ON CONSOLE
(20) ON LAP OR IN ARMS
(30) STANDING ON SEAT
(40) STANDING ON FLOOR
(47) STANDING, EXTERNAL TO
PASSENGER COMPARTMENT
(50) IN BASSINET
(60) IN CHILD SEAT
(65) IN CHILD HARNESS
(70) LYING ON SEAT
(80) LYING/SITTING ON PASSENGER
FLOOR
(83) LYING/SITTING ON OTHER
OBJECT IN PASSENGER
COMPARTMENT: _____
(85) ON CARGO FLOOR/FOLDED
SEAT-BACK
(87) LYING/SITTING, EXTERNAL TO
PASSENGER COMPARTMENT
(97) OTHER: _____
(99) UNKNOWN

10
18 19

MEDICAL CONDITIONS

TREATMENT/MORTALITY

- (00) NONE
(01) FIRST AID AT SCENE
(02) TREATED AT HOSPITAL/CLINIC
BUT NOT ADMITTED
(03) HOSPITALIZED FOR OBSERVATION
LESS THAN 24 HOURS
(04) HOSPITALIZED OVER 24 HOURS
OR FOR SIGNIFICANT TREATMENT
(05) FATAL, DEAD AT SCENE
(06) FATAL, DOA
(07) FATAL, DEAD WITHIN 24 HOURS
(08) FATAL, DEAD 24 HOURS TO
31 DAYS LATER
(09) FATAL, DEAD 31 DAYS TO
1 YEAR LATER
(10) FATAL DEAD WITHIN UNKNOWN
PERIOD
(99) UNKNOWN

00
31 32

INJURY SEVERITY SCORE (ISS)

- (99) UNKNOWN

00
33 34

NON-IMPACT MED. CONDITIONS

- (0) NONE
(1) YES, TIME & TYPE UNKNOWN
(2) PRE-CRASH FATAL (CLINICAL
DEATH AT WHEEL)
(3) PRE-CRASH NON-FATAL (E.G.
PRIOR INJURY, STROKE)
(4) PREGNANT
(5) POST-CRASH FATAL (DROWNING)
(6) POST-CRASH NON-FATAL INJURY
(7) OTHER: _____
(8) COMBINATION OF ABOVE
(CIRCLE EACH)
(9) UNKNOWN

0
35

MEDICAL CONDITIONS (CONT.)

POLICE INJURY SEVERITY
CODE FOR THIS OCCUPANT

- (0) O - NO INJURY
- (1) C - POSSIBLE INJURY
- (2) B - NON-INCAPACITATING
- (3) A - INCAPACITATING INJURY
- (4) K - FATAL
- (5) INJURED, SEVERITY UNKNOWN
- (6) DIED PRIOR TO IMPACT
- (7) NON-FATAL INJURY,
SEVERITY UNKNOWN
- (9) UNKNOWN

0
36

CHILD SEAT TYPE

- (00) NONE USED
- (01) YES, USED
- (02) INTEGRAL, Chrysler Mini-van
- (88) NOT APPLICABLE
(ADULT OR OLDER CHILD)
- (99) UNKNOWN

88
41 42

CHILD SEAT MAKE/MODEL

RESTRAINT SYSTEM

ACTIVE RESTRAINT SYSTEM

- (0) NONE
- (1) LAP BELT
- (2) SHOULDER HARNESS ONLY
- (3) BOTH LAP BELT &
SHOULDER HARNESS
- (9) UNKNOWN

1
37

ACTIVE RESTRAINT SYSTEM USAGE

- (0) NONE (AVAILABLE BUT NOT USED)
- (1) LAP BELT ONLY
- (2) SHOULDER HARNESS ONLY
- (3) BOTH LAP BELT &
SHOULDER HARNESS
- (7) IMPROPER USAGE
- (8) NOT APPLICABLE (NONE AVAILABLE)
- (9) UNKNOWN

1
38

PASSIVE RESTRAINT SYSTEM

- (0) NONE
- (1) AIRBAG INSTALLED
- (2) PASSIVE UPPER TORSO
WITH KNEE BOLSTERS
- (3) PASSIVE UPPER TORSO
WITHOUT KNEE BOLSTERS
- (4) PASSIVE LAP & UPPER TORSO
- (5) AIRBAG INSTALLED &
PASSIVE RESTRAINT
- (7) OTHER: _____
- (9) UNKNOWN

0
39

PASSIVE RESTRAINT SYSTEM USAGE

- (0) SYSTEM DEFEATED
- (1) AIRBAG NOT DEPLOYED
- (2) AIRBAG DEPLOYED
- (3) AIRBAG NOT REINSTALLED
- (4) PASSIVE UPPER TORSO USED
- (5) PASSIVE LAP & UPPER TORSO USED
- (6) SYSTEM USED IN MANUAL MODE
- (7) IMPROPER USAGE
- (8) NOT APPLICABLE (NOT ORIGINALLY
EQUIPPED)
- (9) UNKNOWN

8
40

EJECTION

DEGREE OF EJECTION

- (0) NONE
- (1) PARTIAL
- (2) COMPLETE
- (7) EJECTED, DEGREE UNKNOWN
- (9) UNKNOWN IF EJECTED

0
43

AREA OF EJECTION

- (01) WINDOW, LEFT SIDE
- (02) WINDOW, RIGHT SIDE
- (03) WINDOW, REAR
- (04) DOOR, LEFT SIDE
- (05) DOOR, RIGHT SIDE
- (06) DOOR, REAR OR TAILGATE
- (07) WINDSHIELD
- (08) ROOF OR OPEN CONVERTIBLE OR
FROM EXTERNAL AREA
- (96) EJECTED AREA UNKNOWN
- (97) OTHER AREA: _____
- (98) NOT APPLICABLE (NOT EJECTED)
- (99) UNKNOWN IF EJECTED

98
44 45IF OCCUPANT WAS EJECTED, DESCRIBE
IN DETAIL BELOW:

HEAD RESTRAINT

HEAD RESTRAINT AVAILABLE
FOR THIS POSITION

- (0) NOT EQUIPPED OR REMOVED
- (1) EQUIPPED
- (9) UNKNOWN

0
46

OCCUPANT INFORMATION OC-3

OCCUPANT EYEWEAR

- (0) NONE
- (1) GLASSES
- (2) CONTACTS
- (3) BOTH GLASSES AND CONTACTS
- (4) OTHER _____
- (8) NOT APPLICABLE
- (9) UNKNOWN

9
47



SOURCE OF INFORMATION

- ☒ INTERVIEW
- (1) HOSPITAL
- (2) AUTOPSY
- ☒ POLICE
- (4) OTHER _____
- (5) LAY CORONER/EXTERNAL EXAM
- (7) COMBINATION OF ABOVE (CIRCLE)
- (8) NOT APPLICABLE
- (9) UNKNOWN

2
48

INDICATE LOCATION OF INJURIES.

No reported injury

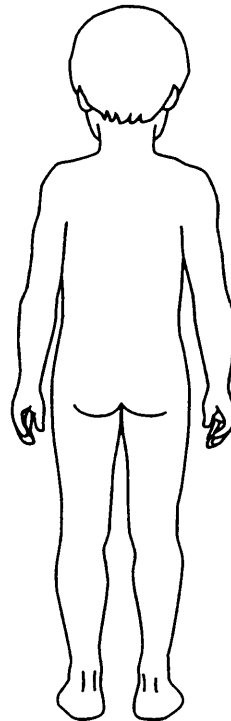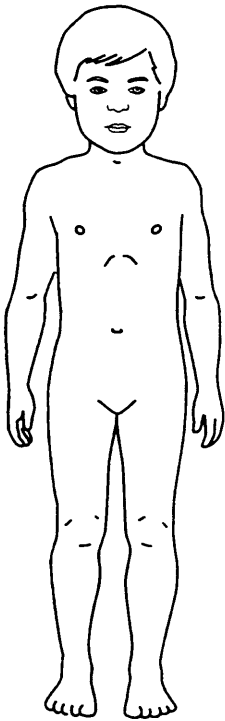

Duplicate columns 1-8
from the previous card.

Module 1 C Format 0 1
9 10 11 12

INJURY CLASSIFICATION IC-1

NOTE: Each line in the table below is a separate record (card).
Duplicate columns 1 - 12 for each completed line.

OCCUPANT INJURY CLASSIFICATION

					PRIMARY OIC					ASSOCIATED OIC					COMMENTS
OCCUPANT NUMBER	INJURY NUMBER	PLACE CONTACTS IN ORDER OF PROBABILITY (HORIZONTALLY). START WITH MOST PROBABLE IN 1ST CONTACT AREA COLUMN.		AREA(S) OF POSSIBLE CONTACT 1ST 2ND	BODY REGION 1	ASPECT 2	LESION 3	SYSTEM/ORGAN 4	SEVERITY 5	BODY REGION 1	ASPECT 2	LESION 3	SYSTEM/ORGAN 4	SEVERITY 5	
		17-18	19-20												
13-14	15-16	17-18	19-20	COMMENTS	21	22	23	24	25	26	27	28	29	30	
<u>03</u>	---	---	---	<p>No Injury</p>	---	---	---	---	---	---	---	---	---	---	
---	---	---	---		---	---	---	---	---	---	---	---	---	---	
---	---	---	---		---	---	---	---	---	---	---	---	---	---	
---	---	---	---		---	---	---	---	---	---	---	---	---	---	
---	---	---	---		---	---	---	---	---	---	---	---	---	---	
---	---	---	---		---	---	---	---	---	---	---	---	---	---	
---	---	---	---		---	---	---	---	---	---	---	---	---	---	
---	---	---	---		---	---	---	---	---	---	---	---	---	---	
---	---	---	---		---	---	---	---	---	---	---	---	---	---	
---	---	---	---		---	---	---	---	---	---	---	---	---	---	
---	---	---	---		---	---	---	---	---	---	---	---	---	---	
---	---	---	---		---	---	---	---	---	---	---	---	---	---	
---	---	---	---		---	---	---	---	---	---	---	---	---	---	
---	---	---	---		---	---	---	---	---	---	---	---	---	---	
---	---	---	---		---	---	---	---	---	---	---	---	---	---	
---	---	---	---		---	---	---	---	---	---	---	---	---	---	
---	---	---	---		---	---	---	---	---	---	---	---	---	---	
---	---	---	---		---	---	---	---	---	---	---	---	---	---	
---	---	---	---		---	---	---	---	---	---	---	---	---	---	

NOTE: USE ADDITIONAL PAGES IF NECESSARY.

CODES FOR AREAS OF POSSIBLE OCCUPANT CONTACT

FRONT OF PASSENGER COMPARTMENT

- (10) SUNVISOR, FITTING(S) &/OR TOP MOLDING
- (12) WINDSHIELD
- (05) INSTRUMENT PANEL (*SPECIFIC AREA UNKNOWN*)
- (54) UPPER INSTRUMENT PANEL (X)
- (55) MIDDLE INSTRUMENT PANEL (Y)
- (56) LOWER INSTRUMENT PANEL (Z)
- (81) ASH TRAY (*INSTRUMENT PANEL*)
- (02) GLOVE COMPARTMENT AREA
- (47) AIRBAG (ACRS) COMPARTMENT DOOR/COVER
- (57) BENEATH INSTRUMENT PANEL
- (53) PARCEL TRAY
- (48) KNEE RESTRAINT
- (86) VERTICAL CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (09) STEERING ASSEMBLY (*SPECIFIC AREA UNKNOWN*)
- (65) STEERING WHEEL
- (66) STEERING WHEEL COLUMN
- (59) TRANSMISSION LEVER ON COLUMN
- (03) HARDWARE ITEM (*SPECIFIC AREA UNKNOWN*)
- (82) INSTRUMENT(S)
- (83) CONTROL KNOB(S) & LEVER(S) (*FRONT*)
- (84) PARKING BRAKE HANDLE IN FRONT
- (67) IGNITION KEY
- (06) MIRROR
- (04) HEATER OR AIR CONDITIONING DUCTS
- (01) AIR CONDITIONING OR VENTILATION OUTLET(S)
- (08) RADIO (*BUILT IN*)
- (58) ADD-ON TAPE DECK, RADIO, A/C
- (68) ROOF MOUNTED CONTROLS/CONSOLES

REAR

- (88) SURFACE OF REAR INTERIOR
- (23) REAR WINDOW
- (39) REAR WINDOW HEADER
- (50) REAR SEAT CUSHION & BACK

INTERIOR-GENERAL

- (11) TRANSMISSION SELECTION LEVER (*LOCATION UNK.*)
- (59) TRANSMISSION LEVER ON STEERING COLUMN
- (44) TRANSMISSION LEVER ON FLOOR OR CONSOLE
- (07) PARKING BRAKE HANDLE (*LOCATION UNKNOWN*)
- (84) PARKING BRAKE HANDLE IN FRONT
- (85) PARKING BRAKE HANDLE ON FLOOR OR CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (29) FRONT SEAT-BACK(S)
- (51) FRONT SEAT CUSHION
- (50) REAR SEAT CUSHION & BACK
- (49) ARMREST ON SEAT
- (89) UNDER SEAT BOTTOM
- (33) RESTRAINT SYSTEM HARDWARE
- (34) RESTRAINT SYSTEM WEBBING
- (87) AIR CUSHION SKIN (*AIRBAG*)
- (47) AIRBAG (ACRS) COMPARTMENT DOOR/COVER
- (46) AIRBAG GAS
- (48) KNEE RESTRAINT
- (30) HEAD RESTRAINT
- (42) CHILD SEAT RESTRAINTS
- (43) CHILD SEAT
- (31) INTERIOR LOOSE OBJECT
- (32) OTHER OCCUPANT(S)
- (52) INTERNAL FLYING GLASS (*FROM ANY SOURCE*)
- (41) UNKNOWN INTERIOR SURFACE

SIDES

- (20) SURFACE OF SIDE INTERIOR
- (19) HARDWARE ON SIDE OR DOOR
- (13) ARMREST ON SIDE OR DOOR
- (24) COAT HOOK
- (22) WINDOW GLASS (*SIDE*)
- (21) WINDOW FRAMES (*SIDE*)
- (26) ROOF SIDE RAIL
- (14) A-PILLAR
- (15) B-PILLAR
- (16) C-PILLAR
- (17) D-PILLAR

FLOOR

- (40) FLOOR
- (27) CONSOLE ON FLOOR OR BETWEEN SEATS
- (44) TRANSMISSION LEVER ON FLOOR OR CONSOLE
- (85) PARKING BRAKE HANDLE ON FLOOR OR CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (91) KICKPANEL

ROOF

- (25) ROOF OR CONVERTIBLE TOP
- (10) SUNVISOR, FITTING(S) &/OR TOP MOLDING
- (26) ROOF SIDE RAIL
- (24) COAT HOOK
- (18) DOME LIGHT
- (39) BACKLIGHT HEADER
- (68) ROOF MOUNTED CONTROLS/CONSOLE
- (69) ROLL BAR

EXTERIOR SURFACE OF CASE VEHICLE

- (37) OUTSIDE SURFACE OF CASE VEHICLE (*SPECIFIC AREA UNKNOWN*)
- (35) HOOD OF CASE VEHICLE
- (60) EXTERIOR OF CASE VEHICLE (E.G. *OUTSIDE MIRRORS, ANTENNA, TRIM*)
- (62) EXTERIOR SIDE ROOF RAIL OF CASE VEHICLE
- (63) TRUNK LID OF CASE VEHICLE
- (64) TIRES OF CASE VEHICLE

BEYOND CASE VEHICLE BOUNDARY

- (36) AREA EXTERIOR TO CAR (*SPECIFIC AREA UNK.*)
- (70) HOOD OF OTHER VEHICLE
- (71) OTHER VEHICLE EXTERIOR HARDWARE (E.G. *OUTSIDE MIRRORS, ANTENNA, TRIM*)
- (73) EXTERIOR SIDE ROOF RAIL OF OTHER VEHICLE
- (74) HEADLIGHT OR FRONT GRILL OF OTHER VEH.
- (75) TRUNK OF OTHER VEHICLE
- (76) OUTSIDE SURFACE OF OTHER VEHICLE
- (77) TIRES OF OTHER VEHICLE
- (78) GROUND
- (79) WATER
- (80) EXTERIOR OBJECT (*NOT VEHICLE, GROUND, OR WATER. PLEASE DESCRIBE.*)

PENETRATING OBJECTS

- (61) OTHER VEHICLE
- (72) OBJECTS (*DESCRIBE*)

MISCELLANEOUS

- (00) NO CONTACT (*INVALID FIELD FORM CODE*)
- (38) OTHER (E.G. *FIRE. DESCRIBE*)
- (90) SPARE TIRE
- (96) INDUCED
- (97) EJECTED, UNKNOWN CONTACT
- (98) IMPACT FORCE, "WHIPLASH", HYPEREXTENSION/COMPRESSION
- (99) UNKNOWN AREA OF CONTACT

Duplicate columns 1-8
from the previous card.

Module 0 C Format 0 2
9 10 11 12

OCCUPANT INFORMATION OC-1

OCCUPANT IDENTIFICATION

OCCUPANT NUMBER

04
13 14

ROLE OF OCCUPANT AT 1ST IMPACT

- (1) MOTOR VEHICLE DRIVER
(2) MOTOR VEHICLE PASSENGER
(NOT DRIVER)
(9) UNKNOWN

2
15

OCCUPANT POSITION

ROW LOCATION

- (1) FRONT
(2) SECOND
(3) THIRD
(4) FOURTH
(7) OTHER: _____
(8) EXTERNAL TO PASSENGER
COMPARTMENT (E.G. BED OF PICKUP)
(9) UNKNOWN

2
16

LATERAL LOCATION

- (1) LEFT
(2) LEFT CENTER
(3) CENTER
(4) RIGHT CENTER
(5) RIGHT
(6) ALL (LYING ON SEAT)
(8) EXTERNAL TO PASSENGER
COMPARTMENT
(9) UNKNOWN

5
17

POSTURE

- (10) SITTING ON SEAT
(11) SITTING ON SEAT IN ABNORMAL
POSITION (E.G. FEET ON DASH,
SIDEWAYS)
(12) SITTING ON CONSOLE
(20) ON LAP OR IN ARMS
(30) STANDING ON SEAT
(40) STANDING ON FLOOR
(47) STANDING, EXTERNAL TO
PASSENGER COMPARTMENT
(50) IN BASSINET
(60) IN CHILD SEAT
(65) IN CHILD HARNESS
(70) LYING ON SEAT
(80) LYING/SITTING ON PASSENGER
FLOOR
(83) LYING/SITTING ON OTHER
OBJECT IN PASSENGER
COMPARTMENT: _____
(85) ON CARGO FLOOR/FOLDED
SEAT-BACK
(87) LYING/SITTING, EXTERNAL TO
PASSENGER COMPARTMENT
(97) OTHER: _____
(99) UNKNOWN

10
18 19

PHYSICAL DESCRIPTION

AGE IN YEARS

- (00) LESS THAN 1 YEAR
(98) 98 YEARS OR OLDER
(99) UNKNOWN

10
20 21

AGE IN MONTHS

- (00) LESS THAN 1 MONTH
(25) 25 MONTHS OR OLDER
(99) UNKNOWN

25
22 23

MASS (kg)

- (999) UNKNOWN

(71 lb)

032
24 25 26

HEIGHT (cm)

- (999) UNKNOWN

(4ft, 5in)

135
27 28 29

SEX

- (1) MALE
(2) FEMALE
(9) UNKNOWN

1
30

MEDICAL CONDITIONS

TREATMENT/MORTALITY

- (00) NONE
(01) FIRST AID AT SCENE
(02) TREATED AT HOSPITAL/CLINIC
BUT NOT ADMITTED
(03) HOSPITALIZED FOR OBSERVATION
LESS THAN 24 HOURS
(04) HOSPITALIZED OVER 24 HOURS
OR FOR SIGNIFICANT TREATMENT
(05) FATAL, DEAD AT SCENE
(06) FATAL, DOA
(07) FATAL, DEAD WITHIN 24 HOURS
(08) FATAL, DEAD 24 HOURS TO
31 DAYS LATER
(09) FATAL, DEAD 31 DAYS TO
1 YEAR LATER
(10) FATAL DEAD WITHIN UNKNOWN
PERIOD
(99) UNKNOWN

00
31 32

INJURY SEVERITY SCORE (ISS)

- (99) UNKNOWN

00
33 34

NON-IMPACT MED. CONDITIONS

- (0) NONE
(1) YES, TIME & TYPE UNKNOWN
(2) PRE-CRASH FATAL (CLINICAL
DEATH AT WHEEL)
(3) PRE-CRASH NON-FATAL (E.G.
PRIOR INJURY, STROKE)
(4) PREGNANT
(5) POST-CRASH FATAL (DROWNING)
(6) POST-CRASH NON-FATAL INJURY
(7) OTHER: _____
(8) COMBINATION OF ABOVE
(CIRCLE EACH)
(9) UNKNOWN

0
35

MEDICAL CONDITIONS (CONT.)

POLICE INJURY SEVERITY
CODE FOR THIS OCCUPANT

- (0) O - NO INJURY
 (1) C - POSSIBLE INJURY
 (2) B - NON-INCAPACITATING
 (3) A - INCAPACITATING INJURY
 (4) K - FATAL
 (5) INJURED, SEVERITY UNKNOWN
 (6) DIED PRIOR TO IMPACT
 (7) NON-FATAL INJURY,
 SEVERITY UNKNOWN
 (9) UNKNOWN

0
36

CHILD SEAT TYPE

- (00) NONE USED
 (01) YES, USED
 (02) INTEGRAL, Chrysler Mini-van
 (88) NOT APPLICABLE
 (ADULT OR OLDER CHILD)
 (99) UNKNOWN

8 8
41 42

CHILD SEAT MAKE/MODEL

RESTRAINT SYSTEM

ACTIVE RESTRAINT SYSTEM

- (0) NONE
 (1) LAP BELT
 (2) SHOULDER HARNESS ONLY
 (3) BOTH LAP BELT &
 SHOULDER HARNESS
 (9) UNKNOWN

3
37

ACTIVE RESTRAINT SYSTEM USAGE

- (0) NONE (AVAILABLE BUT NOT USED)
 (1) LAP BELT ONLY
 (2) SHOULDER HARNESS ONLY
 (3) BOTH LAP BELT &
 SHOULDER HARNESS
 (7) IMPROPER USAGE
 (8) NOT APPLICABLE (NONE AVAILABLE)
 (9) UNKNOWN

3
38

PASSIVE RESTRAINT SYSTEM

- (0) NONE
 (1) AIRBAG INSTALLED
 (2) PASSIVE UPPER TORSO
 WITH KNEE BOLSTERS
 (3) PASSIVE UPPER TORSO
 WITHOUT KNEE BOLSTERS
 (4) PASSIVE LAP & UPPER TORSO
 (5) AIRBAG INSTALLED &
 PASSIVE RESTRAINT
 (7) OTHER: _____
 (9) UNKNOWN

0
39

PASSIVE RESTRAINT SYSTEM USAGE

- (0) SYSTEM DEFEATED
 (1) AIRBAG NOT DEPLOYED
 (2) AIRBAG DEPLOYED
 (3) AIRBAG NOT REINSTALLED
 (4) PASSIVE UPPER TORSO USED
 (5) PASSIVE LAP & UPPER TORSO USED
 (6) SYSTEM USED IN MANUAL MODE
 (7) IMPROPER USAGE
 (8) NOT APPLICABLE (NOT ORIGINALLY
 EQUIPPED)
 (9) UNKNOWN

8
40

EJECTION

DEGREE OF EJECTION

- (0) NONE
 (1) PARTIAL
 (2) COMPLETE
 (7) EJECTED, DEGREE UNKNOWN
 (9) UNKNOWN IF EJECTED

0
43

AREA OF EJECTION

- (01) WINDOW, LEFT SIDE
 (02) WINDOW, RIGHT SIDE
 (03) WINDOW, REAR
 (04) DOOR, LEFT SIDE
 (05) DOOR, RIGHT SIDE
 (06) DOOR, REAR OR TAILGATE
 (07) WINDSHIELD
 (08) ROOF OR OPEN CONVERTIBLE OR
 FROM EXTERNAL AREA
 (96) EJECTED AREA UNKNOWN
 (97) OTHER AREA: _____
 (98) NOT APPLICABLE (NOT EJECTED)
 (99) UNKNOWN IF EJECTED

9 8
44 45

IF OCCUPANT WAS EJECTED, DESCRIBE
IN DETAIL BELOW:

HEAD RESTRAINT

HEAD RESTRAINT AVAILABLE
FOR THIS POSITION

- (0) NOT EQUIPPED OR REMOVED
 (1) EQUIPPED
 (9) UNKNOWN

0
46

OCCUPANT INFORMATION OC-3

OCCUPANT EYEWEAR

- (0) NONE
- (1) GLASSES
- (2) CONTACTS
- (3) BOTH GLASSES AND CONTACTS
- (4) OTHER _____
- (8) NOT APPLICABLE
- (9) UNKNOWN

9
47



SOURCE OF INFORMATION

- (0) INTERVIEW
- (1) HOSPITAL
- (2) AUTOPSY
- (3) POLICE
- (4) OTHER _____
- (5) LAY CORONER/EXTERNAL EXAM
- (7) COMBINATION OF ABOVE (CIRCLE)
- (8) NOT APPLICABLE
- (9) UNKNOWN

2
48

INDICATE LOCATION OF INJURIES.

No injury reported

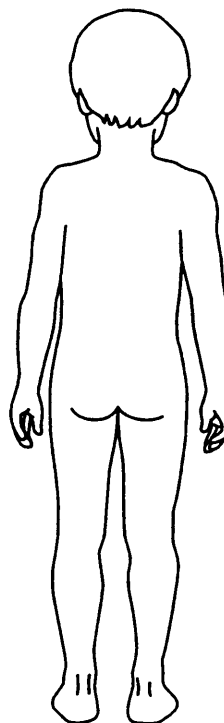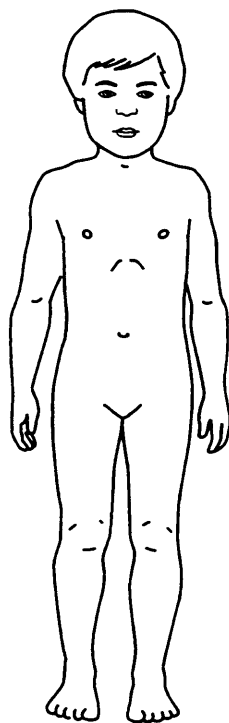

NOTE: Each line in the table below is a separate record (card). Duplicate columns 1 - 12 for each completed line.

OCCUPANT INJURY CLASSIFICATION

[illegible]

NOTE: USE ADDITIONAL PAGES IF NECESSARY.

CODES FOR AREAS OF POSSIBLE OCCUPANT CONTACT

FRONT OF PASSENGER COMPARTMENT

- (10) SUNVISOR, FITTING(S) &/OR TOP MOLDING
- (12) WINDSHIELD
- (05) INSTRUMENT PANEL (*SPECIFIC AREA UNKNOWN*)
- (54) UPPER INSTRUMENT PANEL (X)
- (55) MIDDLE INSTRUMENT PANEL (Y)
- (56) LOWER INSTRUMENT PANEL (Z)
- (81) ASH TRAY (*INSTRUMENT PANEL*)
- (02) GLOVE COMPARTMENT AREA
- (47) AIRBAG (ACRS) COMPARTMENT DOOR/COVER
- (57) BENEATH INSTRUMENT PANEL
- (53) PARCEL TRAY
- (48) KNEE RESTRAINT
- (86) VERTICAL CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (09) STEERING ASSEMBLY (*SPECIFIC AREA UNKNOWN*)
- (65) STEERING WHEEL
- (66) STEERING WHEEL COLUMN
- (59) TRANSMISSION LEVER ON COLUMN
- (03) HARDWARE ITEM (*SPECIFIC AREA UNKNOWN*)
- (82) INSTRUMENT(S)
- (83) CONTROL KNOB(S) & LEVER(S) (*FRONT*)
- (84) PARKING BRAKE HANDLE IN FRONT
- (67) IGNITION KEY
- (06) MIRROR
- (04) HEATER OR AIR CONDITIONING DUCTS
- (01) AIR CONDITIONING OR VENTILATION OUTLET(S)
- (08) RADIO (*BUILT IN*)
- (58) ADD-ON TAPE DECK, RADIO, A/C
- (68) ROOF MOUNTED CONTROLS/CONSOLES

REAR

- (88) SURFACE OF REAR INTERIOR
- (23) REAR WINDOW
- (39) REAR WINDOW HEADER
- (50) REAR SEAT CUSHION & BACK

INTERIOR-GENERAL

- (11) TRANSMISSION SELECTION LEVER (*LOCATION UNK.*)
- (59) TRANSMISSION LEVER ON STEERING COLUMN
- (44) TRANSMISSION LEVER ON FLOOR OR CONSOLE
- (07) PARKING BRAKE HANDLE (*LOCATION UNKNOWN*)
- (84) PARKING BRAKE HANDLE IN FRONT
- (85) PARKING BRAKE HANDLE ON FLOOR OR CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (29) FRONT SEAT-BACK(S)
- (51) FRONT SEAT CUSHION
- (50) REAR SEAT CUSHION & BACK
- (49) ARMREST ON SEAT
- (89) UNDER SEAT BOTTOM
- (33) RESTRAINT SYSTEM HARDWARE
- (34) RESTRAINT SYSTEM WEBBING
- (87) AIR CUSHION SKIN (*AIRBAG*)
- (47) AIRBAG (ACRS) COMPARTMENT DOOR/COVER
- (46) AIRBAG GAS
- (48) KNEE RESTRAINT
- (30) HEAD RESTRAINT
- (42) CHILD SEAT RESTRAINTS
- (43) CHILD SEAT
- (31) INTERIOR LOOSE OBJECT
- (32) OTHER OCCUPANT(S)
- (52) INTERNAL FLYING GLASS (*FROM ANY SOURCE*)
- (41) UNKNOWN INTERIOR SURFACE

SIDES

- (20) SURFACE OF SIDE INTERIOR
- (19) HARDWARE ON SIDE OR DOOR
- (13) ARMREST ON SIDE OR DOOR
- (24) COAT HOOK
- (22) WINDOW GLASS (*SIDE*)
- (21) WINDOW FRAMES (*SIDE*)
- (26) ROOF SIDE RAIL
- (14) A-PILLAR
- (15) B-PILLAR
- (16) C-PILLAR
- (17) D-PILLAR

FLOOR

- (40) FLOOR
- (27) CONSOLE ON FLOOR OR BETWEEN SEATS
- (44) TRANSMISSION LEVER ON FLOOR OR CONSOLE
- (85) PARKING BRAKE HANDLE ON FLOOR OR CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (91) KICKPANEL

ROOF

- (25) ROOF OR CONVERTIBLE TOP
- (10) SUNVISOR, FITTING(S) &/OR TOP MOLDING
- (26) ROOF SIDE RAIL
- (24) COAT HOOK
- (18) DOME LIGHT
- (39) BACKLIGHT HEADER
- (68) ROOF MOUNTED CONTROLS/CONSOLE
- (69) ROLL BAR

EXTERIOR SURFACE OF CASE VEHICLE

- (37) OUTSIDE SURFACE OF CASE VEHICLE (*SPECIFIC AREA UNKNOWN*)
- (35) HOOD OF CASE VEHICLE
- (60) EXTERIOR OF CASE VEHICLE (E.G. *OUTSIDE MIRRORS, ANTENNA, TRIM*)
- (62) EXTERIOR SIDE ROOF RAIL OF CASE VEHICLE
- (63) TRUNK LID OF CASE VEHICLE
- (64) TIRES OF CASE VEHICLE

BEYOND CASE VEHICLE BOUNDARY

- (36) AREA EXTERIOR TO CAR (*SPECIFIC AREA UNK.*)
- (70) HOOD OF OTHER VEHICLE
- (71) OTHER VEHICLE EXTERIOR HARDWARE (E.G. *OUTSIDE MIRRORS, ANTENNA, TRIM*)
- (73) EXTERIOR SIDE ROOF RAIL OF OTHER VEHICLE
- (74) HEADLIGHT OR FRONT GRILL OF OTHER VEH.
- (75) TRUNK OF OTHER VEHICLE
- (76) OUTSIDE SURFACE OF OTHER VEHICLE
- (77) TIRES OF OTHER VEHICLE
- (78) GROUND
- (79) WATER
- (80) EXTERIOR OBJECT (*NOT VEHICLE, GROUND, OR WATER. PLEASE DESCRIBE.*)

PENETRATING OBJECTS

- (61) OTHER VEHICLE
- (72) OBJECTS (*DESCRIBE*)

MISCELLANEOUS

- (00) NO CONTACT (*INVALID FIELD FORM CODE*)
- (38) OTHER (E.G. *FIRE. DESCRIBE*)
- (90) SPARE TIRE
- (96) INDUCED
- (97) EJECTED, UNKNOWN CONTACT
- (98) IMPACT FORCE, "WHIPLASH", HYPEREXTENSION/COMPRESSION
- (99) UNKNOWN AREA OF CONTACT





Tissue: 10-100 mg specimen (cells or tissue) in 2-3 ml lysis buffer

Year	Number of cases	Percentage of cases
1990	10	10.0
1991	15	15.0
1992	20	20.0
1993	25	25.0
1994	30	30.0
1995	35	35.0
1996	40	40.0
1997	45	45.0
1998	50	50.0
1999	55	55.0
2000	60	60.0
2001	65	65.0
2002	70	70.0
2003	75	75.0
2004	80	80.0
2005	85	85.0
2006	90	90.0
2007	95	95.0
2008	100	100.0
2009	105	105.0
2010	110	110.0
2011	115	115.0
2012	120	120.0
2013	125	125.0
2014	130	130.0
2015	135	135.0
2016	140	140.0
2017	145	145.0
2018	150	150.0
2019	155	155.0
2020	160	160.0
2021	165	165.0
2022	170	170.0
2023	175	175.0
2024	180	180.0
2025	185	185.0
2026	190	190.0
2027	195	195.0
2028	200	200.0
2029	205	205.0
2030	210	210.0
2031	215	215.0
2032	220	220.0
2033	225	225.0
2034	230	230.0
2035	235	235.0
2036	240	240.0
2037	245	245.0
2038	250	250.0
2039	255	255.0
2040	260	260.0
2041	265	265.0
2042	270	270.0
2043	275	275.0
2044	280	280.0
2045	285	285.0
2046	290	290.0
2047	295	295.0
2048	300	300.0
2049	305	305.0
2050	310	310.0
2051	315	315.0
2052	320	320.0
2053	325	325.0
2054	330	330.0
2055	335	335.0
2056	340	340.0
2057	345	345.0
2058	350	350.0
2059	355	355.0
2060	360	360.0
2061	365	365.0
2062	370	370.0
2063	375	375.0
2064	380	380.0
2065	385	385.0
2066	390	390.0
2067	395	395.0
2068	400	400.0
2069	405	405.0
2070	410	410.0
2071	415	415.0
2072	420	420.0
2073	425	425.0
2074	430	430.0
2075	435	435.0
2076	440	440.0
2077	445	445.0
2078	450	450.0
2079	455	455.0
2080	460	460.0
2081	465	465.0
2082	470	470.0
2083	475	475.0
2084	480	480.0
2085	485	485.0
2086	490	490.0
2087	495	495.0
2088	500	500.0
2089	505	505.0
2090	510	510.0
2091	515	515.0
2092	520	520.0
2093	525	525.0
2094	530	530.0
2095	535	535.0
2096	540	540.0
2097	545	545.0
2098	550	550.0
2099	555	555.0
2100		

© 2005 Blackwell Publishing Ltd, *Journal of Internal Medicine* 258: 105–112

[Largest Online Market](#)
[Buyer's Guide](#)

Figure 1

Year	2000	2001	2002
2000	100	100	100
2001	100	100	100
2002	100	100	100

Abstract



PN 16400-1



PN 16400 #2



PN 16400 #3
Best Available



PN 16400 #4
Best Available




PN 16400 #5



PN 16400 #8
Best Available



PN 16400 #7
Best Available

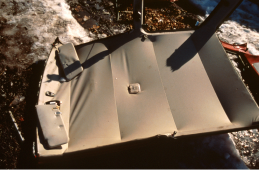

PN 16400#8



PN 16400 #9



PN 16400#10
Best Available



PN 16400 #11
Best Available



PN 16400#12
Best Available



PN 16400 #13
Best Available



PN 16400#14
Best Available



PN 18400 #15
Best Available



PN 16400 #16
Best Available



PN 16400 #17
Best Available



PN 16400#18
Best Available



PN 16400 #19
Best Available



PN 16400 #20



PN 16400 #21
Best Available



PN 16400 #22
Best Available



PN 16400 #23
Best Available



PN 16400 #24
Best Available



PN 16400 #25



FN 16400 #26
Best Available




PN 16400 #27
Best Available



PN 16400 #28
Best Available



PN 16400 #29

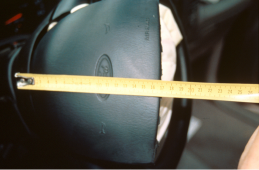

PN 16400 #30



PN 16400 #31



PN 16400#32



PN 16400 #33



PN 16400 #34



PN 16400 #35



PN 16400 #36
Best Available



PN 16400 #37
Best Available



PN 16400 #38



PN 16400 #39



PN 16400 #40



PN 16400 #41



PN 16400 #42



PN 16400 #43



PN 16400 #44



PN 16400-#45



PN 16400 #46



PN 16400 #47



PN 18400 #48



PN 16400 #49



PN 16400 #50



PN 16400-#51



PN 16400 #52



PN 16400 #53



PN 16400 #54
Best Available



PN 16400 #55



PN 16400 #56



PN 16400 #57



PN 16400 #58



PN 16400-#59



PN 16400 #60



PN 16400 #61



PN 16400 #62



PN 16400 #63



PN 16400 #64



PN 16400 #65



PN 16400 #66



PN 16400 #87



PN 16400 #68



PN 16400-#69



PN 16400 #70



PN 16400 #71



PN 16400 #72




PN 16400 #73



PN 16400-#74



PN 16400 #75

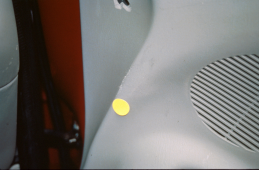

PN 16400 #76



PN 16400 #77



PN 16400-#78



PN 16400 #79



PN 16400 #80



PN 16400 #81



PN 16400 #82



PN 16400 #83



PN 16400 #84



PN 16400 #85



PN 16400 #86



PN 16400 #87

CASE NO.: 194-99

CASE VEHICLE: 1998 Ford

TYPE: P-1600 EIT Super cab 4 x 2, 3-door pickup

OCCUPANT: Driver, 43-year old female

STATURE: 157 cm (5 ft, 0 in) MASS: 66 kg (145 lbs)

RESTRAINTS: 3-point belt worn, airbag deployed

SEVERITY: MAIS - 0, ISS - 0

No reported injury



CASE NO.: 16400

CASE VEHICLE: 1998 Ford

TYPE: R-4 (p. 8), T Super (p. 4 & 5), 3-door pickup

OCCUPANT: Right front; 16-year-old male

STAFF: [REDACTED] (p. 5 & 6), [REDACTED] (p. 11)

RESTRAINTS: 3-point seat belt; airbag deployed

SEVERITY: MAJOR - 0 MINOR - 0

No reported injury



CASE NO.: PN400

CASE VEHICLE: 1988 Ford

TYPE: R-1 50 ML, 1 Super cab, 3 door pickup

CRUISEWAY: Center seat, 11-year-old male

SEATING: 120 inch H PL, 5 RD, 1990, 33 inch W, 80

RESTRAINTS: Lap belt worn

SEVERITY: 100% - 0 - 000 - 0

No reported injury



CASE NO.: 164-00

CASE VEHICLE: 1998 Ford

TYPE: 4-door (4.0 Super cab, 3-door pickup)

OCCUPANT: Right rear 16-year-old male

STATURE: 128 cm (4 ft, 2 in) MASS: 33 kg (71 lbs)

RESTRAINTS: 3-point seat belt

SEVERITY: MAIS - 0; AIS - 0

No injury reported

